



FINAL REPORT

FOUNDATION INVESTIGATION REPORT

**Installation of High Tension Cable Median Barrier at Hwy 401, Windsor to
London, Interchanges of Essex Rd. 42 (Sta. 16+200 Tilbury W) and
Victoria Rd. (Sta. 11+200 Howard Twp)**

**Agreement No. 3015-E-0017
Assignment No. 8
WP 3102-15-00
Geocres No. 40J8-69**

Prepared for:

Ontario Ministry of Transportation
Regional Director's Office -West Region
Geotechnical Section
659 Exeter Road
London, ON N6E 1L3
Attn: Kane Erickson, P.Eng.

Ontario Ministry of Transportation
Pavements and Foundations Section
Materials Engineering and Research Office, Room 223, 2/F
145 Sir William Hearst Avenue
Toronto, ON M3M 0B6
Attn: David Staseff, P.Eng.

exp Services Inc.
January 24, 2018

Ministry of Transportation

Western Region – Geotechnical Section

Foundation Investigation Report

Agreement No. 3015-E-0017

Assignment No. 8

WP 3102-15-00

Geocres No. 40J8-69

Type of Document:

FINAL

Project Name:

Installation of High Tension Cable Median Barrier at Hwy 401, Windsor to London-
Interchanges of Essex Rd. 42 (Sta. 16+200 Tilbury W) and Victoria Rd. (Sta. 11+200 Howard Twp.)

Project Number:

ADM-00235197-L0

Prepared By:

Silvana Micic, Ph.D., P.Eng.

Jia He, M.Eng., E.I.T.

Reviewed By:

TaeChul Kim, M.E.Sc., P.Eng.

Stan E. Gonsalves, M.Eng., P.Eng.

exp Services Inc.

56 Queen St, East, Suite 301

Brampton, ON L6V 4M8

Canada



Silvana Micic, Ph.D., P.Eng.
Senior Geotechnical Engineer



Stan E. Gonsalves, M.Eng., P.Eng.
Principal Engineer
Designated MTO Foundation Contact

Date Submitted:

1/24/2018

Table of Contents

1	FOUNDATION INVESTIGATION REPORT	1
1.1	Introduction	1
1.2	Site Description and Geological Setting	1
1.2.1	Site Description	1
1.2.2	Geological Setting	1
1.3	Investigation Procedures	2
1.3.1	General	2
1.3.2	Laboratory Testing	4
1.4	Subsurface Conditions	4
1.4.1	Segment 1 – Essex Rd. 42 to Drake Rd.	5
1.4.2	Segment 2 - Drake Rd. to Charing Cross Rd.	8
1.4.3	Segment 3 - County Charing Cross Rd. to Harwich Rd.	10
1.4.4	Segment 4 - Harwich Rd. to Scane Rd.	14
1.4.5	Segment 5 - Scane Rd. to Victoria Rd.	16
1.5	Groundwater Conditions	19

Appendices:

Appendix A	–	Photographs
Appendix B	–	Drawings
Appendix C	–	Borehole Logs
Appendix D	–	Laboratory Data

1 FOUNDATION INVESTIGATION REPORT

1.1 Introduction

This report presents the results of a geotechnical investigation carried out by **exp** Services Inc. (**exp**) for installation of High Tension Cable Median Barrier (HTCMB) at Hwy 401 from Windsor to London, Southern Ontario; in particular, from the interchange of Essex Rd. 42 (Sta. 16+200 Tilbury W) to the interchange of Victoria Rd. (Sta. 11+200 Howard Twp.), a distance of approximately 52 km. The work was undertaken under Agreement # 3015-E-0017, Assignment No. 8. The terms of reference (TOR) were as presented in the Ministry of Transportation (MTO) email received on October 24, 2017.

The purpose of this investigation is to obtain information on soil type, soil strength and water table elevation such that the manufacturer of end terminals for the HTCMB can adequately design their end terminals and anchor systems for use in Southern Ontario. The site geotechnical investigation consisted of drilling of boreholes approximately every km, soil sampling, and laboratory testing.

This foundation investigation report has been prepared specifically and solely for the project described herein. It contains the factual results of the investigation and the laboratory testing completed for this project.

1.2 Site Description and Geological Setting

1.2.1 Site Description

The investigation site is located along Hwy 401 between Windsor and London, Southern Ontario, from the interchange of Essex Rd. 42 (Sta. 16+200 Tilbury W) to the interchange of Victoria Rd. (Sta. 11+200 Howard Twp.) (see Key Map on drawings in Appendix B). The total of investigated area is approximately 52 km long. At the site location, Hwy 401 is oriented at an east-west direction and the WBL and EBL are separated by a median ditch having the slope of between 4H:1V and 6H:1V toward the middle. The other interchanges within the area are County Rd. 27 (Bloomfield Rd.), Communication Rd. and Kent Bridge Rd. The terrain in the immediate vicinity is relatively flat-lying agricultural lands. Photographs of the site made during this investigation are included in Appendix A.

1.2.2 Geological Setting

The Map 2556 (Quaternary Geology of Ontario, Southern Sheet, 1991) of the Ministry of Natural Resources indicates that the project area is situated within three Physiographic regions (Glaciolacustrine deposits consisting of sand, gravelly sand and gravel of nearshore and beach deposits from east limit of project area to Bloomfield Rd; Lacustrine deposits consisting of silt and clay of basin or quiet water deposits from Bloomfield Rd to Merlin Rd; and Tavistock Till consisting of sandy silt to silt matrix to silty clay matrix with moderate to high carbonate content from Merlin Rd to west limit of project area). The Map 2544 (Bedrock Geology of Ontario, Southern Sheet, 1991) of the Ministry of Northern Development and Mines, indicates that the bedrock in the project site is reported to consist of shale of the Kettle Point

Formation of Upper Devonian Age from east limit of project area to Merlin Rd. and limestone of the Hamilton Group of Middle Devonian Age from Merlin Rd to west limit of project area.

1.3 Investigation Procedures

1.3.1 General

The field investigation was performed between November 20 and December 22, 2017. The field program consisted of drilling fifty-two (52) sampled boreholes drilled approximately every km within the stretch of 52 km. The boreholes were strategically located into the median of Hwy 401 as proposed on the draft design and draft contract standards office drawings (DCSOD 200.041, 200.046, 200.065 and 913-264) provided by MTO. The drawings are attached in Appendix E. Based on these drawings the boreholes were drilled about 1.2 m away from the top of the median slope. The borehole locations are shown on Drawings 1 to 5 in Appendix B. The Table 1.1 below summarizes the borehole locations, ground surface elevations at borehole locations and borehole depths:

Table 1.1. Borehole information

Borehole	Location	MTM Coordinates		Ground Surface Elevation (m)	Borehole Depth (m)
		Northing	Easting		
BH17-52	EBL Median	4680908.59	309283.01	178.6	4.3
BH17-51	EBL Median	4680925.17	309913.81	177.4	4.3
BH17-50	WBL Median	4681316.32	310948.21	177.6	4.3
BH17-49	WBL Median	4681512.44	311741.18	177.7	4.3
BH17-48	WBL Median	4681701.67	312603.20	177.7	4.3
BH17-47	WBL Median	4682000.09	313882.82	179.3	4.3
BH17-46	WBL Median	4682201.47	314741.62	179.1	4.3
BH17-45	WBL Median	4682420.92	316307.63	179.2	4.3
BH17-44	WBL Median	4683081.20	317107.54	179.1	4.3
BH17-43	WBL Median	4683713.30	317805.72	179.3	4.3
BH17-42	WBL Median	4684348.05	318513.36	178.0	4.3
BH17-41	WBL Median	4685056.48	319449.57	177.8	4.3
BH17-40	WBL Median	4685561.12	320374.16	178.8	4.3
BH17-39	WBL Median	4685763.16	320746.72	178.4	4.3
BH17-38	WBL Median	4686302.67	321827.66	178.4	4.3
BH17-37	WBL Median	4686382.47	322626.41	178.1	4.3
BH17-36	WBL Median	4686491.85	323905.99	178.7	4.3
BH17-35	WBL Median	4686803.27	324678.76	178.4	4.3
BH17-34	EBL Median	4687233.23	325780.24	179.8	4.3
BH17-33	EBL Median	4687618.69	326723.66	179.8	4.3
BH17-32	EBL Median	4687973.27	327589.40	179.8	4.3

Borehole	Location	MTM Coordinates		Ground Surface Elevation (m)	Borehole Depth (m)
		Northing	Easting		
BH17-31	EBL Median	4688352.41	328509.43	179.2	4.4
BH17-30	EBL Median	4688779.93	329301.86	179.2	4.3
BH17-29	EBL Median	4689539.81	330125.75	180.1	4.3
BH17-28	EBL Median	4690386.06	331030.64	181.4	4.4
BH17-27	EBL Median	4690835.98	331606.91	180.1	4.4
BH17-26	EBL Median	4691389.89	332514.86	181.4	4.4
BH17-25	EBL Median	4691848.80	333617.65	182.0	4.4
BH17-24	EBL Median	4692184.21	334512.95	182.3	4.3
BH17-23	EBL Median	4692559.68	335483.98	183.2	4.3
BH17-22	EBL Median	4692840.06	336197.49	183.5	4.3
BH17-21	EBL Median	4693358.73	337493.92	184.4	4.3
BH17-20	WBL Median	4693884.47	338856.85	183.5	4.3
BH17-19	WBL Median	4694146.73	339602.70	184.1	4.3
BH17-18	WBL Median	4694388.09	340287.09	185.3	4.3
BH17-17	WBL Median	4694761.52	341335.00	185.9	4.3
BH17-16	WBL Median	4695060.58	342159.24	187.2	4.3
BH17-15	WBL Median	4695462.59	343176.73	188.4	4.3
BH17-14	WBL Median	4696058.10	343832.68	188.7	4.3
BH17-13	WBL Median	4696744.72	344561.14	188.4	4.3
BH17-12	WBL Median	4697510.27	345368.04	189.3	4.3
BH17-11	WBL Median	4698101.89	345967.93	189.9	4.3
BH17-10	WBL Median	4698794.16	346681.49	188.7	4.4
BH17-09	WBL Median	4699534.92	347432.60	188.1	4.3
BH17-08	WBL Median	4700163.44	348093.27	188.4	4.4
BH17-07	WBL Median	4700897.84	348858.20	188.7	4.3
BH17-06	WBL Median	4701567.34	349567.06	188.7	4.3
BH17-05	WBL Median	4702144.10	350185.42	190.2	4.3
BH17-04	WBL Median	4702855.36	350925.36	191.5	4.3
BH17-03	WBL Median	4703594.69	351747.43	191.4	4.3
BH17-02	WBL Median	4704205.76	352427.61	194.5	4.3
BH17-01	WBL Median	4704875.85	353168.98	193.5	4.3

The borehole locations (referenced to the MTM NAD83 coordinate system) and their ground surface elevations were surveyed by **exp** personnel. Coordinates were determined using a GPS, while a leveling instrument was used to determine ground surface elevations at boreholes relative to the adjacent edge of highway pavement.

The boreholes were advanced using a geoprobe truck mounted drill rig (Model 7822DT), equipped with a hollow stem augers and casing. All borehole drilling and sampling operations were performed by a specialist drilling contractor, Landshark Drilling.

During the drilling of boreholes, soil samples were obtained using a 51 mm outside diameter (O.D.) split-spoon sampler in accordance with Standard Penetration Test (SPT) procedures (ASTM D 1586), at intervals shown on the attached borehole logs (Appendix C). The original field (uncorrected) SPT “N” values were recorded on the borehole logs as recommended in the Canadian Foundation Engineering Manual (CFEM pg. 40), and used to provide an assessment of in-situ consistency of cohesive soils or relative density of non-cohesive soils. Pocket penetrometer tests were performed on split spoon samples of cohesive soils to assess undrained shear strength of that soil. In addition, field vane testing was conducted in some boreholes to measure an in-situ undrained shear strength of cohesive soils.

Upon completion of the drilling operations, groundwater level measurements were carried out in the open holes. The boreholes were decommissioned by bentonite/cement mixtures in accordance with the Ministry of the Environment Regulation 903, as amended by Regulation 128/03 (the well regulation under the Ontario Water Resources Act).

The fieldwork was supervised by a member of **exp**'s engineering staff who directed the drilling and sampling operation, logged borehole data in accordance with MTO and/or ASTM standards for soils classification, and retrieved soil samples for subsequent laboratory testing and identification.

All the recovered soil samples were placed in labelled moisture-proof bags and returned to **exp**'s London laboratory for additional visual, textual and olfactory examination, and sampling for laboratory testing.

1.3.2 Laboratory Testing

The laboratory testing program included the determination of natural moisture content and particle size distribution for approximately 25% of the collected soil samples. Atterberg Limits tests were carried out on selected cohesive soil samples. All the laboratory tests were carried out in accordance with MTO and/or ASTM standards as appropriate.

1.4 Subsurface Conditions

The detailed subsurface soil and groundwater conditions encountered in the boreholes advanced during this investigation, together with the results of the laboratory tests carried out on selected soil samples, are presented on the borehole log sheets in Appendix C. The “Explanation of Terms Used in Report” preceding the borehole logs in Appendix C forms an integral part of and should be read in conjunction with this report.

A borehole location plan and stratigraphic section along the Hwy 401 is provided in Appendix B. It should be noted that the stratigraphic boundaries indicated on the borehole logs and stratigraphic section are inferred from non-continuous sampling, observations of drilling progress and results of Standard Penetration Tests. These boundaries typically represent transitions from one soil type to another and

should not be regarded as exact planes of geological change. Further, subsurface conditions may vary between and beyond the borehole locations.

1.4.1 Segment 1 – Essex Rd. 42 to Drake Rd.

A total of seventeen (17) boreholes were drilled within the segment Essex Rd. 42 to Drake Rd. (BH17-52 to BH17-36) along median slope of Hwy 401.

The general stratigraphy encountered within the investigated depths of boreholes indicate the following sub-surface sequence: sand and gravel fill underlain by silty clay fill followed by native silty clay/clayey silt. A detailed description of the stratigraphy encountered in the boreholes is discussed further in subsequent sections.

1.4.1.1 Fill: Sand and Gravel

A sand and gravel fill layer was encountered at the surface of all boreholes drilled within this segment. The fill layer extended to depth about 0.8 m below ground surface with elevations ranging between 176.6 m to 178.5 m. The explored thickness of this layer was about 0.8 m.

The composition of this fill layer is sand and gravel, trace to few silt, trace topsoil, and trace asphalt inclusions. The SPT “N” values from four samples taken within this layer ranged from 9 to 26 blows per 0.3 m penetration, suggesting loose to compact relative density. The grain size distribution test performed on selected sample (BH17-37, SS1), which shown 41% gravel, 50% sand and 9% silt and clay. The results of the grain size distribution test performed are also provided on Figure 1 in Appendix D.

1.4.1.2 Fill: Silty Clay

A silty clay fill layer was encountered below sand and gravel fill in all boreholes drilled within this segment. The approximate elevations of the surface and base, thickness, moisture content, SPT ‘N’ value and undrained shear strength of the fill as encountered in boreholes are summarized in Table 1.2 below:

Table 1.2. Summary of silty clay fill layer

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m)	Moisture Content Range (%)		SPT ‘N’ Value Range		Undrained Shear Strength (kPa)		
	Top	Bottom			Min.	Max.	Min.	Max.	Vane Test	Pocket Penetrometer Test	
										Min.	Max.
17-52	177.8	174.5	0.8	3.3	22	27	5	17	-	60	215
17-51	176.6	174.8	0.8	1.8	16	24	8	20	-	144	215
17-50	176.8	175.3	0.8	1.5	24	28	5	8	-	144	-
17-49	176.9	174.6	0.8	2.3	17	25	7	10	-	132	215
17-48	176.9	175.4	0.8	1.5	20	22	10	11	-	120	156
17-47	177.5	176.0	0.8	1.5	25	26	5	7	-	84	120

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m)	Moisture Content Range (%)		SPT 'N' Value Range		Undrained Shear Strength (kPa)		
	Top	Bottom			Min.	Max.	Min.	Max.	Vane Test	Pocket Penetrometer Test	
										Min.	Max.
17-46	178.3	176.0	0.8	2.3	20	26	5	10	-	120	192
17-45	178.4	176.1	0.8	2.3	18	28	8	12	-	96	215
17-44	178.3	176.8	0.8	1.5	25	26	7	8	-	84	120
17-43	178.5	177.0	0.8	1.5	24	29	8	9	-	144	-
17-42	177.2	175.4	0.8	1.8	25	27	5	6	-	60	120
17-41	177.0	176.3	0.8	0.7	27	-	10	-	-	132	-
17-40	178.0	175.7	0.8	2.3	16	26	8	12	-	60	168
17-39	177.6	176.9	0.8	0.7	25	-	8	-	-	180	-
17-38	177.6	176.1	0.8	1.5	26	-	7	-	-	72	84
17-37	177.3	175.8	0.8	1.5	20	25	7	11	-	96	120
17-36	177.9	176.4	0.8	1.5	20	26	5	8	-	96	192

Laboratory testing performed on selected samples from this fill layer are summarized on Table 1.3 below:

Table 1.3. Laboratory test results for selected samples from silty clay fill layer

Borehole	Sample	Depth (m)	Atterberg Limits			Grain Size Distribution			
			W _L	W _P	I _P	Gravel	Sand	Silt	Clay
17-52	4	3.05-3.51	44	22	22	1	16	39	44
17-49	1	0.76-1.22	-	-	-	1	17	37	
17-46	2	1.52-1.98	-	-	-	2	19	79	
17-43	3	2.29-2.74	51	22	29	1	11	36	52
17-35	2	1.52-1.98	-	-	-	0	9	41	50

W_L= Liquid Limit; W_P= Plastic Limit; I_P= Plasticity Index

The results of the moisture content, grain size distribution and Atterberg Limit tests are provided on the record of borehole sheets in Appendix C. The results of the grain size distribution test and Atterberg Limit tests performed are also provided on Figures 2 and 3, respectively, in Appendix D.

1.4.1.3 Silty Clay/Clayey Silt

A native silty clay/clayey silt layer was encountered below silty clay fill layer in all boreholes drilled within this segment. The approximate elevations of the surface and base, thickness, moisture content, SPT 'N' value and undrained shear strength of the fill as encountered in boreholes are summarized in Table 1.4 below:

Table 1.4. Summary of silty clay/clay silt layer

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m)	Moisture Content Range (%)		SPT 'N' Value Range		Undrained Shear Strength (kPa)		
	Top	Bottom			Min.	Max.	Min.	Max.	Vane Test	Pocket Penetrometer Test	
										Min.	Max.
17-52	174.5	174.3	4.1	0.2	21	-	18	-	-	-	-
17-51	174.8	173.1	2.6	1.7	16	19	15	20	-	203	215
17-50	175.3	173.3	2.3	2.0	17	21	5	20	-	215	-
17-49	174.6	173.4	3.1	1.2	22	26	8	9	-	192	215
17-48	175.4	173.4	2.3	2.0	19	19	9	17	-	96	215
17-47	176.0	174.0	2.3	2.0	18	19	8	14	-	168	215
17-46	176.0	174.8	3.1	1.2	16	17	12	23	-	215	-
17-45	176.1	174.9	3.1	1.2	18	19	10	15	-	96	215
17-44	176.8	174.8	2.3	2.0	16	21	8	19	-	120	168
17-43	177.0	175.0	2.3	2.0	16	19	12	21	-	215	-
17-42	175.4	173.7	2.6	1.7	16	18	5	18	-	215	-
17-41	176.3	175.3	1.5	2.8	17	22	7	20	-	96	215
17-40	175.7	174.5	3.1	1.2	18	27	8	12	-	84	120
17-39	176.9	174.1	1.5	2.8	24	27	7	14	-	72	156
17-38	176.1	174.1	2.3	2.0	17	25	6	24	-	84	144
17-37	175.8	173.8	2.3	2.0	14	25	14	21	-	120	215
17-36	176.4	174.4	2.3	2.0	18	20	11	15	-	72	180

Laboratory testing performed on selected samples from this fill layer are summarized on Table 1.5 below:

Table 1.5. Laboratory test results for selected samples from silty clay/clay silt layer

Borehole	Sample	Depth (m)	Atterberg Limits			Grain Size Distribution			
			W _L	W _P	I _P	Gravel	Sand	Silt	Clay
17-51	3	2.29-2.74	-	-	-	1	22	77	
17-49	5	3.81-4.27	35	18	17	1	14	42	41
17-47	4	3.05-3.5	31	17	14	2	24	42	
17-45	4	3.05-3.5	-	-	-	2	20	78	
17-44	5	3.81-4.27	34	16	18	1	19	35	35
17-42	3	2.29-2.74	50	23	27	3	14	38	
17-41	5	3.05-3.5	37	18	19	2	19	39	40
17-38	5	4.04-4.50	41	20	21	1	20	41	35
17-37	4	3.28-3.74	45	22	23	1	13	39	44
17-36	4	3.28-3.74	-	-	-	5	21	74	

W_L= Liquid Limit; W_P= Plastic Limit; I_P= Plasticity Index

The results of the moisture content, grain size distribution and Atterberg Limit tests are provided on the record of borehole sheets in Appendix C. The results of the grain size distribution test and Atterberg Limit tests performed are also provided on Figures 4, 5 and 6, respectively, in Appendix D.

1.4.2 Segment 2 - Drake Rd. to Charing Cross Rd.

A total of eleven (11) boreholes were drilled within the segment Drake Rd. to Charing Cross Rd. (BH17-35 to BH17-25) along median slope of Hwy 401.

The general stratigraphy encountered within the investigated depths of boreholes indicate the following sub-surface sequence: sand and gravel/sandy silt fill underlain by silty clay/clayey silt fill followed by native silty clay/clayey silt. A detailed description of the stratigraphy encountered in the boreholes is discussed further in subsequent sections.

1.4.2.1 Fill: Sand and Gravel

A sand and gravel fill layer was encountered at the surface of all boreholes drilled within this segment. The fill layer extended to depth about 0.8 m below ground surface with elevations ranging between 177.6 m to 181.2 m. The explored thickness of this layer was about 0.8 m.

The composition of this fill layer is sand and gravel, trace to few silt, trace topsoil, and trace asphalt inclusions.

1.4.2.2 Fill: Sandy Silt

A sandy silt fill layer was encountered below sand and gravel fill in BH17-26 and BH17-25. The approximate elevations of the surface and base, thickness, SPT 'N' value and moisture content of the fill as encountered in boreholes are summarized in Table 1.6 below:

Table 1.6. Summary of sandy silt fill layer

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m)	Moisture Content Range (%)		SPT 'N' Value Range	
	Top	Bottom			Min.	Max.	Min.	Max.
17-26	180.6	179.9	0.8	0.7	22	-	16	-
17-25	181.2	180.5	0.8	0.7	19	-	13	-

The results of the moisture content are provided on the record of borehole sheets in Appendix C.

1.4.2.3 Fill: Silty Clay/Clayey Silt

A silty clay/clayey silt fill layer was encountered below sandy silt/sand and gravel fill in all drilled boreholes except for BH 17-26 within this segment. The approximate elevations of the surface and base, thickness, moisture content, SPT 'N' value and undrained shear strength of the fill as encountered in these boreholes are summarized in Table 1.7 below:

Table 1.7. Summary of silty clay/clay silt fill layer

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m)	Moisture Content Range (%)		SPT 'N' Value Range		Undrained Shear Strength (kPa)		
	Top	Bottom			Min.	Max.	Min.	Max.	Vane Test	Pocket Penetrometer Test	
										Min.	Max.
17-35	177.6	174.6	0.8	3.0	17	29	6	14	-	96	215
17-34	179.0	177.5	0.8	1.5	17	21	8	12	-	120	144
17-33	179.0	176.7	0.8	2.3	14	25	6	15	-	72	215
17-32	179.0	177.4	0.8	1.6	18	27	6	13	-	96	215
17-31	178.4	177.7	0.8	0.7	14	-	12	-	-	168	-
17-30	178.4	176.1	0.8	2.3	16	23	4	12	-	84	203
17-29	179.3	177.8	0.8	1.5	18	26	11	12	-	156	215
17-28	180.6	178.3	0.8	2.3	16	26	5	18	-	60	132
17-27	179.3	178.6	0.8	0.7	17	-	15	-	-	-	-
17-25	180.5	178.9	1.5	1.6	21	25	6	8	-	60	72

Laboratory testing performed on selected samples from this fill layer are summarized on Table 1.8 below:

Table 1.8. Laboratory test results for selected samples from silty clay/clay silt fill layer

Borehole	Sample	Depth (m)	Atterberg Limits			Grain Size Distribution			
			W _L	W _P	I _P	Gravel	Sand	Silt	Clay
17-33	2	1.52-1.98	-	-	-	2	21	77	
17-28	3	2.28-2.74	-	-	-	0	3	64	33
17-27	1	0.76-1.22	-	-	-	0	11	89	
17-25	2	1.52-1.98	-	-	-	0	7	93	

W_L= Liquid Limit; W_P= Plastic Limit; I_P= Plasticity Index

The results of the moisture content and grain size distribution are provided on the record of borehole sheets in Appendix C. The results of the grain size distribution tests performed are also provided on Figure 7, in Appendix D.

1.4.2.4 Silty Clay/Clayey Silt

A native silty clay/clayey silt layer was encountered below sandy silt/silty clay/clayey silt fill layer in all boreholes drilled within this segment. The approximate elevations of the surface and base, thickness, moisture content, SPT 'N' value and undrained shear strength of the fill as encountered in boreholes are summarized in Table 1.9 below:

Table 1.9. Summary of silty clay/clay silt layer

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m)	Moisture Content Range (%)		SPT 'N' Value Range		Undrained Shear Strength (kPa)		
	Top	Bottom			Min.	Max.	Min.	Max.	Vane Test	Pocket Penetrometer Test	
										Min.	Max.
17-35	174.6	174.1	3.8	0.5	18	-	14	-	-	215	-
17-34	177.5	175.5	2.3	2.0	18	27	6	13	-	48	144
17-33	176.7	175.5	3.1	1.2	16	20	14	15	-	96	192
17-32	177.4	175.5	2.4	1.9	21	30	6	11	-	72	120
17-31	177.7	174.8	1.5	2.9	20	29	5	16	102	24	192
17-30	176.1	174.9	3.1	1.2	22	23	10	21	-	72	215
17-29	177.8	175.8	2.3	2.0	18	-	7	15	-	96	203
17-28	178.3	177.0	3.1	1.3	20	22	7	9	83.8	24	72
17-27	178.6	175.7	1.5	2.9	17	42	4	6	93.1	24	168
17-26	179.9	177.0	1.5	2.9	23	26	WH	6	37	12	-
17-25	178.9	177.6	3.1	1.3	27	37	3	5	46.5	24	-

Laboratory testing performed on selected samples from this silty clay/clayey silt layer are summarized on Table 1.10 below:

Table 1.10. Laboratory test results for selected samples from silty clay/clayey silt layer

Borehole	Sample	Depth (m)	Atterberg Limits			Grain Size Distribution			
			W _L	W _P	I _P	Gravel	Sand	Silt	Clay
17-34	4	3.28-3.74	41	20	21	0	13	52	35
17-31	5	4.04-4.50	35	18	17	1	15	51	33
17-30	4	3.28-3.74	36	17	19	0	16	52	32
17-29	4	3.28-3.74	36	17	19	1	19	45	35
17-26	4	3.28-3.74	27	18	9	0	2	81	17
17-25	4	3.28-3.74	33	20	13	0	2	78	20

W_L= Liquid Limit; W_P= Plastic Limit; I_P= Plasticity Index

The results of the moisture content, grain size distribution and Atterberg Limit tests are provided on the record of borehole sheets in Appendix C. The results of the grain size distribution test and Atterberg Limit tests performed are also provided on Figures 8 and 9, respectively, in Appendix D.

1.4.3 Segment 3 - County Charing Cross Rd. to Harwich Rd.

A total of nine (9) boreholes were drilled within the segment County Charing Cross Rd. to Harwich Rd. (BH17-24 to BH17-16) along median slope of Hwy 401.

The general stratigraphy encountered within the investigated depths of boreholes indicate the following sub-surface sequence: sand and gravel fill underlain by silty clay/clayey silt/silt fill followed by native silty clay/ clayey silt/silty sand. A detailed description of the stratigraphy encountered in the boreholes is discussed further in subsequent sections.

1.4.3.1 Fill: Sand and Gravel

A sand and gravel fill layer was encountered at the surface of all boreholes drilled within this segment. The fill layer extended to depth about 0.8 m below ground surface with elevations ranging between 181.5 m to 186.7 m. The explored thickness of this layer was about 0.8 m.

1.4.3.2 Fill: Silty Clay/Clayey Silt

A silty clay/clayey silt fill layer was encountered below sand and gravel fill in all drilled boreholes within this segment. The approximate elevations of the surface and base, thickness, SPT 'N' value and moisture content of the fill as encountered in these boreholes are summarized in Table 1.12 below:

Table 1.12. Summary of silty clay/clay silt fill layer

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m)	Moisture Content Range (%)		SPT 'N' Value Range		Undrained Shear Strength (kPa)		
	Top	Bottom			Min.	Max.	Min.	Max.	Vane Test	Pocket Penetrometer Test	
										Min.	Max.
17-24	181.5	180.0	0.8	1.5	15	20	10	16	-	132	215
17-23	182.4	180.9	0.8	1.5	14	24	11	15	-	132	215
17-22	182.7	182.0	0.8	0.7	13	-	10	-	-	192	-
17-22	180.4	179.7	3.1	0.7	29	-	9	-	-	36	-
17-21	183.6	182.1	0.8	1.5	15	18	13	-	-	144	215
17-20	182.7	181.8	0.8	0.9	20	-	9	-	-	96	-
17-19	183.3	182.3	0.8	1.0	16	22	6	9	-	72	144
17-18	184.5	183.8	0.8	0.7	20	-	12	-	-	156	-
17-17	185.1	183.6	0.8	1.5	20	23	6	7	-	96	-
17-16	186.4	185.6	0.8	0.7	24	-	7	-	-	72	-

Laboratory testing performed on selected samples from this fill layer are summarized on Table 1.13 below:

Table 1.13. Laboratory test results for selected samples from silty clay/clay silt fill layer

Borehole	Sample	Depth (m)	Atterberg Limits			Grain Size Distribution			
			W _L	W _P	I _P	Gravel	Sand	Silt	Clay
17-17	2	1.52-1.98	-	-	-	0	19	81	

W_L= Liquid Limit; W_P= Plastic Limit; I_P= Plasticity Index

The results of the moisture content and grain size distribution are provided on the record of borehole sheets in Appendix C. The result of the grain size distribution test performed is also provided on Figure 10, in Appendix D.

1.4.3.3 Fill: Silt

A silt fill layer was encountered between clayey silt fill and silty clay fill only in BH 17-22 within this segment. The approximate elevations of the surface and base, thickness, SPT 'N' value and moisture content of the fill as encountered in this borehole are summarized in Table 1.14 below:

Table 1.14. Summary of silt fill layer

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m)	Moisture Content Range (%)		SPT 'N' Value Range	
	Top	Bottom			Min.	Max.	Min.	Max.
17-22	182.0	180.4	1.5	1.6	17	26	12	15

Laboratory testing performed on selected sample from this fill layer are summarized on Table 1.15 below:

Table 1.15. Laboratory test results for selected samples from silt fill layer

Borehole	Sample	Depth (m)	Atterberg Limits			Grain Size Distribution			
			W _L	W _P	I _P	Gravel	Sand	Silt	Clay
17-22	3	2.28-2.74	Non-Plastic			0	2	85	13

W_L= Liquid Limit; W_P= Plastic Limit; I_P= Plasticity Index

The results of the moisture content and grain size distribution are provided on the record of borehole sheets in Appendix C. The result of the grain size distribution test performed is also provided on Figure 11 in Appendix D.

1.4.3.4 Silty Clay/Clayey Silt

A native silty clay/clayey silt layer was encountered below silty clay/clayey silt fill layer in all boreholes drilled except for BH 17-22 within this segment. The approximate elevations of the surface and base, thickness, moisture content, SPT 'N' value and undrained shear strength of the fill as encountered in boreholes are summarized in Table 1.16 below:

Table 1.16. Summary of silty clay/clay silt layer

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m)	Moisture Content Range (%)		SPT 'N' Value Range		Undrained Shear Strength (kPa)		
	Top	Bottom			Min.	Max.	Min.	Max.	Vane Test	Pocket Penetrometer Test	
										Min.	Max.
17-24	180.0	178.0	2.3	2.0	29	32	4	5	-	156	192
17-23	180.9	178.9	2.3	2.0	17	25	8	20	-	156	192
17-21	182.1	180.1	2.3	2.0	14	28	5	11	-	60	144
17-20	181.7	179.2	1.7	2.6	17	33	5	16	-	156	192
17-19	182.3	179.8	1.8	2.5	13	27	12	16	-	132	192
17-18	183.8	181.0	1.5	2.8	15	24	9	25	-	168	215
17-17	183.6	181.6	2.3	2.0	19	21	8	18	-	144	215

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m)	Moisture Content Range (%)		SPT 'N' Value Range		Undrained Shear Strength (kPa)		
	Top	Bottom			Min.	Max.	Min.	Max.	Vane Test	Pocket Penetrometer Test	
										Min.	Max.
17-16	185.6	182.9	1.5	2.8	19	25	7	22	-	72	215

Laboratory testing performed on selected samples from this silty clay/clayey silt layer are summarized on Table 1.17 below:

Table 1.17. Laboratory test results for selected samples from silty clay/clayey silt layer

Borehole	Sample	Depth (m)	Atterberg Limits			Grain Size Distribution			
			W _L	W _P	I _P	Gravel	Sand	Silt	Clay
17-24	5	3.81-4.27	46	21	25	0	2	40	58
17-23	4	3.05-3.51	34	18	16	3	23	45	29
17-21	3	2.28-2.74	44	19	25	0	2	66	32
17-21	5	3.81-4.27	42	19	13	3	10	40	46
17-20	3	2.28-2.74	52	22	30	0	2	35	63
17-19	4	3.05-3.51	30	16	14	2	25	46	27
17-18	4	3.05-3.51	33	16	17	2	20	48	30
17-17	4	3.05-3.51	40	21	19	2	13	50	35
17-16	5	3.81-4.27	38	17	21	2	13	41	43

W_L= Liquid Limit; W_P= Plastic Limit; I_P= Plasticity Index

The results of the moisture content, grain size distribution and Atterberg Limit tests are provided on the record of borehole sheets in Appendix C. The results of the grain size distribution test and Atterberg Limit tests performed are also provided on Figure 12-13 and 14-15, respectively, in Appendix D.

1.4.3.5 Silty Sand

A native silt sand layer was encountered below silty clay fill only in BH 17-22 within this segment. The approximate elevations of the surface and base, thickness, SPT 'N' value and moisture content of the fill as encountered in this borehole are summarized in Table 1.18 below:

Table 1.18. Summary of silty sand layer

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m)	Moisture Content Range (%)		SPT 'N' Value Range	
	Top	Bottom			Min.	Max.	Min.	Max.
17-22	179.7	179.2	3.8	0.5	32	-	21	-

The result of the moisture content is provided on the record of borehole sheets in Appendix C.

1.4.4 Segment 4 - Harwich Rd. to Scane Rd.

A total of ten (11) boreholes were drilled within the segment Harwich Rd. to Scane Rd. (BH17-15 to BH17-05) along median slope of Hwy 401.

The general stratigraphy encountered within the investigated depths of boreholes indicate the following sub-surface sequence: sand and gravel fill underlain by sand/silty clay/clayey silt fill followed by native silty clay/ clayey silt. A detailed description of the stratigraphy encountered in the boreholes is discussed further in subsequent sections.

1.4.4.1 Fill: Sand and Gravel

A sand and gravel fill layer was encountered at the surface of all boreholes drilled within this segment. The fill layer extended to depth ranged from 0.8 to 1.5 m below ground surface with elevations ranging between 187.3 m to 189.1 m. The explored thickness of this layer ranged from 0.8 to 1.5 m.

The composition of this fill layer is sand and gravel and trace recycled asphalt inclusions. The SPT “N” value from one sample taken within this layer was 11 blows per 0.3 m penetration, suggesting compact relative density. The water content performed on selected sample (BH17-05, SS1), which shown 4%. The grain size distribution test also performed on this sample, which shown 64% gravel, 28% sand and 8% silt and clay. The result of the moisture content is provided on the record of borehole sheets in Appendix C. The result of the grain size distribution test performed are also provided on Figure 16 in Appendix D.

1.4.4.2 Fill: Silty Sand/Sandy Silt/Sand

A silty sand/sandy/sand silt fill layer was encountered below sand and gravel fill in BH17-15 and BH17-05. The approximate elevations of the surface and base, thickness, SPT ‘N’ value and moisture content of the fill as encountered in boreholes are summarized in Table 1.19 below:

Table 1.19. Summary of silty sand/sandy silt/sand fill layer

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m)	Moisture Content Range (%)		SPT ‘N’ Value Range	
	Top	Bottom			Min.	Max.	Min.	Max.
17-15	187.6	186.7	0.8	0.9	12	-	13	-
17-05	188.7	187.9	1.5	0.8	25	-	11	-

The results of the moisture content are provided on the record of borehole sheets in Appendix C.

1.4.4.3 Fill: Silty Clay/Clayey Silt

A silty clay/clayey silt fill layer was encountered below sand and gravel/silty sand/sandy silt fill in all drilled boreholes except for BH17-05 within this segment. The approximate elevations of the surface and base, thickness, moisture content, SPT ‘N’ value and undrained shear strength of the fill as encountered in these boreholes are summarized in Table 1.20 below:

Table 1.20. Summary of silty clay/clay silt fill layer

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m)	Moisture Content Range (%)		SPT 'N' Value Range		Undrained Shear Strength (kPa)		
	Top	Bottom			Min.	Max.	Min.	Max.	Vane Test	Pocket Penetrometer Test	
										Min.	Max.
17-15	186.7	186.1	1.7	0.6	22	-	7	-	-	105	-
17-14	187.9	186.4	0.8	1.5	18	22	8	-	-	96	144
17-13	187.6	186.0	0.8	1.6	21	24	5	12	-	72	96
17-12	188.5	187.8	0.8	0.7	24	-	5	-	-	84	192
17-11	189.1	187.6	0.8	1.5	19	23	10	14	-	120	215
17-10	187.8	186.4	0.9	1.4	17	21	7	12	-	144	180
17-09	187.3	186.6	0.8	0.7	22	-	9	-	-	168	-
17-08	187.6	186.1	0.8	1.5	21	23	11	-	-	144	168
17-07	187.9	187.2	0.8	0.7	13	-	11	-	-	-	-
17-06	187.9	186.4	0.8	1.5	21	25	8	9	-	108	168

Laboratory testing performed on selected sample from this fill layer are summarized on Table 1.21 below:

Table 1.21. Laboratory test results for selected samples from silty clay/clay silt fill layer

Borehole	Sample	Depth (m)	Atterberg Limits			Grain Size Distribution			
			W _L	W _P	I _P	Gravel	Sand	Silt	Clay
17-06	1	0.76-1.22	-	-	-	2	28	70	

W_L= Liquid Limit; W_P= Plastic Limit; I_P= Plasticity Index

The results of the moisture content and grain size distribution are provided on the record of borehole sheets in Appendix C. The result of the grain size distribution test performed is also provided on Figure 17 in Appendix D.

1.4.4.4 Silty Clay/Clayey Silt

A native silty clay/clayey silt layer was encountered below silty clay/clayey silt/sand fill layer in all boreholes drilled within this segment. The approximate elevations of the surface and base, thickness, moisture content, SPT 'N' value and undrained shear strength of the fill as encountered in boreholes are summarized in Table 1.22 below:

Table 1.22. Summary of silty clay/clay silt layer

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m)	Moisture Content Range (%)		SPT 'N' Value Range		Undrained Shear Strength (kPa)		
	Top	Bottom			Min.	Max.	Min.	Max.	Vane Test	Pocket Penetrometer Test	
										Min.	Max.
17-15	186.1	184.1	2.3	2.0	19	20	17	23	-	192	215
17-14	186.4	184.4	2.3	2.0	19	20	8	23	-	120	215

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m)	Moisture Content Range (%)		SPT 'N' Value Range		Undrained Shear Strength (kPa)		
	Top	Bottom			Min.	Max.	Min.	Max.	Vane Test	Pocket Penetrometer Test	
										Min.	Max.
17-13	186.0	184.1	2.4	1.9	19	29	11	19	-	84	192
17-12	187.8	185.0	1.5	2.8	18	19	15	25	-	192	215
17-11	187.6	185.6	2.3	2.0	29	35	5	14	-	72	156
17-10	186.4	184.3	2.3	2.1	25	31	5	8	111.7	36	168
17-09	186.6	183.8	1.5	2.8	15	22	10	15	-	144	192
17-08	186.1	184.0	2.3	2.1	16	28	6	11	140	96	192
17-07	187.2	184.4	1.5	2.8	16	21	12	18	-	156	215
17-06	186.4	184.4	2.3	2.0	16	28	9	14	-	120	156
17-05	187.9	185.9	2.3	2.0	22	35	3	8	-	48	72

Laboratory testing performed on selected samples from this silty clay/clayey silt layer are summarized on Table 1.23 below:

Table 1.23. Laboratory test results for selected samples from silty clay/clayey silt layer

Borehole	Sample	Depth (m)	Atterberg Limits			Grain Size Distribution			
			W _L	W _P	I _P	Gravel	Sand	Silt	Clay
17-15	4	3.05-3.51	43	20	23	1	13	40	46
17-14	3	2.28-2.74	55	20	35	0	9	39	52
17-13	3	2.28-2.74	58	23	35	0	6	40	54
17-13	5	3.81-4.27	37	18	19	1	15	52	32
17-12	2	1.52-1.98	47	22	25	1	7	29	63
17-10	3	2.28-2.74	45	21	24	0	3	44	53
17-09	5	3.81-4.27	29	16	13	2	24	39	35
17-07	2	2.28-2.74	45	21	24	0	5	38	57
17-05	4	3.05-3.51	38	19	19	1	3	35	61

W_L= Liquid Limit; W_P= Plastic Limit; I_P= Plasticity Index

The results of the moisture content, grain size distribution and Atterberg Limit tests are provided on the record of borehole sheets in Appendix C. The results of the grain size distribution test and Atterberg Limit tests performed are also provided on Figure 18-19 and 20-21, respectively, in Appendix D.

1.4.5 Segment 5 - Scane Rd. to Victoria Rd.

A total of four (4) boreholes were drilled within the segment Scane Rd. to Victoria Rd. (BH17-04 to BH17-01) along median slope of Hwy 401.

The general stratigraphy encountered within the investigated depths of boreholes indicate the following sub-surface sequence: granular fill followed by silty sand/sand fill underlain by silty clay/clayey silt fill followed by native silty clay/clayey silt/silty sand. A detailed description of the stratigraphy encountered in the boreholes is discussed further in subsequent sections.

1.4.5.1 Fill: Sand and Gravel

A sand and gravel fill layer was encountered at the surface of all boreholes drilled within this segment. The fill layer extended to depth ranged from 0.8 to 0.9 m below ground surface with elevations ranging between 190.6 m to 193.6 m. The explored thickness of this layer ranged from 0.8 to 0.9 m.

The composition of this fill layer is sand and gravel, some stone and trace recycled asphalt inclusions.

1.4.5.2 Fill: Silty Sand/Sand

A silty sand/sand fill layer was encountered below sand and gravel fill in all boreholes drilled within this segment. The approximate elevations of the surface and base, thickness, SPT 'N' value and moisture content of the fill as encountered in boreholes are summarized in Table 1.24 below:

Table 1.24. Summary of silty sand/sand fill layer

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m) Min.	Moisture Content Range (%)		SPT 'N' Value Range	
	Top	Bottom			Min.	Min.	Min.	Max.
17-04	190.7	189.2	0.8	13	12	22	13	16
17-03	190.6	188.3	0.8	11	7	20	11	20
17-02	193.6	192.2	0.9	8	20	33	8	14
17-01	192.7	192.0	0.8	12	19	-	12	-

The results of the moisture content is provided on the record of borehole sheets in Appendix C.

1.4.5.3 Fill: Silty Clay

A silty clay fill layer was encountered below silty sand fill in BH17-04 and BH17-01 within this segment. The approximate elevations of the surface and base, thickness, moisture content, SPT 'N' value and undrained shear strength of the fill as encountered in these boreholes are summarized in Table 1.25 below:

Table 1.25. Summary of silty clay fill layer

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m)	Moisture Content Range (%)		SPT 'N' Value Range		Undrained Shear Strength (kPa)		
	Top	Bottom			Min.	Max.	Min.	Max.	Vane Test	Pocket Penetrometer Test	
										Min.	Max.
17-04	189.2	188.2	2.3	1.1	17	27	8	11	-	168	-
17-01	192.0	190.4	1.5	1.6	17	28	7	13	-	48	215

The results of the moisture content are provided on the record of borehole sheets in Appendix C.

1.4.5.4 Topsoil

A topsoil layer was encountered below sand/silty clay fill in BH17-04 and BH17-03 within this segment. The composition of this layer is topsoil mixed with some sand, some silt and trace clay. The approximate elevations of the surface and base, thickness, SPT 'N' value and moisture content of the fill as encountered in these boreholes are summarized in Table 1.26 below:

Table 1.26. Summary of topsoil layer

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m)	Moisture Content Range (%)		SPT 'N' Value Range	
	Top	Bottom			Min.	Max.	Min.	Max.
17-04	188.2	187.7	3.4	0.4	-	-	-	-
17-03	188.3	187.6	3.1	0.7	25	-	5	-

The result of the moisture content is provided on the record of borehole sheets in Appendix C.

1.4.5.5 Silty Clay/Clayey Silt

A native silty clay/clayey silt layer was encountered below topsoil/silty clay fill layer in BH17-04, BH17-03 and BH17-01 drilled within this segment. The approximate elevations of the surface and base, thickness, moisture content, SPT 'N' value and undrained shear strength of the fill as encountered in boreholes are summarized in Table 1.27 below:

Table 1.27. Summary of silty clay/clayey silt layer

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m)	Moisture Content Range (%)		SPT 'N' Value Range		Undrained Shear Strength (kPa)		
	Top	Bottom			Min.	Max.	Min.	Max.	Vane Test	Pocket Penetrometer Test	
										Min.	Max.
17-04	187.7	187.2	3.8	0.5	24	-	9	-	-	192	215
17-03	187.6	187.1	3.8	0.5	21	-	12	-	-	96	-
17-01	190.4	189.2	3.1	1.2	20	21	18	20	-	72	-

Laboratory testing performed on selected samples from silty clay/clayey silt layer are summarized on Table 1.28 below:

Table 1.28. Laboratory test results for selected samples from silty clay/clayey silt layer

Borehole	Sample	Depth (m)	Atterberg Limits			Grain Size Distribution			
			W _L	W _P	I _P	Gravel	Sand	Silt	Clay
17-04	5	3.81-4.27	35	19	26	0	3	50	48
17-01	4	3.05-3.51	42	20	22	0	6	32	62

W_L= Liquid Limit; W_P= Plastic Limit; I_P= Plasticity Index

The results of the moisture content, grain size distribution and Atterberg Limit tests are provided on the record of borehole sheets in Appendix C. The results of the grain size distribution test and Atterberg Limit tests performed are also provided on Figure 22 and 23, respectively, in Appendix D.

1.4.5.6 Silty Sand

A native silty sand layer was encountered below the silty sand fill layer only in BH17-02. The approximate elevations of the surface and base, thickness, SPT 'N' value and moisture content of the fill as encountered in boreholes are summarized in Table 1.27 below:

Table 1.29. Summary of silty sand layer

Borehole	Elevation (m)		Layer Surface Depth (m)	Layer Thickness (m)	SPT 'N' Value Range		Moisture Content Range (%)	
	Top	Bottom			Min.	Max.	Min.	Max.
17-02	192.2	190.2	2.3	2.0	19	26	15	23

Laboratory testing performed on selected samples from this silty sand layer are summarized on Table 1.30 below:

Table 1.30. Laboratory test results for selected samples from silty sand layer

Borehole	Sample	Depth (m)	Atterberg Limits			Grain Size Distribution			
			W _L	W _P	I _P	Gravel	Sand	Silt	Clay
17-02	3	2.28-2.74	-	-	-	0	50	50	

W_L= Liquid Limit; W_P= Plastic Limit; I_P= Plasticity Index

The results of the moisture content, grain size distribution and Atterberg Limit tests are provided on the record of borehole sheets in Appendix C. The result of the grain size distribution test performed are also provided on Figure 24 in Appendix D.

1.5 Groundwater Conditions

Information on groundwater levels at the site was obtained by measuring the water levels in the open boreholes after completion of drilling. The groundwater levels encountered in the boreholes are shown on the borehole logs and presented below in Table 1.31.

Table 1.31. Groundwater data

Borehole	Date Completed and Measured	Ground Surface Elevation (m)	Groundwater Elevation (m)	Groundwater Depth (m)
BH17-52	Nov 21, 2017	178.6	Dry in the open hole	
BH17-51	Nov 21, 2017	177.4	Dry in the open hole	
BH17-50	Nov 21, 2017	177.6	Dry in the open hole	
BH17-49	Nov 21, 2017	177.7	Dry in the open hole	
BH17-48	Nov 21, 2017	177.7	176.2	1.5

Borehole	Date Completed and Measured	Ground Surface Elevation (m)	Groundwater Elevation (m)	Groundwater Depth (m)
BH17-47	Nov 21, 2017	179.3	Dry in the open hole	
BH17-46	Nov 21, 2017	179.1	Dry in the open hole	
BH17-45	Nov 21, 2017	179.2	Dry in the open hole	
BH17-44	Nov 20, 2017	179.1	Dry in the open hole	
BH17-43	Nov 20, 2017	179.3	Dry in the open hole	
BH17-42	Nov 20, 2017	178.0	Dry in the open hole	
BH17-41	Nov 20, 2017	177.8	Dry in the open hole	
BH17-40	Nov 20, 2017	178.8	Dry in the open hole	
BH17-39	Nov 20, 2017	178.4	Dry in the open hole	
BH17-38	Nov 20, 2017	178.4	Dry in the open hole	
BH17-37	Nov 20, 2017	178.1	Dry in the open hole	
BH17-36	Nov 20, 2017	178.7	Not measured since borehole was caved	
BH17-35	Nov 20, 2017	178.4	Dry in the open hole	
BH17-34	Nov 19, 2017	179.8	Dry in the open hole	
BH17-33	Nov 19, 2017	179.8	Dry in the open hole	
BH17-32	Nov 19, 2017	179.8	Dry in the open hole	
BH17-31	Nov 19, 2017	179.2	Dry in the open hole	
BH17-30	Nov 19, 2017	179.2	Dry in the open hole	
BH17-29	Nov 19, 2017	180.1	Dry in the open hole	
BH17-28	Nov 19, 2017	181.4	Dry in the open hole	
BH17-27	Nov 19, 2017	180.1	Dry in the open hole	
BH17-26	Dec 21, 2017	181.4	Dry in the open hole	
BH17-25	Dec 21, 2017	182.0	Dry in the open hole	
BH17-24	Dec 21, 2017	182.3	Dry in the open hole	
BH17-23	Dec 21, 2017	183.2	Dry in the open hole	
BH17-22	Dec 21, 2017	183.5	Dry in the open hole	
BH17-21	Dec 21, 2017	184.4	Dry in the open hole	
BH17-20	Dec 20, 2017	183.5	Dry in the open hole	
BH17-19	Dec 20, 2017	184.1	Dry in the open hole	
BH17-18	Dec 20, 2017	185.3	Dry in the open hole	
BH17-17	Dec 20, 2017	185.9	Dry in the open hole	
BH17-16	Dec 20, 2017	187.2	Dry in the open hole	
BH17-15	Dec 20, 2017	188.4	Dry in the open hole	
BH17-14	Dec 20, 2017	188.7	Dry in the open hole	
BH17-13	Dec 20, 2017	188.4	Dry in the open hole	
BH17-12	Dec 18, 2017	189.3	Dry in the open hole	
BH17-11	Dec 18, 2017	189.9	Dry in the open hole	
BH17-10	Dec 18, 2017	188.7	Dry in the open hole	
BH17-9	Dec 18, 2017	188.1	Dry in the open hole	

Borehole	Date Completed and Measured	Ground Surface Elevation (m)	Groundwater Elevation (m)	Groundwater Depth (m)
BH17-8	Dec 18, 2017	188.4	Dry in the open hole	
BH17-7	Dec 18, 2017	188.7	Dry in the open hole	
BH17-6	Dec 18, 2017	188.7	Dry in the open hole	
BH17-5	Dec 18, 2017	190.2	Dry in the open hole	
BH17-4	Dec 11, 2017	191.5	Dry in the open hole	
BH17-3	Dec 11, 2017	191.4	189.0	2.4
BH17-2	Dec 11, 2017	194.5	Dry in the open hole	
BH17-1	Dec 11, 2017	193.5	Dry in the open hole	

Note that water levels measured in open boreholes might not be stabilized due to short term observation.

Seasonal variations in the water table should be expected, with higher levels occurring during wetter periods of the year and lower levels during drier periods. Some perched water could exist in the granular fill as well.

January 24, 2018

2 CLOSURE

The comments given in this report are intended only for the guidance of design engineers. The number of boreholes required to determine the localized underground conditions between boreholes affecting construction costs, techniques, sequencing, equipment, scheduling, etc. could be greater than has been carried out for design purposes. Contractors bidding on or undertaking the works should, in this light, decide on their own investigations, as well as their own interpretations of the factual borehole results, so that they may draw their own conclusions as to how the subsurface conditions may affect them.

This Foundation Investigation Report has been prepared by Silvana Micic, Ph.D., P.Eng. and Jia He, M.Eng., E.I.T. and reviewed by TaeChul Kim, M.E.Sc., P.Eng. and Stan E. Gonsalves, M.Eng., P.Eng., Designated MTO Foundation Contact. The field investigation was conducted by Natasha Ungerer and Mona Ungerer.


We trust that these comments provide you with sufficient information to proceed with design. Should you have any questions, please do not hesitate to contact this office.

Yours truly,

exp Services Inc.



Jia He, M.Eng., E.I.T.
Technical Specialist

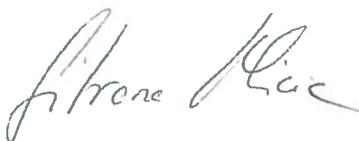

Silvana Micic, Ph.D, P.Eng.
Senior Geotechnical Engineer



TaeChul Kim, M.E.Sc., P.Eng.
Senior Geotechnical/Foundation Engineer



Stan E. Gonsalves, M.Eng., P.Eng.
Principal Engineer
Designated MTO Foundation Contact



Encl.

Appendix A – Photographs



Photo 1. Drilling BH17-20 at Hwy 401, facing west



Photo 2. Drilling BH17-20 at Hwy 401, facing east



Photo 3. Drilling BH17-33t Hwy 401, facing east



Photo 3. Rig used for drilling at Hwy 401, facing east

Appendix B – Drawings

METRIC
DIMENSIONS ARE IN METERS UNLESS OTHERWISE SHOWN.

Agreement No. 3015-E-0017
Assignment No. 8
WP 3102-15-00

Installation of High Tension Cable Median Barrier at Hwy 401, Windsor to London- Interchanges of Essex Rd. 42 (Sta. 16+200 Tibury W) and Victoria Rd. (Sta. 11+200 Howard Twp.)

BOREHOLE LOCATION PLAN AND SOIL STRATA



exp Services Inc.

KEY PLAN




- LEGEND**
- Location of New Boreholes Drilled by EXP
 - Standard Penetration Test (Blows/0.3 m)
 - Groundwater level measured in open hole (Note: All other boreholes were dry)

- SOIL STRATA**
- FILL: SAND AND GRAVEL
 - FILL: SILTY SAND/ SANDY SILT / SAND/ SILT
 - FILL: SILTY CLAY/ CLAYEY SILT
 - SILTY CLAY/ CLAYEY SILT
 - SILTY SAND
 - TOPSOIL



PLAN

Segment 1

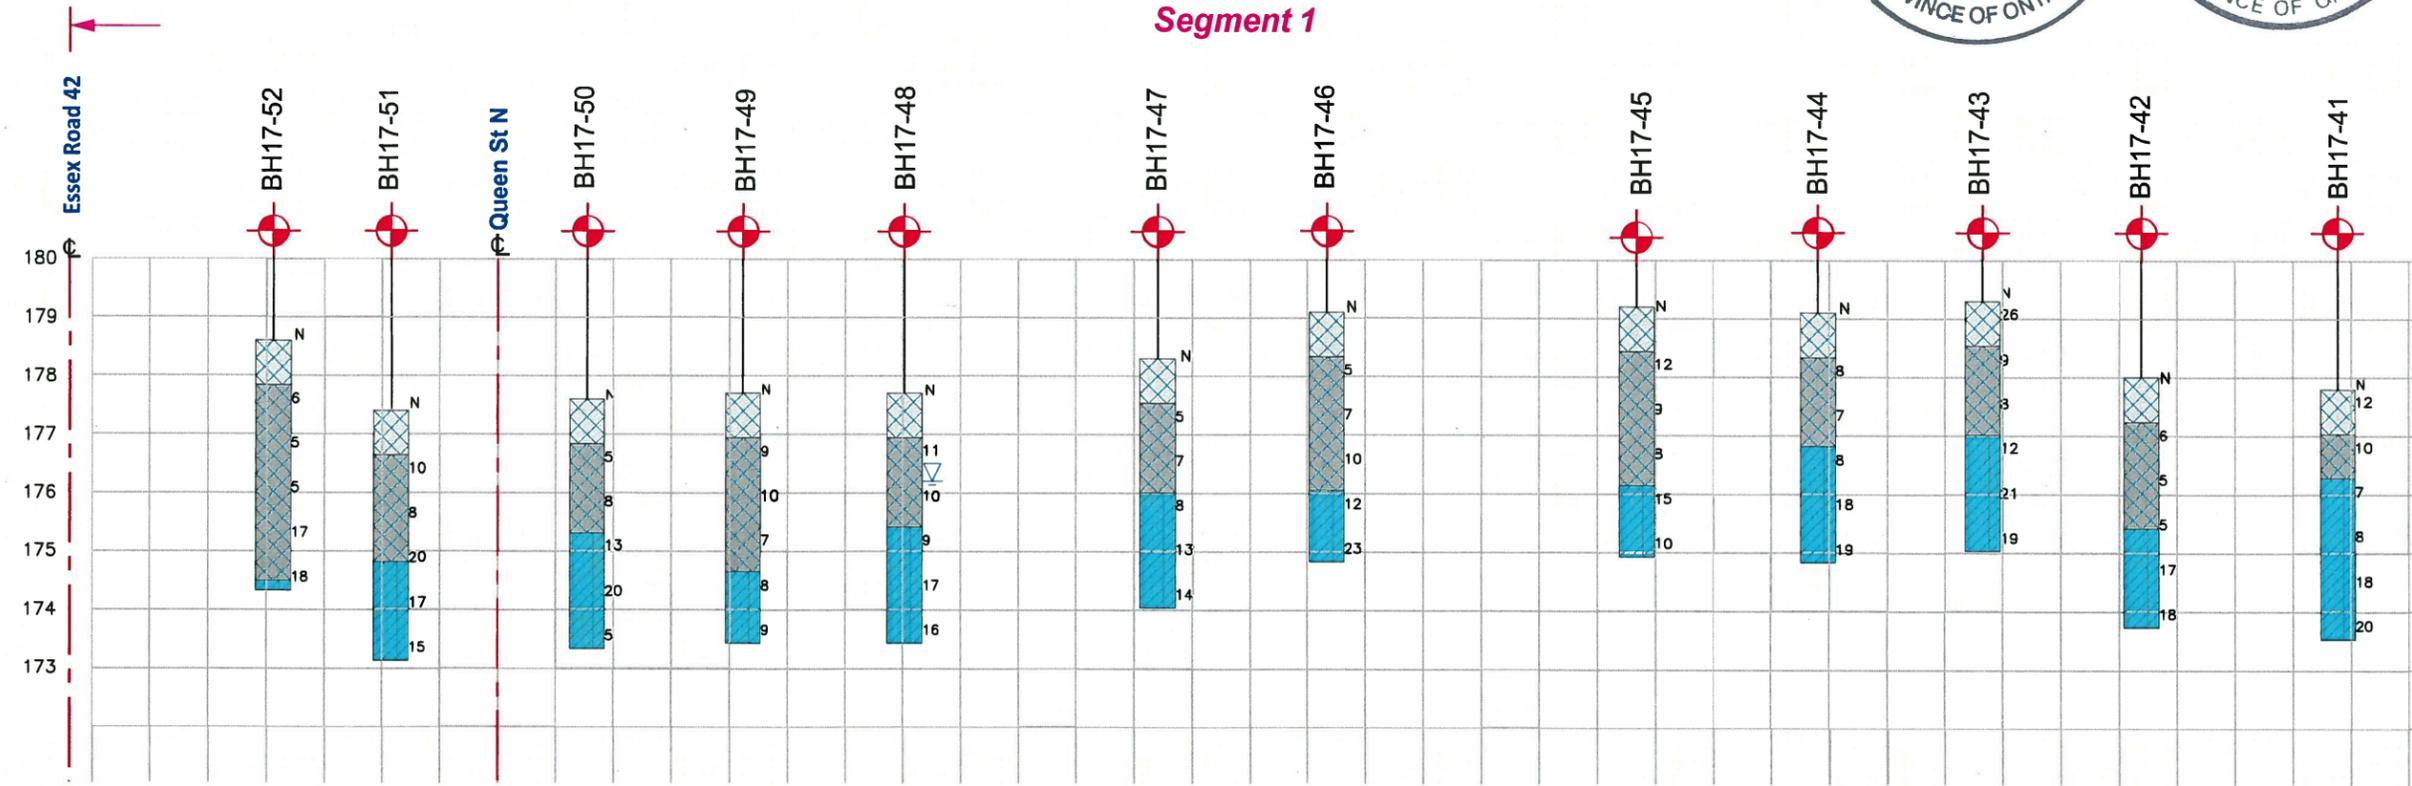


PROFILE ALONG HWY 401

BH No.	APPROX. ELEV.	MTM CO-ORDINATES	
		NORTHING	EASTING
BH17-52	178.6	4680908.6	309283.0
BH17-51	177.4	4681240.1	352688.7
BH17-50	177.6	4681316.3	310948.2
BH17-49	177.7	4681512.4	311741.2
BH17-48	177.7	4681701.7	312603.2
BH17-47	178.3	4682000.1	313882.8
BH17-46	179.1	4682201.5	314741.6
BH17-45	179.2	4682420.9	316307.6
BH17-44	179.1	4683081.2	317107.5
BH17-43	179.3	4683713.3	317805.7
BH17-42	178.0	4684348.1	318513.4
BH 17-41	177.8	4685056.5	319449.6

NOTE

This drawing is for subsurface information only. The proposed structure details/works are shown for illustration purposes only and may not be consistent with the final design configuration as shown elsewhere in the Contracts Documents.

The complete foundation investigation and design report for this project and other related documents may be examined at the Materials Engineering and Research Office, Downsview. Information contained in the report and related documents are specifically excluded in accordance with the conditions of Section GC 2.01 of OPS Gen. Cond.



SM	SUBMISSION FOR MTO REVIEW		
BY	DESCRIPTION		
	GEOCRES NO. 4018-69		
	PROJECT NO. ADM-00235197-L0		
SUBMD SM	CHECKED SM	DATE	Jan. 24, 18
DRAWN SH	CHECKED SM	APPROVED SG	DWG. 1

METRIC
DIMENSIONS ARE IN METERS UNLESS OTHERWISE SHOWN.

Agreement No. 3015-E-0017
Assignment No. 8
WP 3102-15-00

Installation of High Tension Cable Median Barrier at Hwy 401, Windsor to London- Interchanges of Essex Rd. 42 (Sta. 16+200 Tibury W) and Victoria Rd. (Sta. 11+200 Howard Twp.)

BOREHOLE LOCATION PLAN AND SOIL STRATA

exp Services Inc.



- LEGEND**
- Location of New Boreholes Drilled by EXP
 - Standard Penetration Test (Blows/0.3 m)
 - Groundwater level measured in open hole (Note: All other boreholes were dry)


- FILL: SAND AND GRAVEL
- FILL: SILTY SAND/ SANDY SILT/ SAND/ SILT
- FILL: SILTY CLAY/ CLAYEY SILT
- SILTY CLAY/ CLAYEY SILT
- SILTY SAND
- TOPSOIL

BH No.	APPROX. ELEV.	MTM CO-ORDINATES	
		NORTHING	EASTING
BH17-40	178.8	4685561.1	320374.2
BH17-39	178.4	4685763.2	320746.7
BH17-38	178.4	4686302.7	321827.7
BH17-37	178.1	4686382.5	322626.4
BH17-36	178.7	4686491.9	323905.9
BH17-35	178.4	4686803.3	324678.8
BH17-34	179.8	4687233.2	325780.2
BH17-33	179.8	4687618.7	326723.7
BH17-32	179.8	4687973.3	327589.4
BH17-31	179.2	4688352.4	328509.4

NOTE

This drawing is for subsurface information only. The proposed structure details/works are shown for illustration purposes only and may not be consistent with the final design configuration as shown elsewhere in the Contracts Documents.

The complete foundation investigation and design report for this project and other related documents may be examined at the Materials Engineering and Research Office, Downsview. Information contained in the report and related documents are specifically excluded in accordance with the conditions of Section GC 2.01 of OPS Gen. Cond.




SM	SUBMISSION FOR MTO REVIEW		
BY	DESCRIPTION		
	GEOCRETS NO. 4018-69		
	PROJECT NO. ADM-00235197-L0		
SUBMD SM	CHECKED SM	DATE	Jan. 24, 18
DRAWN SH	CHECKED SM	APPROVED SG	DWG. 2



PLAN

Segment 1

Segment 2

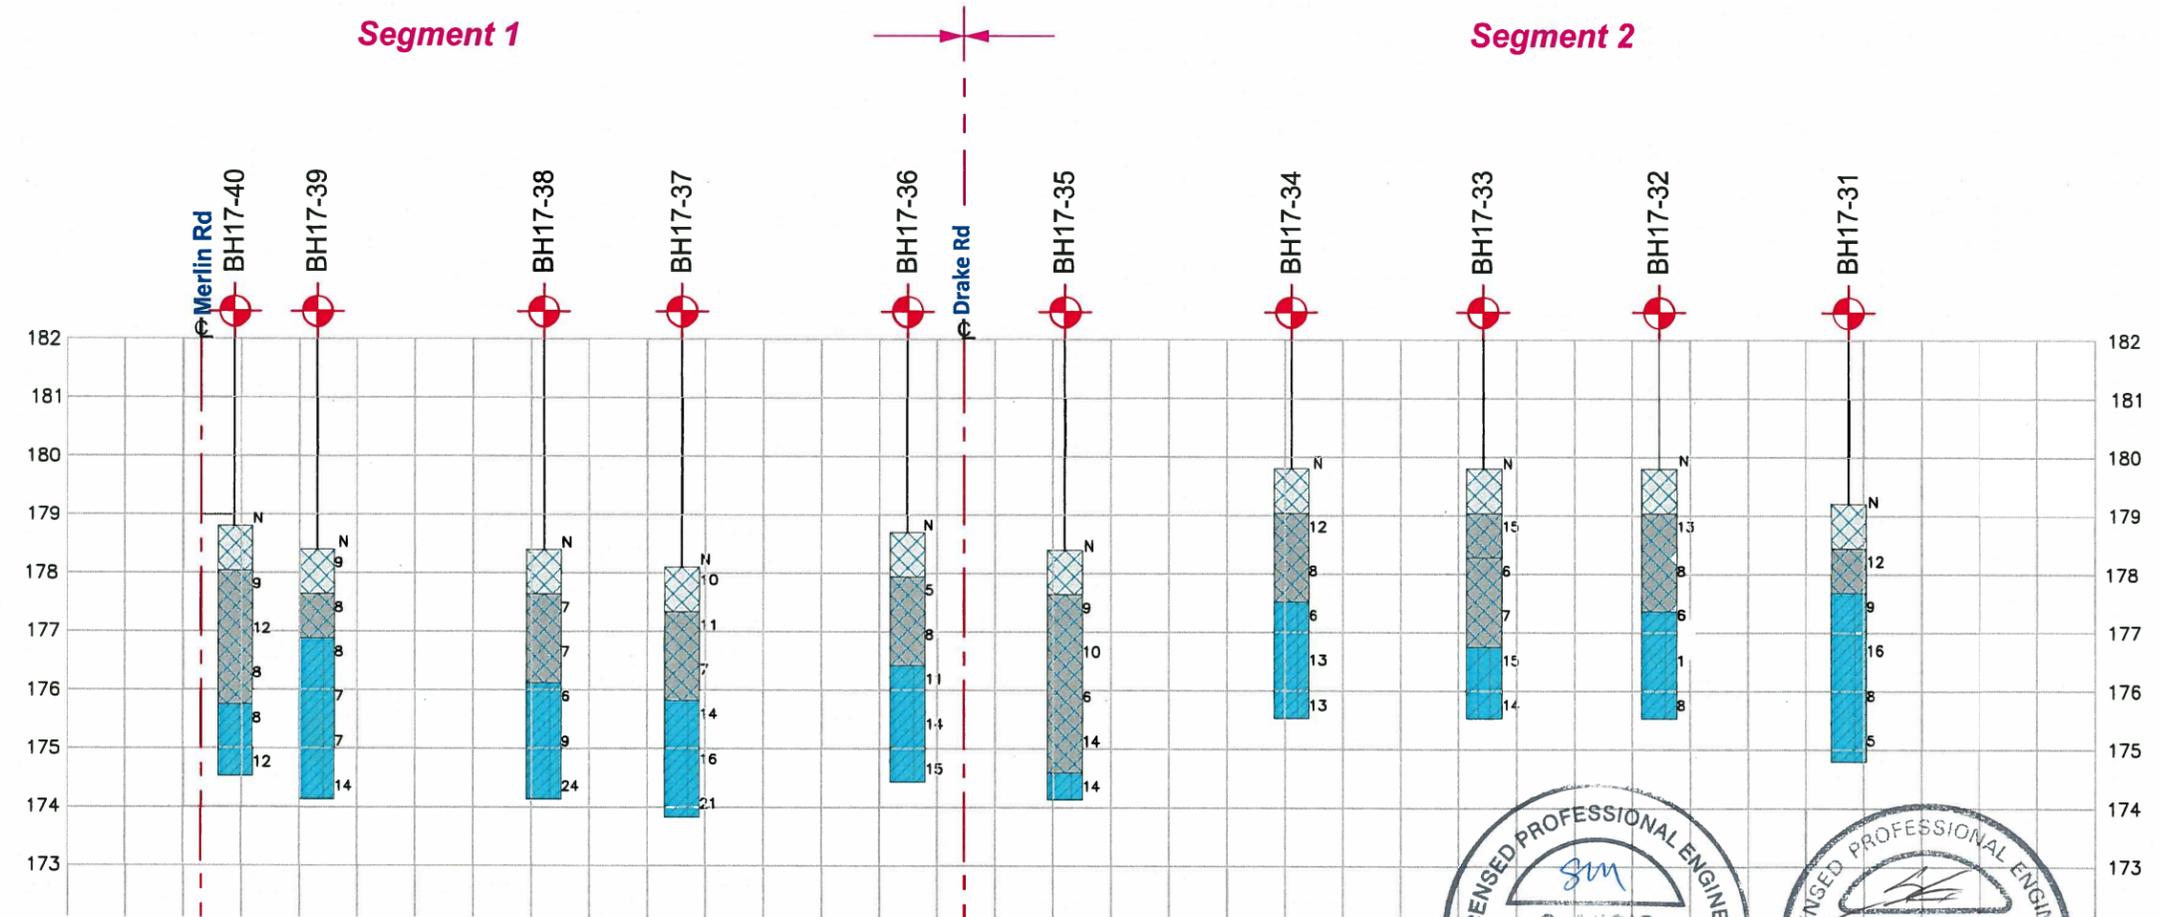

PROFILE ALONG HWY 401



METRIC
DIMENSIONS ARE IN METERS UNLESS OTHERWISE SHOWN.

Agreement No. 3015-E-0017
Assignment No. 8
WP 3102-15-00

Installation of High Tension Cable Median Barrier at Hwy 401, Windsor to London- Interchanges of Essex Rd. 42 (Sta. 16+200 Tibury W) and Victoria Rd. (Sta. 11+200 Howard Twp.)

BOREHOLE LOCATION PLAN AND SOIL STRATA

exp Services Inc.

KEY PLAN

LEGEND

SOIL STRATA

NOTE

SCALE

DATE

PROJECT NO. ADM-00235197-L0

SUBMD SM CHECKED SM DATE Jan. 24, 18
DRAWN SH CHECKED SM APPROVED SG DWG. 3



PLAN




Legend symbols:
 - Red circle with crosshair: Location of New Boreholes Drilled by EXP
 - N: Standard Penetration Test (Blows/0.3 m)
 - Blue inverted triangle: Groundwater level measured in open hole (Note: All other boreholes were dry)

Soil Strata Legend:
 - Diagonal lines: FILL: SAND AND GRAVEL
 - Yellow: SILTY SAND
 - Cross-hatch: FILL: SILTY SAND/ SANDY SILT/ SAND/ SILT
 - Grey: TOPSOIL
 - Blue diagonal lines: FILL: SILTY CLAY/ CLAYEY SILT
 - Blue: SILTY CLAY/ CLAYEY SILT

BH No.	APPROX. ELEV.	MTM CO-ORDINATES	
		NORTHING	EASTING
BH17-30	179.2	4688779.9	329301.9
BH17-29	180.1	4689539.8	330125.8
BH17-28	181.4	469719.4	373966.7
BH17-27	180.1	4690835.9	331606.9
BH17-26	181.4	4691389.9	332514.9
BH17-25	182.0	4691848.8	333617.7
BH17-24	182.3	4692184.2	334512.9
BH17-23	183.2	4692559.7	335483.9
BH17-22	183.5	4692840.1	336197.5
BH17-21	184.4	4695060.5	337493.9

Segment 2

Segment 3

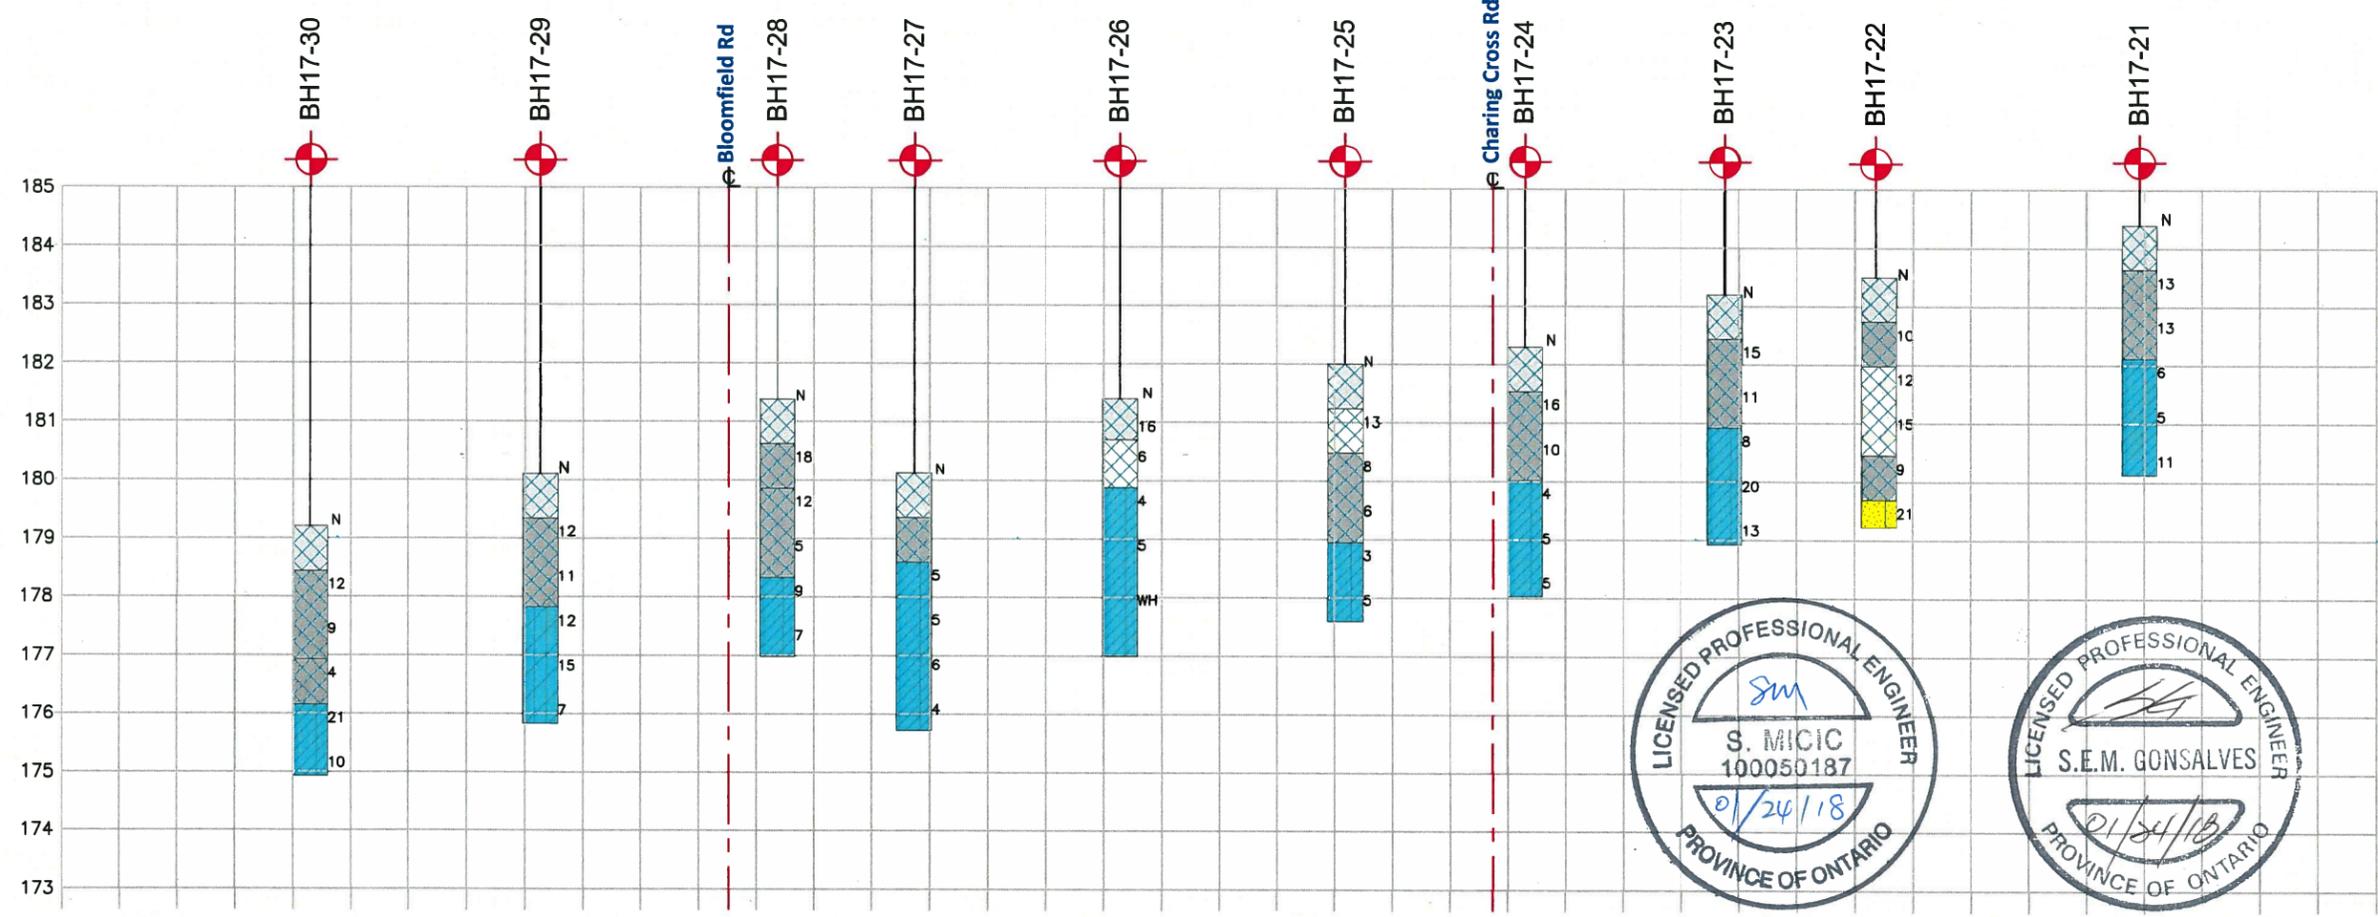


PROFILE ALONG HWY 401

LICENSED PROFESSIONAL ENGINEER
S. MICIC
100050187
01/24/18
PROVINCE OF ONTARIO

LICENSED PROFESSIONAL ENGINEER
S.E.M. GONSALVES
01/24/18
PROVINCE OF ONTARIO

NOTE
This drawing is for subsurface information only. The proposed structure details/works are shown for illustration purposes only and may not be consistent with the final design configuration as shown elsewhere in the Contracts Documents.
The complete foundation investigation and design report for this project and other related documents may be examined at the Materials Engineering and Research Office, Downsview. Information contained in the report and related documents are specifically excluded in accordance with the conditions of Section GC 2.01 of OPS Gen. Cond.



DATE	BY	DESCRIPTION
	SM	SUBMISSION FOR MTO REVIEW
		GEOCRYS NO. 4018-69
		PROJECT NO. ADM-00235197-L0

METRIC
DIMENSIONS ARE IN METERS UNLESS OTHERWISE SHOWN.

Agreement No. 3015-E-0017
Assignment No. 8
WP 3102-15-00

Installation of High Tension Cable Median Barrier at Hwy 401, Windsor to London- Interchanges of Essex Rd. 42 (Sta. 16+200 Tibury W) and Victoria Rd. (Sta. 11+200 Howard Twp.)

BOREHOLE LOCATION PLAN AND SOIL STRATA

SHEET 1



PLAN



KEY PLAN

- LEGEND**
- Location of New Boreholes Drilled by EXP
 - Standard Penetration Test (Blows/0.3 m)
 - Groundwater level measured in open hole (Note: All other boreholes were dry)

SOIL STRATA


	FILL: SAND AND GRAVEL		SLTY SAND
	FILL: SILTY SAND/ SANDY SILT/ SAND/ SILT		TOPSOIL
	FILL: SILTY CLAY/ CLAYEY SILT		SLTY CLAY/ CLAYEY SILT

BH No.	APPROX. ELEV.	MTM CO-ORDINATES	
		NORTHING	EASTING
BH17-20	183.5	4693884.5	338856.8
BH17-19	184.1	4694146.7	339602.7
BH17-18	185.3	4694388.1	340287.1
BH17-17	185.9	4694761.5	341335.0
BH17-16	187.2	4695060.5	342159.2
BH17-15	188.4	4695462.6	343176.7
BH17-14	188.7	4696058.1	343832.7
BH17-13	188.4	4696744.7	344561.1
BH17-12	189.3	4697510.3	345368.0
BH17-11	189.9	4698101.9	345967.9


NOTE

This drawing is for subsurface information only. The proposed structure details/works are shown for illustration purposes only and may not be consistent with the final design configuration as shown elsewhere in the Contracts Documents.


The complete foundation investigation and design report for this project and other related documents may be examined at the Materials Engineering and Research Office, Downsview. Information contained in the report and related documents are specifically excluded in accordance with the conditions of Section GC 2.01 of OPS Gen. Cond.



SM	SUBMISSION FOR MTO REVIEW		
DATE	BY	DESCRIPTION	
		GEOCRE NO. 4018-69	
		PROJECT NO. ADM-00235197-L0	
SUBMD SM	CHECKED SM	DATE	Jan. 24, 18
DRAWN SH	CHECKED SM	APPROVED SG	DWG. 4

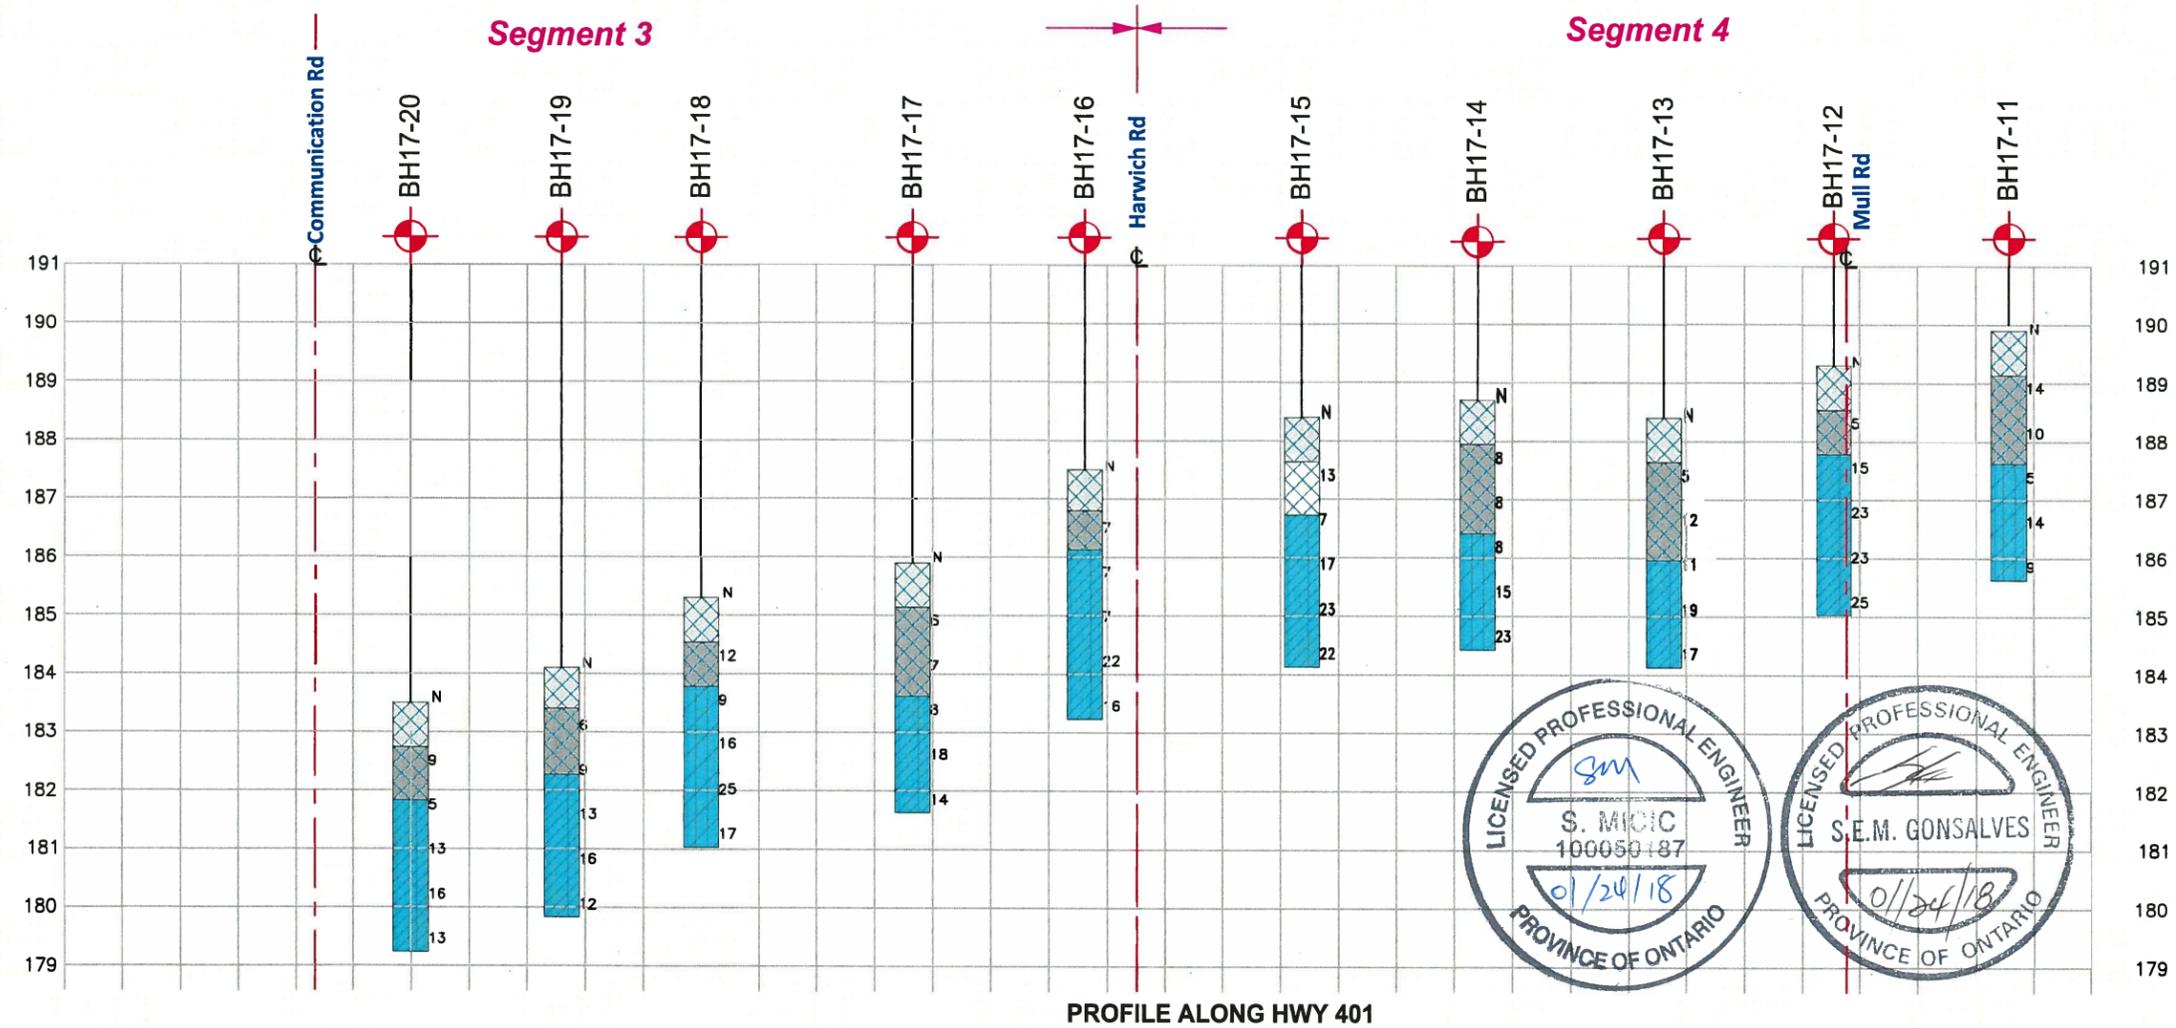

PROFILE ALONG HWY 401

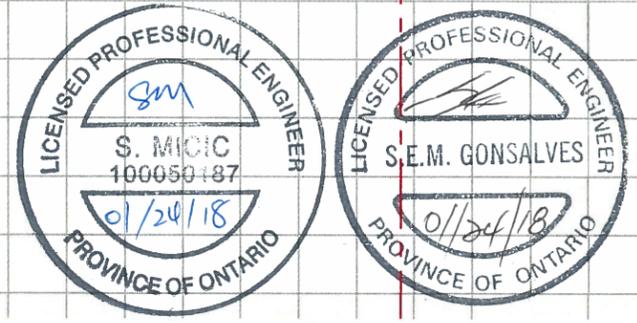


METRIC
DIMENSIONS ARE IN METERS
UNLESS OTHERWISE SHOWN

Agreement No. 3015-E-0017
Assignment No. 8
WP 3102-15-00

Installation of High Tension Cable Median Barrier at Hwy 401, Windsor to London- Interchanges of Essex Rd. 42 (Sta. 16+200 Tibury W) and Victoria Rd. (Sta. 11+200 Howard Twp.)

BOREHOLE LOCATION PLAN AND SOIL STRATA

SHEET 1

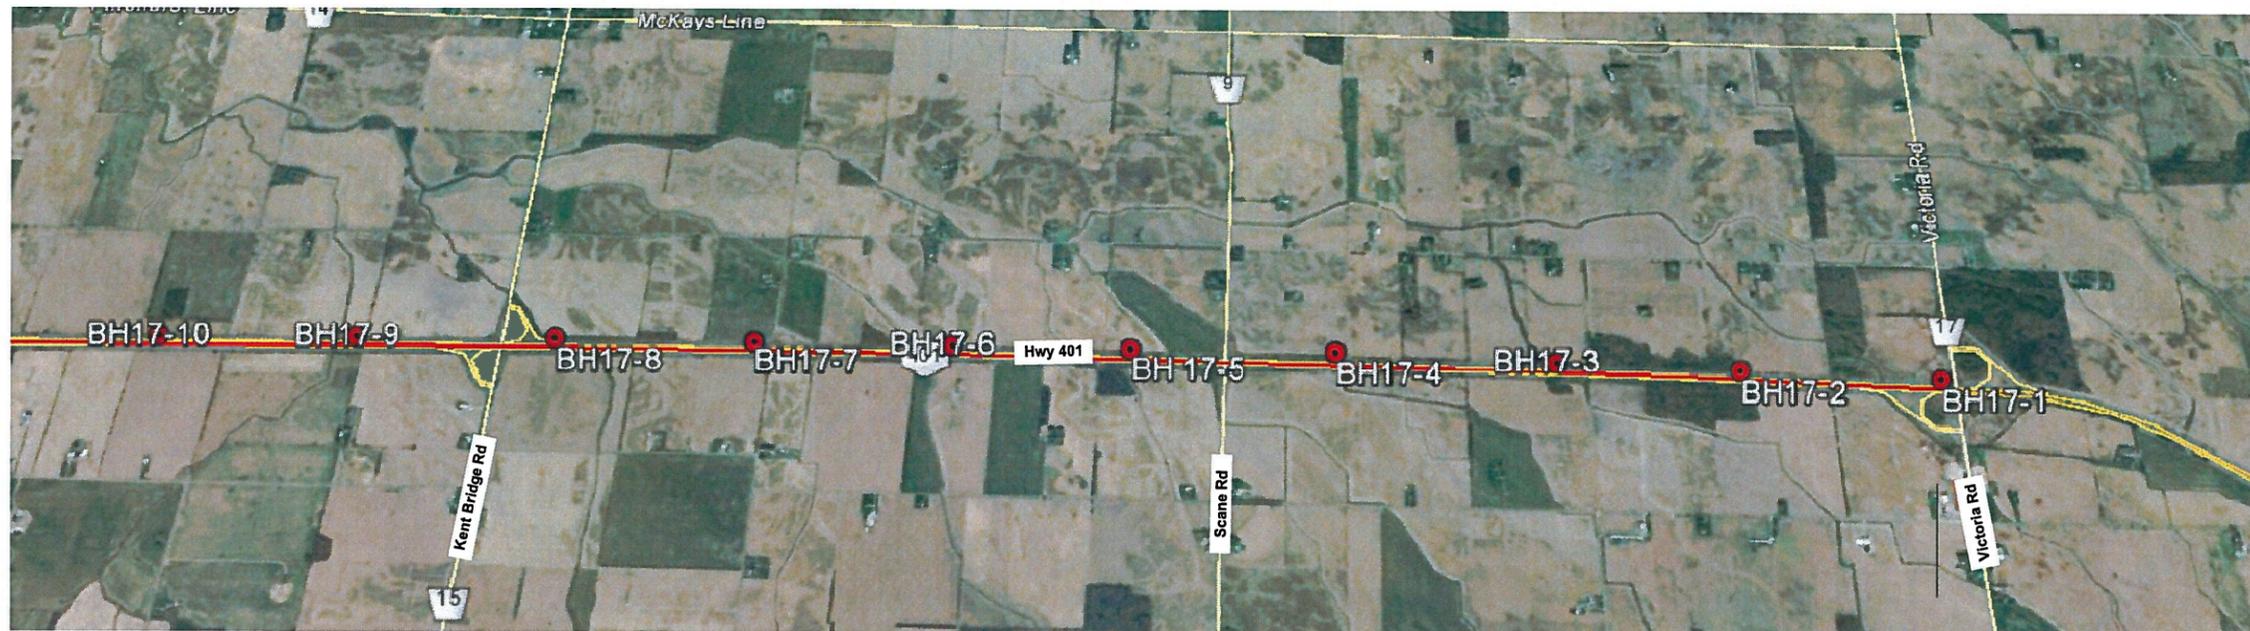

PLAN

exp Services Inc.



KEY PLAN

- LEGEND**
- Location of New Boreholes Drilled by EXP
 - N Standard Penetration Test (Blows/0.3 m)
 - Groundwater level measured in open hole (Note: All other boreholes were dry)

SOIL STRATA



- FILL: SAND AND GRAVEL
- FILL: SILTY SAND/ SANDY SILT/ SAND/ SILT
- FILL: SILTY CLAY/ CLAYEY SILT
- SILTY SAND
- TOPSOIL
- SILTY CLAY/ CLAYEY SILT

BH No.	APPROX. ELEV.	MTM CO-ORDINATES	
		NORTHING	EASTING
BH17-10	188.7	4698794.2	346681.5
BH17-09	188.1	4699534.9	347432.6
BH17-08	188.4	4700163.4	348093.3
BH17-07	188.7	4700897.8	348858.2
BH17-06	188.7	4701567.3	349567.1
BH17-05	190.2	4702144.1	350185.4
BH17-04	191.5	4702855.4	350925.4
BH17-03	191.4	4703594.7	351747.4
BH17-02	194.5	4704205.8	352427.6
BH17-01	193.5	4704875.8	353168.9

NOTE

This drawing is for subsurface information only. The proposed structure details/works are shown for illustration purposes only and may not be consistent with the final design configuration as shown elsewhere in the Contracts Documents.

The complete foundation investigation and design report for this project and other related documents may be examined at the Materials Engineering and Research Office, Downsview. Information contained in the report and related documents are specifically excluded in accordance with the conditions of Section GC 2.01 of OPS Gen. Cond.

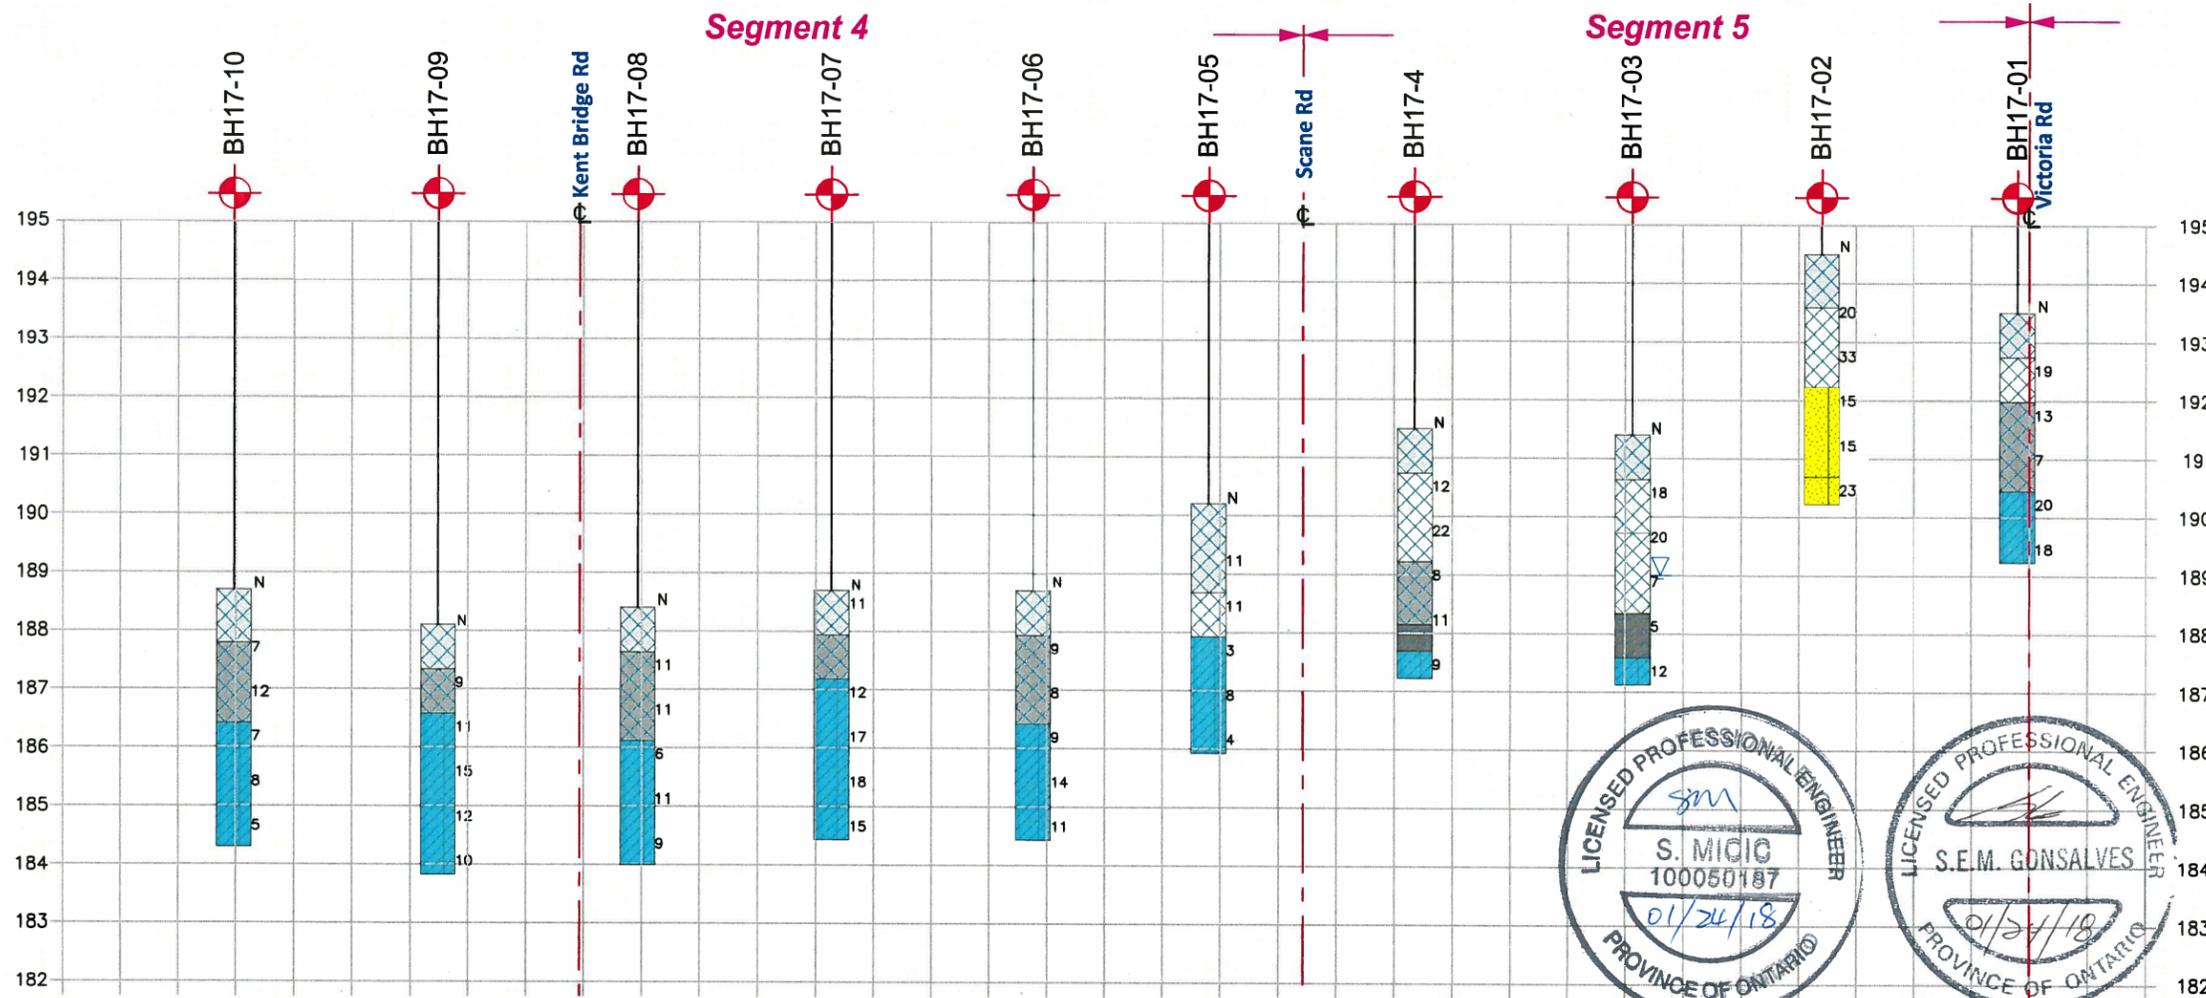

PROFILE ALONG HWY 401



SM	SUBMISSION FOR MTO REVIEW		
BY	DESCRIPTION		
	GEOCRE NO. 4018-69		
	PROJECT NO. ADM-00235197-L0		
SUBMD SM	CHECKED SM	DATE	Jan. 24, 18
DRAWN SH	CHECKED SM	APPROVED SG	DWG. 5

Appendix C – Borehole Logs

Explanation of Terms Used on Borehole Records

SOIL DESCRIPTION

Terminology describing common soil genesis:

Topsoil: mixture of soil and humus capable of supporting good vegetative growth.

Peat: fibrous fragments of visible and invisible decayed organic matter.

Fill: where fill is designated on the borehole log it is defined as indicated by the sample recovered during the boring process. The reader is cautioned that fills are heterogeneous in nature and variable in density or degree of compaction. The borehole description may therefore not be applicable as a general description of site fill materials. All fills should be expected to contain obstruction such as wood, large concrete pieces or subsurface basements, floors, tanks, etc.; none of these may have been encountered in the boreholes. Since boreholes cannot accurately define the contents of the fill, test pits are recommended to provide supplementary information. Despite the use of test pits, the heterogeneous nature of fill will leave some ambiguity as to the exact composition of the fill. Most fills contain pockets, seams, or layers of organically contaminated soil. This organic material can result in the generation of methane gas and/or significant ongoing and future settlements. Fill at this site may have been monitored for the presence of methane gas and, if so, the results are given on the borehole logs. The monitoring process does not indicate the volume of gas that can be potentially generated nor does it pinpoint the source of the gas. These readings are to advise of the presence of gas only, and a detailed study is recommended for sites where any explosive gas/methane is detected. Some fill material may be contaminated by toxic/hazardous waste that renders it unacceptable for deposition in any but designated land fill sites; unless specifically stated the fill on this site has not been tested for contaminants that may be considered toxic or hazardous. This testing and a potential hazard study can be undertaken if requested. In most residential/commercial areas undergoing reconstruction, buried oil tanks are common and are generally not detected in a conventional geotechnical site investigation.

Till: the term till on the borehole logs indicates that the material originates from a geological process associated with glaciation. Because of this geological process the till must be considered heterogeneous in composition and as such may contain pockets and/or seams of material such as sand, gravel, silt or clay. Till often contains cobbles (60 to 200 mm) or boulders (over 200 mm). Contractors may therefore encounter cobbles and boulders during excavation, even if they are not indicated by the borings. It should be appreciated that normal sampling equipment cannot differentiate the size or type of any obstruction. Because of the horizontal and vertical variability of till, the sample description may be applicable to a very limited zone; caution is therefore essential when dealing with sensitive excavations or dewatering programs in till materials.

Terminology describing soil structure:

Desiccated: having visible signs of weathering by oxidization of clay minerals, shrinkage cracks, etc.

Stratified: alternating layers of varying material or color with the layers greater than 6 mm thick.

Laminated: alternating layers of varying material or color with the layers less than 6 mm thick.

Fissured: material breaks along plane of fracture.

Varved: composed of regular alternating layers of silt and clay.

Slickensided: fracture planes appear polished or glossy, sometimes striated.

Blocky: cohesive soil that can be broken down into small angular lumps which resist further breakdown.

Lensed: inclusion of small pockets of different soil, such as small lenses of sand scattered through a mass of clay; not thickness.


Seam: a thin, confined layer of soil having different particle size, texture, or color from materials above and below.

Homogeneous: same color and appearance throughout.

Well Graded: having wide range in grain sized and substantial amounts of all predominantly on grain size.

Uniformly Graded: predominantly on grain size.

All soil sample descriptions included in this report follow the ASTM D2487-11 Standard Practice for Classification of Soils for Engineering Purposes (Unified Soil Classification System). The system divides soils into three major categories: (1) coarse grained, (2) fine-grained, and (3) highly organic. The soil is then subdivided based on either gradation or plasticity characteristics. The system provides a group symbol (e.g. SM) and group name (e.g. silty sand) for identification. The classification excludes particles larger than 76 mm. Please note that, with the exception of those samples where a grain size analysis has been made, all samples are classified visually in accordance with ASTM D2488-09a Standard Practice for Description and Identification of Soils (Visual-Manual Procedure). Visual classification is not sufficiently accurate to provide exact grain sizing or precise differentiation between size classification systems. Others may use different classification systems; one such system is the ISSMFE Soil Classification.

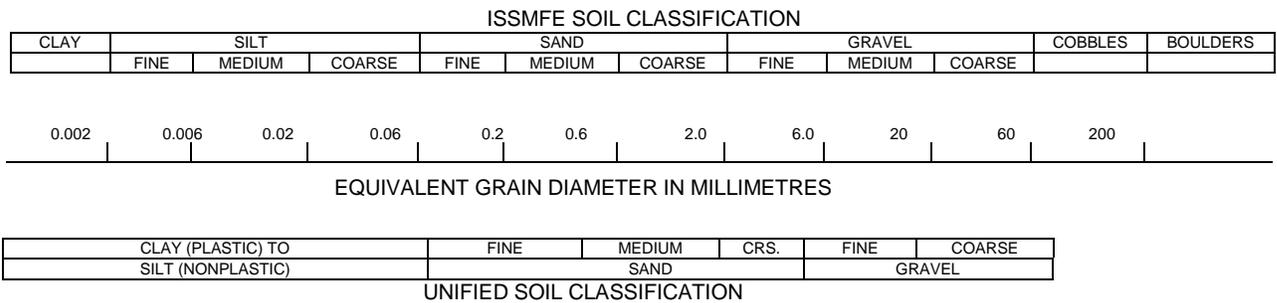

Terminology describing materials outside the USCS, (e.g. particles larger than 76 mm, visible organic matter, construction debris) is based upon the proportion of these materials present and as described below in accordance with Note 16 in ASTM D2488-09a:

Table a: Percent or Proportion of Soil, Pp

	Criteria
Trace	Particles are present but estimated to be less than 5%
Few	$5 \leq Pp \leq 10\%$
Little	$15 \leq Pp \leq 25\%$
Some	$30 \leq Pp \leq 45\%$
Mostly	$50 \leq Pp \leq 100\%$

The standard terminology to describe cohesionless soils includes the compactness as determined by the Standard Penetration Test 'N' value:

Table b: Apparent Density of Cohesionless Soil

	'N' Value (blows/0.3 m)
Very Loose	$N < 5$
Loose	$5 \leq N < 10$
Compact	$10 \leq N < 30$
Dense	$30 \leq N < 50$
Very Dense	$50 \leq N$

The standard terminology to describe cohesive soils includes consistency, which is based on undrained shear strength as measured by insitu vane tests, penetrometer tests, unconfined compression tests or similar field and laboratory analysis, Standard Penetration Test 'N' values can also be used to provide an approximate indication of the consistency and shear strength of fine grained, cohesive soils:


Table c: Consistency of Cohesive Soil

Consistency	Vane Shear Measurement (kPa)	'N' Value
Very Soft	<12.5	<2
Soft	12.5-25	2-4
Firm	25-50	4-8
Stiff	50-100	8-15
Very Stiff	100-200	15-30
Hard	>200	>30

Note: 'N' Value - The Standard Penetration Test records the number of blows of a 140 pound (64kg) hammer falling 30 inches (760mm), required to drive a 2 inch (50.8mm) O.D. split spoon sampler 1 foot (305mm). For split spoon samples where full penetration is not achieved, the number of blows is reported over the sampler penetration in meters (e.g. 50/0.15).

STRATA PLOT

Strata plots symbolize the soil or bedrock description. They are combinations of the following basic symbols:

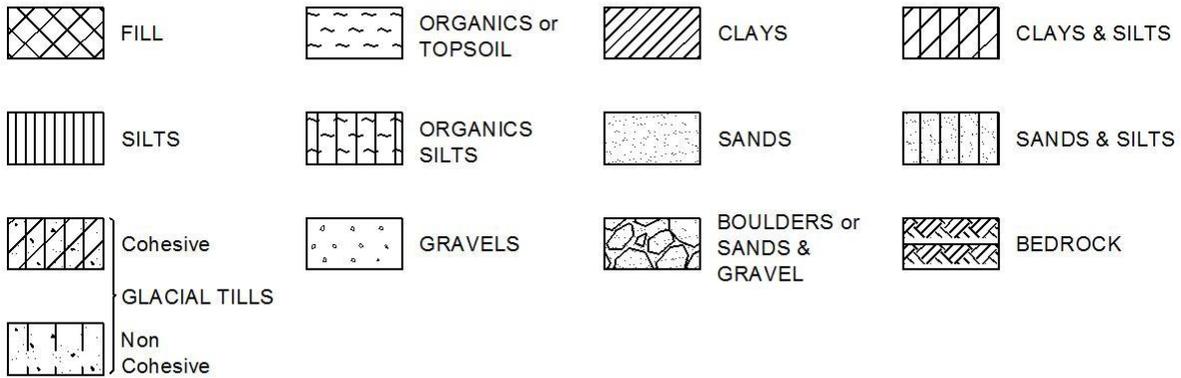

WATER LEVEL MEASUREMENT



Open Borehole or Test Pit



Monitoring Well, Piezometer or Standpipe

ABBREVIATIONS AND SYMBOLS

FIELD SAMPLING

SS	Split spoon sample (obtained from the Standard Penetration Test)
WS	Wash sample
BS	Bulk sample
TW	Thin wall sample or Shelby tube
PS	Piston sample
AS	Auger sample
VT	Vane test
GS	Grab sample
HQ, NQ, etc.	Rock core samples obtained with the use of standard size diamond drilling bits

STRESS AND STRAIN

u_w	kPa	Pore water pressure
r_u	1	Pore pressure ratio
σ	kPa	Total normal stress
σ'	kPa	Effective normal stress
τ	kPa	Shear stress
$\sigma_1, \sigma_2, \sigma_3$	kPa	Principal stresses
ε	%	Linear strain
$\varepsilon_1, \varepsilon_2, \varepsilon_3$	%	Principal strains
E	kPa	Modulus of linear deformation
G	kPa	Modulus of shear deformation
μ	1	Coefficient of friction

MECHANICAL PROPERTIES OF SOIL

m_v	kPa^{-1}	Coefficient of volume change
c_c	1	Compression index
c_s	1	Swelling index
c_r	1	Recompression index
c_v	m^2/s	Coefficient of consolidation
H	m	Drainage path
T_v	1	Time factor
U	%	Degree of consolidation
σ'_{v0}	kPa	Effective overburden pressure
σ'_p	kPa	Preconsolidation pressure
τ_f	kPa	Shear strength
c'	kPa	Effective cohesion intercept
ϕ'	$-\circ$	Effective angle of internal friction
c_u	kPa	Apparent cohesion intercept
ϕ_u	$-\circ$	Apparent angle of internal friction
τ_R	kPa	Residual shear strength
τ_r	kPa	Remoulded shear strength
S_t	1	Sensitivity = c_u/τ_r

PHYSICAL PROPERTIES OF SOIL

P_s	kg/m^3	Density of solid particles
γ_s	kN/m^3	Unit weight of solid particles
ρ_w	kg/m^3	Density of water
γ_w	kN/m^3	Unit weight of water
ρ	kg/m^3	Density of soil
γ	kN/m^3	Unit weight of soil
ρ_d	kg/m^3	Density of dry soil
γ_d	kN/m^3	Unit weight of dry soil
ρ_{sat}	kg/m^3	Density of saturated soil
γ_{sat}	kN/m^3	Unit weight of saturated soil
ρ'	kg/m^3	Density of submerged soil
γ'	kN/m^3	Unit weight of submerged soil
e	1, %	Void ratio
n	1, %	Porosity
w	1, %	Water content
S_r	%	Degree of saturation
W_L	%	Liquid limit
W_P	%	Plastic limit
W_s	%	Shrinkage limit
I_P	%	Plasticity index = $(W_L - W_P)$
I_L	%	Liquidity index = $(W - W_P)/I_P$
I_C	%	Consistency index = $(W_L - W)/I_P$
e_{max}	1, %	Void ratio in loosest state
e_{min}	1, %	Void ratio in densest state
I_D	1	Density index = $(e_{max} - e)/(e_{max} - e_{min})$
D	mm	Grain diameter
D_n	mm	N percent - diameter
C_u	1	Uniformity coefficient
h	m	Hydraulic head or potential
q	m^3/s	Rate of discharge
v	m/s	Discharge velocity
i	1	Hydraulic gradient
k	m/s	Hydraulic conductivity
j	kN/m^3	Seepage force

Brampton, Ontario

RECORD OF BOREHOLE No 17-52

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4680908.58N, 309283.01E ORIGINATED BY MU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.11.21 - 2017.11.21 LATITUDE 42.2677306 LONGITUDE -82.4456567 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)	
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa									WATER CONTENT (%)
						20	40	60	80	100	20	40	60		GR SA SI CL		
178.6 0.0	Ground Surface FILL: SAND AND GRAVEL trace silt																
177.8 0.8	FILL: SILTY CLAY trace gravel, little sand, brown and grey mottled, moist, firm to very stiff		1	SS	6				X								
			2	SS	5							X					
			3	SS	5				X								
			4	SS	17								>>X			1	16 39 44
			5	SS	18								>>X				
174.5 4.3	SILTY CLAY/CLAYEY SILT - trace gravel, trace sand, brown and grey mottled, moist, very stiff End of Borehole at 4.27 m below ground surface.																
174.3 4.3	Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 2.44 m below ground surface. 3. Borehole was dry in open hole.																

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, X³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-51

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 468124.10N, 352688.66E ORIGINATED BY MU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.11.21 - 2017.11.21 LATITUDE 42.267876 LONGITUDE -82.43801 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20
177.4 0.0	Ground Surface FILL: SAND AND GRAVEL trace silt																	
176.6 0.8	FILL: SILTY CLAY trace gravel, little sand, brown and grey mottled, moist, stiff		1	SS	10						>>X	o						
176			2	SS	8							>>X	o					
175			3	SS	20								>>X	o				
174.8 2.6	SILTY CLAY/CLAYEY SILT trace gravel, trace to some sand, brown, moist, very stiff		4	SS	17							>>X	o					
174			5	SS	15								>>X	o				
173.1 4.3			End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 2.74 m below ground surface. 3. Borehole was dry in open hole.															

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity o 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-50

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4681316.32N, 310948.21E ORIGINATED BY MU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.11.21 - 2017.11.21 LATITUDE 42.2713903 LONGITUDE -82.4254668 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20
177.6 0.0	Ground Surface FILL: SAND AND GRAVEL trace silt																	
176.8 0.8	FILL: SILTY CLAY trace gravel, trace to little sand, brown and grey mottled, moist, firm		1	SS	5													
175.3 2.3	SILTY CLAY/CLAYEY SILT trace gravel, trace to little sand, brown to grey, moist, firm to very stiff		2	SS	8													
			3	SS	13													
			4	SS	20													
173.3 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 2.44 m below ground surface. 3. Borehole was dry in open hole.		5	SS	5													

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, ×³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-49

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4681512.44N, 311741.18E ORIGINATED BY MU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.11.21 - 2017.11.21 LATITUDE 42.2731494 LONGITUDE -82.4158515 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)			
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20	40
177.7 0.0	Ground Surface FILL: SAND AND GRAVEL trace silt																		
176.9 0.8	FILL: SILTY CLAY trace gravel, little sand, brown and grey mottled, moist, stiff		1	SS	9														
			2	SS	10														
			3	SS	7														
174.6 3.1	SILTY CLAY/CLAYEY SILT trace gravel, few to little sand, brown to grey, moist, stiff		4	SS	8														
173.4 4.3			5	SS	9														
End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 3.05 m below ground surface. 3. Borehole was dry in open hole.																			

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-48

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4681701.67N, 312603.2E ORIGINATED BY MU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.11.21 - 2017.11.21 LATITUDE 42.274845 LONGITUDE -82.4053986 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT				PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)	
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa								WATER CONTENT (%)
						20	40	60	80	100	20	40	60		GR SA SI CL	
177.7 0.0	Ground Surface FILL: SAND AND GRAVEL trace silt															
176.9 0.8	FILL: SILTY CLAY trace gravel, trace to little sand, brown and grey mottled, moist, stiff		1	SS	11						>>X					
			2	SS	10						X					
175.4 2.3	SILTY CLAY/CLAYEY SILT trace gravel, trace to little sand, brown to grey, moist, stiff to very stiff		3	SS	9				X							
			4	SS	17						>>X					
173.4 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 3.05 m below ground surface. 3. Groundwater level was measured in open hole upon completion of drilling at 1.52 m below ground surface.		5	SS	16						>>X					

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, X³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-47

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4682000.09N, 313882.82E ORIGINATED BY MU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.11.21 - 2017.11.21 LATITUDE 42.277518 LONGITUDE -82.3898806 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20
178.3 0.0	Ground Surface FILL: SAND AND GRAVEL trace asphalt, trace silt																	
177.5 0.8	FILL: SILTY CLAY trace gravel, trace to little sand, brown and grey mottled, moist, firm		1	SS	5							X	o					
			2	SS	7				X				o					
176.0 2.3	SILTY CLAY/CLAYEY SILT trace gravel, little sand, brown to grey, moist, stiff		3	SS	8							>>X	o					
			4	SS	13							>>X	o	10				2 24 42 32
174.0 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 3.05 m below ground surface. 3. Borehole was dry in open hole.		5	SS	14							>>X	o					

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity o 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-46

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4682201.47N, 314741.62E ORIGINATED BY MU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.11.21 - 2017.11.21 LATITUDE 42.2793207 LONGITUDE -82.3794651 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)	
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa									WATER CONTENT (%)
						20	40	60	80	100	20	40	60		GR SA SI CL		
179.1 0.0	Ground Surface FILL: SAND AND GRAVEL trace silt, trace asphalt, trace topsoil																
178.3 0.8	FILL: SILTY CLAY trace gravel, trace to little sand, brown and grey mottled, moist, firm to stiff		1	SS	5						X						
			2	SS	7							X					
			3	SS	10								>>X				
176.0 3.1	SILTY CLAY/CLAYEY SILT trace gravel, trace to little sand, brown to grey, moist, stiff to very stiff		4	SS	12												
174.8 4.3			5	SS	23												
	<p>End of Borehole at 4.27 m below ground surface.</p> <p>Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 3.05 m below ground surface. 3. Borehole was dry in open hole.</p>																

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, X³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-45

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4682420.92N, 316307.63E ORIGINATED BY MU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.11.21 - 2017.11.21 LATITUDE 42.281275 LONGITUDE -82.3604741 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa								
						20	40	60	80	100	20	40	60		GR SA SI CL	
179.2 0.0	Ground Surface FILL: SAND AND GRAVEL trace silt, trace asphalt, trace topsoil															
178.4 0.8	FILL: SILTY CLAY - trace gravel, trace to little sand, brown and grey mottled, moist, stiff		1	SS	12											
			2	SS	9											
			3	SS	8											
176.1 3.1	SILTY CLAY/CLAYEY SILT trace gravel, trace to some sand, brown to grey, moist, stiff to very stiff		4	SS	15											
174.9 4.3			5	SS	10											
	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 3.05 m below ground surface. 3. Borehole was dry in open hole.															

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, ×³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-44

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON.4683081.20N,317107.54E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.11.20 - 2017.11.20 LATITUDE 42.2872076 LONGITUDE -82.3507615 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)			
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20	40
179.1 0.0	Ground Surface FILL: SAND AND GRAVEL trace silt, trace asphalt, trace topsoil																		
178.3 0.8	FILL: SILTY CLAY trace organics, trace gravel, trace to little sand, dark brown to grey, moist, firm to stiff		1	SS	8														
			2	SS	7														
176.8 2.3	SILTY CLAY/CLAYEY SILT occasional cobbles, trace gravel, little sand, brown to grey, moist, stiff to very stiff		3	SS	8														
			4	SS	18														
			5	SS	19														
174.8 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 3.66 m below ground surface. 3. Borehole was dry in open hole.																	1 19 35 35	

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, ×³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

RECORD OF BOREHOLE No 17-43

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON.44683713.29N,317805.72E ORIGINATED BY MU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.11.20 - 2017.11.20 LATITUDE 42.2928873 LONGITUDE -82.3422813 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT				PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa							
						20	40	60	80	100	20	40	60		GR SA SI CL
179.3 0.0	Ground Surface FILL: SAND AND GRAVEL trace silt, trace asphalt, trace topsoil, compact		1	SS	26										
178.5 0.8	FILL: SILTY CLAY trace gravel, few to little sand, brown to grey, moist, stiff		2	SS	9						>>X				
			3	SS	8						>>X				1 11 36 52
177.0 2.3	SILTY CLAY/CLAYEY SILT trace gravel, trace to little sand, brown to grey, moist, stiff to very stiff		4	SS	12						>>X				
			5	SS	21						>>X				
175.0 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.1 m below ground surface. 3. Borehole was dry in open hole.		6	SS	19						>>X				

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-42

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON.4684348.05N, 318513.36E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.11.20 - 2017.11.20 LATITUDE 42.2985902 LONGITUDE -82.3336849 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)	
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa									WATER CONTENT (%)
						20	40	60	80	100	20	40	60		GR SA SI CL		
178.0	Ground Surface																
0.0	FILL: SAND AND GRAVEL trace silt, trace asphalt, trace topsoil																
177.2	FILL: SILTY CLAY trace gravel, few to little sand, trace organics, brown to grey, moist, firm		1	SS	6												
0.8			2	SS	5												
			3	SS	5												
175.4	SILTY CLAY/CLAYEY SILT trace gravel, few to little sand seams, brown to grey, moist, firm to very stiff		4	SS	17												
2.6			5	SS	18												
173.7	End of Borehole at 4.27 m below ground surface.																
4.3	Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 3.35 m below ground surface. 3. Borehole was dry in open hole.																

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-41

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4685056.47N, 319449.57E ORIGINATED BY MU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.11.20 - 2017.11.20 LATITUDE 42.3049514 LONGITUDE -82.3223127 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20
177.8 0.0	Ground Surface FILL: SAND AND GRAVEL trace silt, trace asphalt, trace topsoil		1	SS	12													
177.0 0.8	FILL: SILTY CLAY trace topsoil, trace gravel, trace sand, brown, moist, stiff		2	SS	10													
176.3 1.5	SILTY CLAY/CLAYEY SILT trace gravel, little sand seams, brown to grey, moist, firm to very stiff		3	SS	7													
			4	SS	8													
			5	SS	18													
173.5 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.		6	SS	20													

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, ×³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-40

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4685561.12N, 320374.16E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.11.20 - 2017.11.20 LATITUDE 42.309477 LONGITUDE -82.3110846 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)			
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20	40
178.8 0.0	Ground Surface FILL: SAND AND GRAVEL trace silt, trace asphalt, trace topsoil																		
178.0 0.8	FILL: SILTY CLAY trace topsoil, little gravel, some sand, dark brown, moist, stiff		1	SS	9														
			2	SS	12														
			3	SS	8														
175.7 3.1	SILTY CLAY/CLAYEY SILT trace gravel, occasional sand seams, brown to grey, moist, stiff		4	SS	8														
			5	SS	12														
174.5 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 3.35 m below ground surface. 3. Borehole was dry in open hole.																		

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, ×³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-39

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4685763.16N, 320746.72E ORIGINATED BY MU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.11.20 - 2017.11.20 LATITUDE 42.3112885 LONGITUDE -82.3065599 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%) GR SA SI CL		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20
178.4 0.0	Ground Surface FILL: SAND AND GRAVEL trace silt, trace asphalt, loose		1	SS	9													
177.6 0.8	FILL: SILTY CLAY trace organics, trace gravel, brown, moist, stiff		2	SS	8													
176.9 1.5	SILTY CLAY/CLAYEY SILT trace gravel, occasional sand seams, brown to grey, moist, firm to stiff		3	SS	8													
			4	SS	7													
			5	SS	7													
			6	SS	14													
174.1 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 3.81 m below ground surface. 3. Borehole was dry in open hole.																	

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, ×³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-38

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4686302.67N, 321827.66E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.11.20 - 2017.11.20 LATITUDE 42.3161231 LONGITUDE -82.2934319 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)				
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20	40	60
178.4 0.0	Ground Surface FILL: SAND AND GRAVEL trace silt, trace asphalt																			
177.6 0.8	FILL: SILTY CLAY trace organics, trace gravel, brown, moist, firm		1	SS	7				X			o								
			2	SS	7			X				o								
176.1 2.3	SILTY CLAY/CLAYEY SILT trace gravel, little sand seams, brown to grey, moist, firm to very stiff		3	SS	6						>>X	o								
			4	SS	9				X			o								
174.1 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 3.35 m below ground surface. 3. Borehole was dry in open hole.		5	SS	24						>>X	o	—				1	20	41	35

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity o 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-37

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4686382.47N, 322626.41E ORIGINATED BY MU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.11.20 - 2017.11.20 LATITUDE 42.3168237 LONGITUDE -82.2837396 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT				PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa							
						20	40	60	80	100	20	40	60		GR SA SI CL
178.1 0.0	Ground Surface FILL: SAND AND GRAVEL trace silt, trace asphalt, compact		1	SS	10										41 50 (9)
177.3 0.8	FILL: SILTY CLAY trace organics, trace gravel, brown to black, moist, firm to stiff		2	SS	11						X				
			3	SS	7				X						
175.8 2.3	SILTY CLAY/CLAYEY SILT trace gravel, few to little sand seams, brown to grey, moist, firm to very stiff		4	SS	14						X				1 13 39 44
			5	SS	16						>>X				
			6	SS	21						>>X				
173.8 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 3.67 m below ground surface. 3. Borehole was dry in open hole.														

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, X³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-36

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4686491.85N, 323905.99E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.11.20 - 2017.11.20 LATITUDE 42.3177782 LONGITUDE -82.2682129 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa								
						20	40	60	80	100	20	40	60		GR SA SI CL	
178.7 0.0	Ground Surface FILL: SAND AND GRAVEL trace silt, trace asphalt															
177.9 0.8	FILL: SILTY CLAY trace organics, trace gravel, brown to black, moist, firm to stiff		1	SS	5						>>X					
			2	SS	8				X							
176.4 2.3	SILTY CLAY/CLAYEY SILT few gravel, little sand seams, brown to grey, moist, stiff to very stiff		3	SS	11						>>X					
			4	SS	14				X							5 21 (74)
174.4 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Since, borehole was caved upto top after auger pullout, groundwater level was not measured in open hole upon completion of drilling.		5	SS	15						>>X					

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, X³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-35

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4686803.27N, 324678.78E ORIGINATED BY MU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.11.20 - 2017.11.20 LATITUDE 42.3205627 LONGITUDE -82.2588273 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)			
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20	40
178.4 0.0	Ground Surface FILL: SAND AND GRAVEL trace silt, trace asphalt, trace topsoil																		
177.6 0.8	FILL: SILTY CLAY few sand, dark brown to grey, moist, firm to stiff		1	SS	9														
			2	SS	10														
			3	SS	6						X								
			4	SS	14														
174.6 3.8	SILTY CLAY/CLAYEY SILT trace gravel, occasional sand seams, brown to grey, moist, stiff		5	SS	14														
174.1 4.3																			
	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 3.58 m below ground surface. 3. Borehole was dry in open hole.																		

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, X³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-34

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4687233.23N, 325780.24E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.19 - 2017.12.19 LATITUDE 42.32440489 LONGITUDE -82.24544843 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT				PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa							
						20	40	60	80	100	20	40	60		GR SA SI CL
179.8 0.0	Ground Surface FILL: SAND AND GRAVEL														
179.0 0.8	FILL: CLAYEY SILT trace gravel, trace organics, brown, moist, stiff		1	SS	12										
			2	SS	8										
177.5 2.3	SILTY CLAY/CLAYEY SILT few wet sand seams, brown to grey mottled, moist, firm to stiff		3	SS	6										
			4	SS	13										0 13 52 35
175.5 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.														

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-33

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4687618.69N, 326723.66E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.19 - 2017.12.19 LATITUDE 42.32784931 LONGITUDE -82.23398749 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa								
						20	40	60	80	100						
179.8 0.0	Ground Surface FILL: SAND AND GRAVEL															
179.0 0.8	FILL: CLAYEY SILT trace gravel, trace to little sand, brown to grey, moist, firm to very stiff	[Cross-hatched pattern]	1	SS	15											
			2	SS	6											
			3	SS	7											
176.8 3.1	SILTY CLAY/CLAYEY SILT trace gravel, trace sand, brown, moist, stiff to very stiff	[Diagonal hatched pattern]	4	SS	15											
175.5 4.3			5	SS	14											
	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.															

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, ×³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-32

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4687973.27N, 327589.40E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.19 - 2017.12.19 LATITUDE 42.33101686 LONGITUDE -82.22346909 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT				PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa							
						20	40	60	80	100	20	40	60		GR SA SI CL
179.8 0.0	Ground Surface FILL: SAND AND GRAVEL														
179.0 0.8	FILL: CLAYEY SILT trace to some organics, trace gravel, brown to grey, moist, firm to stiff		1	SS	13										
			2	SS	8				X						
177.4 2.4	SILT CLAY/CLAYEY SILT trace gravel, trace sand, brown to grey, moist, firm to stiff		3	SS	6				X						
			4	SS	11						X				
175.5 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.		5	SS	8				X						

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-31

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4688352.41N, 328509.43E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.19 - 2017.12.19 LATITUDE 42.33440297 LONGITUDE -82.21228988 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa								
						20	40	60	80	100	20	40	60		GR SA SI CL	
179.2 0.0	Ground Surface FILL: SAND AND GRAVEL															
178.4 0.8	FILL: CLAYEY SILT trace organics, trace gravel, grey/ brown, moist, stiff		1	SS	12						>>X	o				
177.7 1.5	SILTY CLAY/CLAYEY SILT trace gravel, little wet sand seams, brown to grey, moist to very moist, firm to very stiff		2	SS	9						>>X	o				
			3	SS	16						>>X	o				
	-becoming wet sandy seams		4	SS	8				X			o				
			5	SS	5		X					o				
174.8 4.4	End of Borehole at 4.4 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.				VANE											1 15 51 33

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, X³: Numbers refer to Sensitivity o 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-30

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4688779.93N, 329301.86E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.19 - 2017.12.19 LATITUDE 42.33822749 LONGITUDE -82.20265582 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)					
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	SHEAR STRENGTH kPa			
											○ UNCONFINED + FIELD VANE			● QUICK TRIAXIAL P. PENETROMETER			GR	SA	SI	CL	
179.2 0.0	Ground Surface FILL: SAND AND GRAVEL																				
178.4 0.8	FILL: CLAYEY SILT trace organics, trace gravel, brown to grey/black, moist, firm to stiff		1	SS	12																
			2	SS	9																
	-becoming with wet sand seams		3	SS	4																
176.1 3.1	SILTY CLAY/CLAYEY SILT trace gravel, little sand, moist, brown to grey, stiff to very stiff		4	SS	21																
			5	SS	10																
174.9 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.																				

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, ×³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

RECORD OF BOREHOLE No 17-29

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4689539.81N, 330125.75E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.19 - 2017.12.19 LATITUDE 42.34504261 LONGITUDE -82.19262431 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa								
						20	40	60	80	100	20	40	60		GR SA SI CL	
180.1 0.0	Ground Surface FILL: SAND AND GRAVEL															
179.3 0.8	FILL: CLAYEY SILT trace organics, trace gravel, trace sand, brown/black, moist, stiff		1	SS	12						>>X	o				
			2	SS	11						>>X	o				
177.8 2.3	SILTY CLAY/CLAYEY SILT trace gravel, little sand, brown to grey, moist, firm to very stiff		3	SS	12						>>X	o				
			4	SS	15						>>X	o			1	19 45 35
			5	SS	7				X			o				
175.8 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.															

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity o 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-28

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4690386.06N, 331030.64E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.19 - 2017.12.19 LATITUDE 42.3526316 LONGITUDE -82.1816035 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT				PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa							
						20	40	60	80	100	20	40	60		GR SA SI CL
181.4 0.0	Ground Surface FILL: SAND AND GRAVEL														
180.6 0.8	FILL: CLAYEY SILT some organics, trace sand, brown, moist, very stiff -becoming grey to black		1	SS	18						>>X				
			2	SS	12				X						
			3	SS	5			X							0 3 64 33
178.4 3.1	SILTY CLAY/CLAYEY SILT trace gravel, trace sand, brown to grey, moist, firm to stiff		4	SS	9				X						
			5	SS	7		X								
177.0 4.4	End of Borehole at 4.4 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.		VANE												

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-27

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4690835.98N, 331606.91E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.19 - 2017.12.19 LATITUDE 42.35666276 LONGITUDE -82.17458775 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)				
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20	40	60
180.1 0.0	Ground Surface FILL: SAND AND GRAVEL trace recycled asphalt																			
179.3 0.8	FILL: CLAYEY SILT few sand, brown, moist, stiff		1	SS	15							o						0 11 (89)		
178.6 1.5	SILTY CLAY/CLAYEY SILT trace gravel, occasional wet sand seams, brown to grey, very moist, firm		2	SS	5															
			3	SS	5				X											
			4	SS	6				X											
			5	SS	4															
			VANE																	
175.7 4.4	End of Borehole at 4.4 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.																			

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity o 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-26

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4691389.89N, 332514.86E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.21 - 2017.12.21 LATITUDE 42.36161791 LONGITUDE -82.16353962 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20
181.4	Ground Surface																	
0.0	FILL: SAND AND GRAVEL																	
180.6						181												
0.8	FILL: SANDY SILT trace gravel, brown, moist, compact		1	SS	16													
179.9						180												
1.5	SILTY CLAY/CLAYEY SILT trace sand seams, brown to grey, moist to wet, firm		2	SS	6		X											
						179												
			3	SS	4		X											
						178												
			4	SS	5		X											0 2 81 17
	- becoming wet, very soft																	
			5	SS	WH													
177.0						177												
4.4	End of Borehole at 4.4 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.																	

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, X³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-25

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4691848.80N, 333617.65E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.21 - 2017.12.21 LATITUDE 42.36570954 LONGITUDE -82.15012891 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa								
						20	40	60	80	100	20	40	60		GR SA SI CL	
182.0 0.0	Ground Surface FILL: SAND AND GRAVEL															
181.2 0.8	FILL: SANDY SILT some organics, brown/black, moist, compact		1	SS	13											
180.5 1.5	FILL: SILTY CLAY/CLAYEY SILT trace organics, few sand seams, brown/black to brown/grey, moist, firm		2	SS	8				X						0 7 (93)	
			3	SS	6				X							
178.9 3.1	SILTY CLAY/CLAYEY SILT trace sand seams, brown to grey, moist, soft to firm		4	SS	3		X								0 2 78 20	
			5	SS	5		X									
177.6 4.4	End of Borehole at 4.4 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.		VANE													

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, X³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-24

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4692184.21N, 334512.96E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.21 - 2017.12.21 LATITUDE 42.36869563 LONGITUDE -82.13924208 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT				PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)			
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60						80	100	20
182.3 0.0	Ground Surface FILL: SAND AND GRAVEL																	
181.5 0.8	FILL: SILTY CLAY trace gravel, trace to little sand, trace organics, brown, moist, stiff to very stiff		1	SS	16						>>X	○						
			2	SS	10						>>X	○						
180.0 2.3	SILTY CLAY/CLAYEY SILT trace sand seams, brown to grey, moist, firm		3	SS	4						>>X	○						
			4	SS	5						>>X	○						
178.0 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.		5	SS	5						>>X	○	— —					0 2 40 58

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, X³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-23

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4692559.68N, 335483.98E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.21 - 2017.12.21 LATITUDE 42.3720383 LONGITUDE -82.12743269 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20
183.2 0.0	Ground Surface FILL: SAND AND GRAVEL																	
182.4 0.8	FILL: CLAYEY SILT trace organics, trace gravel, trace to little sand, brown to grey, moist, stiff to very stiff		1	SS	15						>>X	o						
			2	SS	11						>>X		o					
180.9 2.3	SILTY CLAY/CLAYEY SILT trace gravel, few sand, brown to grey, moist, stiff to very stiff		3	SS	8						>>X		o					
			4	SS	20						>>X			4				3 23 45 29
			5	SS	13						>>X		o					
178.9 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.																	

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity o 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-22

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4692840.06N, 336197.49E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.21 - 2017.12.21 LATITUDE 42.37453421 LONGITUDE -82.11875409 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20
183.5 0.0	Ground Surface FILL: SAND AND GRAVEL																	
182.7 0.8	FILL: CLAYEY SILT trace organics, trace to some gravel, trace sand, brown, moist, stiff		1	SS	10													
182.0 1.5	FILL: SILT trace organics, trace sand, few clay, brown/black, moist, compact		2	SS	12													
180.4 3.1	FILL: SILTY CLAY some organics, trace sand, grey/black, moist, stiff		4	SS	9				X									
179.7 3.8	SILTY SAND trace gravel, grey, wet, compact		5	SS	21													
179.2 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 3.05 m below ground surface. 3. Borehole was dry in open hole.																	

Non Plastic
0 2 85 13

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, X³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-21

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4693358.72N, 337493.92E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.21 - 2017.12.21 LATITUDE 42.37915037 LONGITUDE -82.10298313 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT				PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)			
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60						80	100	20
184.4 0.0	Ground Surface FILL: SAND AND GRAVEL																	
183.6 0.8	FILL: CLAYEY SILT - trace gravel, trace sand, trace organics, brown, moist, stiff		1	SS	13													
182.1 2.3	SILTY CLAY/CLAYEY SILT trace organics, trace gravel, trace to few sand seams, brown to grey, moist, firm to stiff		2	SS	13													
			3	SS	6				X									0 2 66 32
			4	SS	5				X									
180.1 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.		5	SS	11													3 10 40 46

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-20

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4693884.46N, 338856.84E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.20 - 2017.12.20 LATITUDE 42.38382517 LONGITUDE -82.08640184 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT				PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa							
						20	40	60	80	100	20	40	60		GR SA SI CL
183.5 0.0	Ground Surface FILL: SAND AND GRAVEL														
182.7 0.8	FILL: CLAYEY SILT trace gravel, trace to some sand, trace topsoil, brown, moist, stiff		1	SS	9					X					
181.8 1.7	- becoming sandy silt, trace clay, brown, very moist @ 1.3 m below ground surface SILTY CLAY/CLAYEY SILT trace gravel, trace sand, brown to grey, moist, firm to very stiff		2	SS	5					X					
			3	SS	13					>>X					0 2 35 63
			4	SS	16					>>X					
			5	SS	13					>>X					
179.2 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.														

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-19

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4694146.72N, 339602.69E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.20 - 2017.12.20 LATITUDE 42.38615327 LONGITUDE -82.07732837 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20
184.1 0.0	Ground Surface FILL: SAND AND GRAVEL																	
183.3 0.8	FILL: CLAYEY SILT trace topsoil, trace gravel, trace to little sand, brown moist, firm		1	SS	6													
182.3 1.8	SLITY CLAY/CLAYEY SILT trace gravel, little sand, moist, stiff to very stiff		2	SS	9													
			3	SS	13													
			4	SS	16													
			5	SS	12													
179.8 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27m below ground surface. 3. Borehole was dry in open hole.																	

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, ×³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-18

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4694388.09N, 340287.09E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.20 - 2017.12.20 LATITUDE 42.38829538 LONGITUDE -82.06900186 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT				PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa							
						20	40	60	80	100	20	40	60		GR SA SI CL
185.3 0.0	Ground Surface FILL: SAND AND GRAVEL														
184.5 0.8	FILL: CLAYEY SILT trace organics, trace to little sand, brown/black, moist, stiff		1	SS	12						>>X				
183.8 1.5	SILTY CLAY/CLAYEY SILT trace gravel, little sand, brown to grey, moist, stiff to very stiff		2	SS	9						>>X				1 6 (93)
			3	SS	16						>>X				
			4	SS	25						>>X				2 20 48 30
181.0 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.		5	SS	17						>>X				

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, X³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-17

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4694761.52N, 341335.00E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.20 - 2017.12.20 LATITUDE 42.39160887 LONGITUDE -82.05625151 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT				PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa							
						20	40	60	80	100	20	40	60		GR SA SI CL
185.9 0.0	Ground Surface FILL: SAND AND GRAVEL														
185.1 0.8	FILL: CLAYEY SILT trace organics and topsoil inclusion, little sand, brown to greyish black, moist, firm		1	SS	6				X		o				
			2	SS	7				X		o				0 19 (81)
183.6 2.3	SILTYCLAY/CLAYEY SILT trace gravel, little sand, brown to grey, moist, stiff to very stiff		3	SS	8				>>X		o				
			4	SS	18				>>X		o	o			2 13 50 35
181.6 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.		5	SS	14				>>X		o				

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity o 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-16

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4695060.58N, 342159.23E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.20 - 2017.12.20 LATITUDE 42.3942621 LONGITUDE -82.0462214 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20
187.2 0.0	Ground Surface FILL: SAND AND GRAVEL																	
186.4 0.8	FILL: CLAYEY SILT some organics, trace sand, greyish black, moist, firm		1	SS	7				X									
185.6 1.5	SILTY CLAY/CLAYEY SILT trace organics, trace gravel, few sand seams, brown to grey, moist, firm to very stiff		2	SS	7				X									
			3	SS	7						>>X							
			4	SS	22						>>X							
			5	SS	16						>>X							
182.9 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.																	2 13 42 43

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-15

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4695462.59N, 343176.73E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.20 - 2017.12.20 LATITUDE 42.3978319 LONGITUDE -82.0338361 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20
188.4 0.0	Ground Surface FILL: SAND AND GRAVEL																	
187.6 0.8	FILL: SILTY SAND/SANDY SILT trace gravel, brown, moist, compact		1	SS	13							○						
186.7 1.7	FILL: CLAYEY SILT trace gravel, trace sand, moist, firm		2	SS	7					×		○						
186.1 2.3	SILTY CLAY/CLAYEY SILT trace gravel, few sand, brown to grey, moist, very stiff		3	SS	17					>>×		○						
			4	SS	23					>>×		○	—					1 13 40 46
184.1 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.		5	SS	22					>>×		○						

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, × 3: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-14

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4696058.1N, 343832.67E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.20 - 2017.12.20 LATITUDE 42.4031605 LONGITUDE -82.0258282 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT				PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)			
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60						80	100	20
188.7 0.0	Ground Surface FILL: SAND AND GRAVEL																	
187.9 0.8	FILL: SILTY CLAY trace organics, trace gravel, trace to few sand, brown to grey, moist, stiff		1	SS	8													
			2	SS	8					X								
186.4 2.3	SILTY CLAY/CLAYEY SILT trace gravel, trace sand, brown to grey, moist, firm to very stiff		3	SS	8						X							0 9 39 52
			4	SS	15							X						
			5	SS	23													
184.4 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.																	

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-13

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4696744.72N, 344561.13E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.20 - 2017.12.20 LATITUDE 42.4093053 LONGITUDE -82.0169317 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa								
						20	40	60	80	100	20	40	60		GR SA SI CL	
188.4 0.0	Ground Surface FILL: SAND AND GRAVEL															
187.6 0.8	FILL: SILTY CLAY trace to some organics, trace gravel, trace to few sand, brown to grey, moist, firm to stiff		1	SS	5				X							
			2	SS	12					X						
186.0 2.4	SILTY CLAY/CLAYEY SILT trace gravel, little wet sand seams, brown, moist, stiff to very stiff		3	SS	11				X						0	6 40 54
			4	SS	19						>>X					
184.1 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.		5	SS	17										1	15 52 32

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, X³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-12

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4697510.26N, 345368.04E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.18 - 2017.12.18 LATITUDE 42.41615574 LONGITUDE -82.00707483 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20
189.3 0.0	Ground Surface FILL: SAND AND GRAVEL recycled asphalt over sand and gravel																	
188.5 0.8	FILL: CLAYEY SILT trace gravel, trace sand, brown, very moist, firm		1	SS	5				X									
187.8 1.5	SILTY CLAY/CLAYEY SILT trace gravel, few sand, brown, moist, very stiff		2	SS	15					>>X								1 7 29 63
			3	SS	23					>>X								
			4	SS	23					>>X								
185.0 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.		5	SS	25					>>X								

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-11

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4698101.89N, 345967.93E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.18 - 2017.12.18 LATITUDE 42.4214505 LONGITUDE -81.9997437 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%) GR SA SI CL	
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa									
						20	40	60	80	100							
189.9	Ground Surface																
0.0	FILL: SAND AND GRAVEL recycled asphalt over sand and gravel																
189.1	FILL: CLAYEY SILT with sand and gravel, trace organics, brown/grey, moist, stiff -becoming trace gravel, some sand		1	SS	14												
0.8			2	SS	10												
187.6	SILTY CLAY/CLAYEY SILT trace gravel, brown to grey, moist, firm to stiff		3	SS	5				X								
2.3			4	SS	14												
187			5	SS	9						X						
186																	
185.6	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.																
4.3																	

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-10

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4698794.16N, 346681.48E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.18 - 2017.12.18 LATITUDE 42.42764485 LONGITUDE -81.99102279 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20
188.7 0.0	Ground Surface FILL: SAND AND GRAVEL recycled asphalt over sand and gravel																	
187.8 0.9	FILL: CLAYEY SILT some organics, some sand, brown to grey, moist, firm to stiff		1	SS	7													
186.4 2.3	SILTY CLAY/CLAYEY SILT trace sand, brown to grey, moist, firm to stiff		2	SS	12													
186.4 2.3	SILTY CLAY/CLAYEY SILT trace sand, brown to grey, moist, firm to stiff		3	SS	7													
			4	SS	8													
185.0 3.4			5	SS	5													
184.3 4.4	End of Borehole at 4.4 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.																	

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-09

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4699534.92N, 347432.60E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.18 - 2017.12.18 LATITUDE 42.43427294 LONGITUDE -81.98184005 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20
188.1 0.0	Ground Surface FILL: SAND AND GRAVEL recycled asphalt over sand and gravel																	
187.3 0.8	FILL: CLAYEY SILT trace sand, brown, moist, stiff		1	SS	9						>>X	o						
186.6 1.5	SILTY CLAY/CLAYEY SILT trace gravel, little sand, brown to grey, moist, stiff		2	SS	11						>>X	o						
			3	SS	15						>>X	o						
			4	SS	12						>>X	o						
			5	SS	10						>>X	o						
183.8 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.																2 24 39 35	

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity o 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-08

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4700163.44N, 348093.27E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.18 - 2017.12.18 LATITUDE 42.43989486 LONGITUDE -81.97376328 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT				PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa								WATER CONTENT (%)	
						20	40	60	80	100	20	40	60		GR SA SI CL		
188.4 0.0	Ground Surface FILL: SAND AND GRAVEL recycled asphalt over sand and gravel																
187.6 0.8	FILL: CLAYEY SILT trace organics, trace gravel, trace sand, brown, moist, stiff		1	SS	11						>>X						
186.1 2.3			2	SS	11							>>X					
186.1 2.3	SILTY CLAY/CLAYEY SILT trace gravel, some thin sand/silt layers, brown to grey, moist, firm to stiff		3	SS	6				X								
185.0 4.4			4	SS	11							>>X					
184.0 4.4			5	SS	9					X							
184.0 4.4	End of Borehole at 4.4 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27m below ground surface. 3. Borehole was dry in open hole.				VANE												

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-07

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4700897.84N, 348858.20E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.18 - 2017.12.18 LATITUDE 42.44646356 LONGITUDE -81.96440945 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)			
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20	40
188.7 0.0	Ground Surface FILL: SAND AND GRAVEL recycled asphalt over sand and gravel																		
187.9 0.8	FILL: CLAYEY SILT with sand and gravel, brown, moist, stiff		1	SS	11														
187.2 1.5	SILTY CLAY/CLAYEY SILT trace sand, brown to grey, moist, stiff to very stiff		2	SS	12						>>X					0	5	38	57
			3	SS	17						>>X								
			4	SS	18						>>X								
			5	SS	15						>>X								
184.4 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.																		

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, X³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-06

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4701567.34N, 349567.06E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.18 - 2017.12.18 LATITUDE 42.45245031 LONGITUDE -81.95574044 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20
188.7 0.0	Ground Surface FILL: SAND AND GRAVEL trace recycled asphalt																	
187.9 0.8	FILL: CLAYEY SILT organics with depth, trace gravel, little to some sand, brown/grey, moist, stiff		1	SS	9						>>X	o						2 28 (70)
			2	SS	8						X	o						
186.4 2.3	SILTY CLAY/CLAYEY SILT trace gravel, trace sand, brown to grey, moist, stiff		3	SS	9						>>X	o						
			4	SS	14						>>X	o						
184.4 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.		5	SS	11						X	o						

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity o 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-05

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4702144.09N, 350185.42E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.18 - 2017.12.18 LATITUDE 42.45760683 LONGITUDE -81.94817741 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa									WATER CONTENT (%)	
						20	40	60	80	100	20	40	60		GR	SA	SI	CL
190.2 0.0	Ground Surface FILL: SAND AND GRAVEL thin recycled asphalt over sand and gravel, grey, moist, compact																	
	-becoming sandy gravel, few silt and clay		1	SS	11							o				64	28	(8)
188.7 1.5	FILL: SAND trace gravel, trace silt, brown, wet, compact		2	SS	11							o						
187.9 2.3	SILTY CLAY/CLAYEY SILT trace gravel, trace sand, grey, moist, soft to stiff		3	SS	3			X				o						
			4	SS	8				X							1	3	35
185.9 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 4.27 m below ground surface. 3. Borehole was dry in open hole.	5	SS	4			X				o							

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity o 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-04

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4702855.36N, 350925.36E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.11 - 2017.12.11 LATITUDE 42.463966 LONGITUDE -81.939124 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)				
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20	40	60
191.5	Ground Surface																			
0.0	FILL: SAND AND GRAVEL trace recycled asphalt																			
190.7						191														
0.8	FILL: SILTY SAND trace organics, trace gravel, brown to black, moist, compact		1	SS	12							o								
189.2						190						o								
2.3	FILL: SILTY CLAY trace gravel, brown, moist, stiff		3	SS	8							>>X								
188.2						189						o								
3.4	TOPSOIL some sand, some silt, trace clay, brown/black, moist, compact		4	SS	11							o								
187.7						188														
3.8	SILTY CLAY/CLAYEY SILT trace sand, grey, moist, stiff		5	SS	9				X			o					0	3	50	48
187.2																				
4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 3.05 m below ground surface. 3. Borehole was dry in open hole.																			

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity o 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-03

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4703594.69N, 351747.43E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.11 - 2017.12.11 LATITUDE 42.470573 LONGITUDE -81.929067 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20
191.4	Ground Surface																	
0.0	FILL: SAND AND GRAVEL trace recycled asphalt																	
190.6																		
0.8	FILL: SAND medium to coarse sand, few gravel, little silt, brown to grey, moist to very moist, compact		1	SS	18							○						
			2	SS	20							○						5 67 23 5
			3	SS	7	▽						○						
188.3																		
3.1	TOPSOIL some silt, some sand, black, moist, loose		4	SS	5							○						
187.6																		
3.8	SILTY CLAY trace gravel, brown, moist, stiff		5	SS	12					×		○						
187.1																		
4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 2.74 m below ground surface. 3. Groundwater level measured at 2.43 m depth below ground surface in an open hole.																	

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+³, ×³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-02

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4704205.76N, 352427.61E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.11 - 2017.12.11 LATITUDE 42.476033 LONGITUDE -81.920745 CHECKED BY SM

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20
194.5 0.0	Ground Surface FILL: SAND AND GRAVEL trace recycled asphalt																	
193.6 0.9	FILL: SILTY SAND fine sand, trace organics, trace gravel, brown/black, moist, compact to dense -becoming trace organics, fine to medium gravel, brown/black, moist, dense		1	SS	20							o						
			2	SS	33							o						
192.2 2.3	SILTY SAND trace organics, brown to grey, moist to wet, compact		3	SS	15							o						0 50 (50)
			4	SS	15							o						
			5	SS	23							o						
190.2 4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 3.05 m below ground surface. 3. Borehole was dry in open hole.																	

ONTARIO.MTO_ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18

+ 3, X 3: Numbers refer to Sensitivity o 3% STRAIN AT FAILURE

Brampton, Ontario

RECORD OF BOREHOLE No 17-01

1 OF 1

METRIC

W.P. WP 3102-15-00 LOCATION Along Hwy 401 Centre Line, Essex Rd 42 to Victoria Rd, ON, 4704875.85N, 353168.97E ORIGINATED BY NU
 DIST Chatham-Kent HWY 401 BOREHOLE TYPE Geoprobe Truck Mount, HSA, Cased COMPILED BY NT
 DATUM Geodetic DATE 2017.12.11 - 2017.12.11 LATITUDE 42.48201971 LONGITUDE -81.91167317 CHECKED BY SM


SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20
193.5	Ground Surface																	
0.0	FILL: SAND AND GRAVEL some stone																	
192.7						193												
0.8	FILL: SILTY SAND trace topsoil, little gravel, brown, moist, compact		1	SS	19							o						16 32 (52)
192.0						192												
1.5	FILL: SILTY CLAY brown/grey, mottled, moist to wet, firm to stiff		2	SS	13							>>x						
191.0						191		x										
3.1	SILTY CLAY/CLAYEY SILT few sand, brown, moist, very stiff		4	SS	20							>>x						0 6 32 62
190.4						190												
189.2			5	SS	18							>>x						
4.3	End of Borehole at 4.27 m below ground surface. Notes: 1. This log is to be read with the subject report and project numbers as presented above. 2. Borehole open up to 2.13 m below ground surface. 3. Borehole was dry in open hole.																	

ONTARIO.MTO.ADM-00235197-L0 - ASSIGN8.GPJ ONTARIO.MTO.GDT 1/12/18


+ 3, x 3: Numbers refer to Sensitivity o 3% STRAIN AT FAILURE

**Appendix D –
Laboratory Data**

UNIFIED SOIL CLASSIFICATION SYSTEM

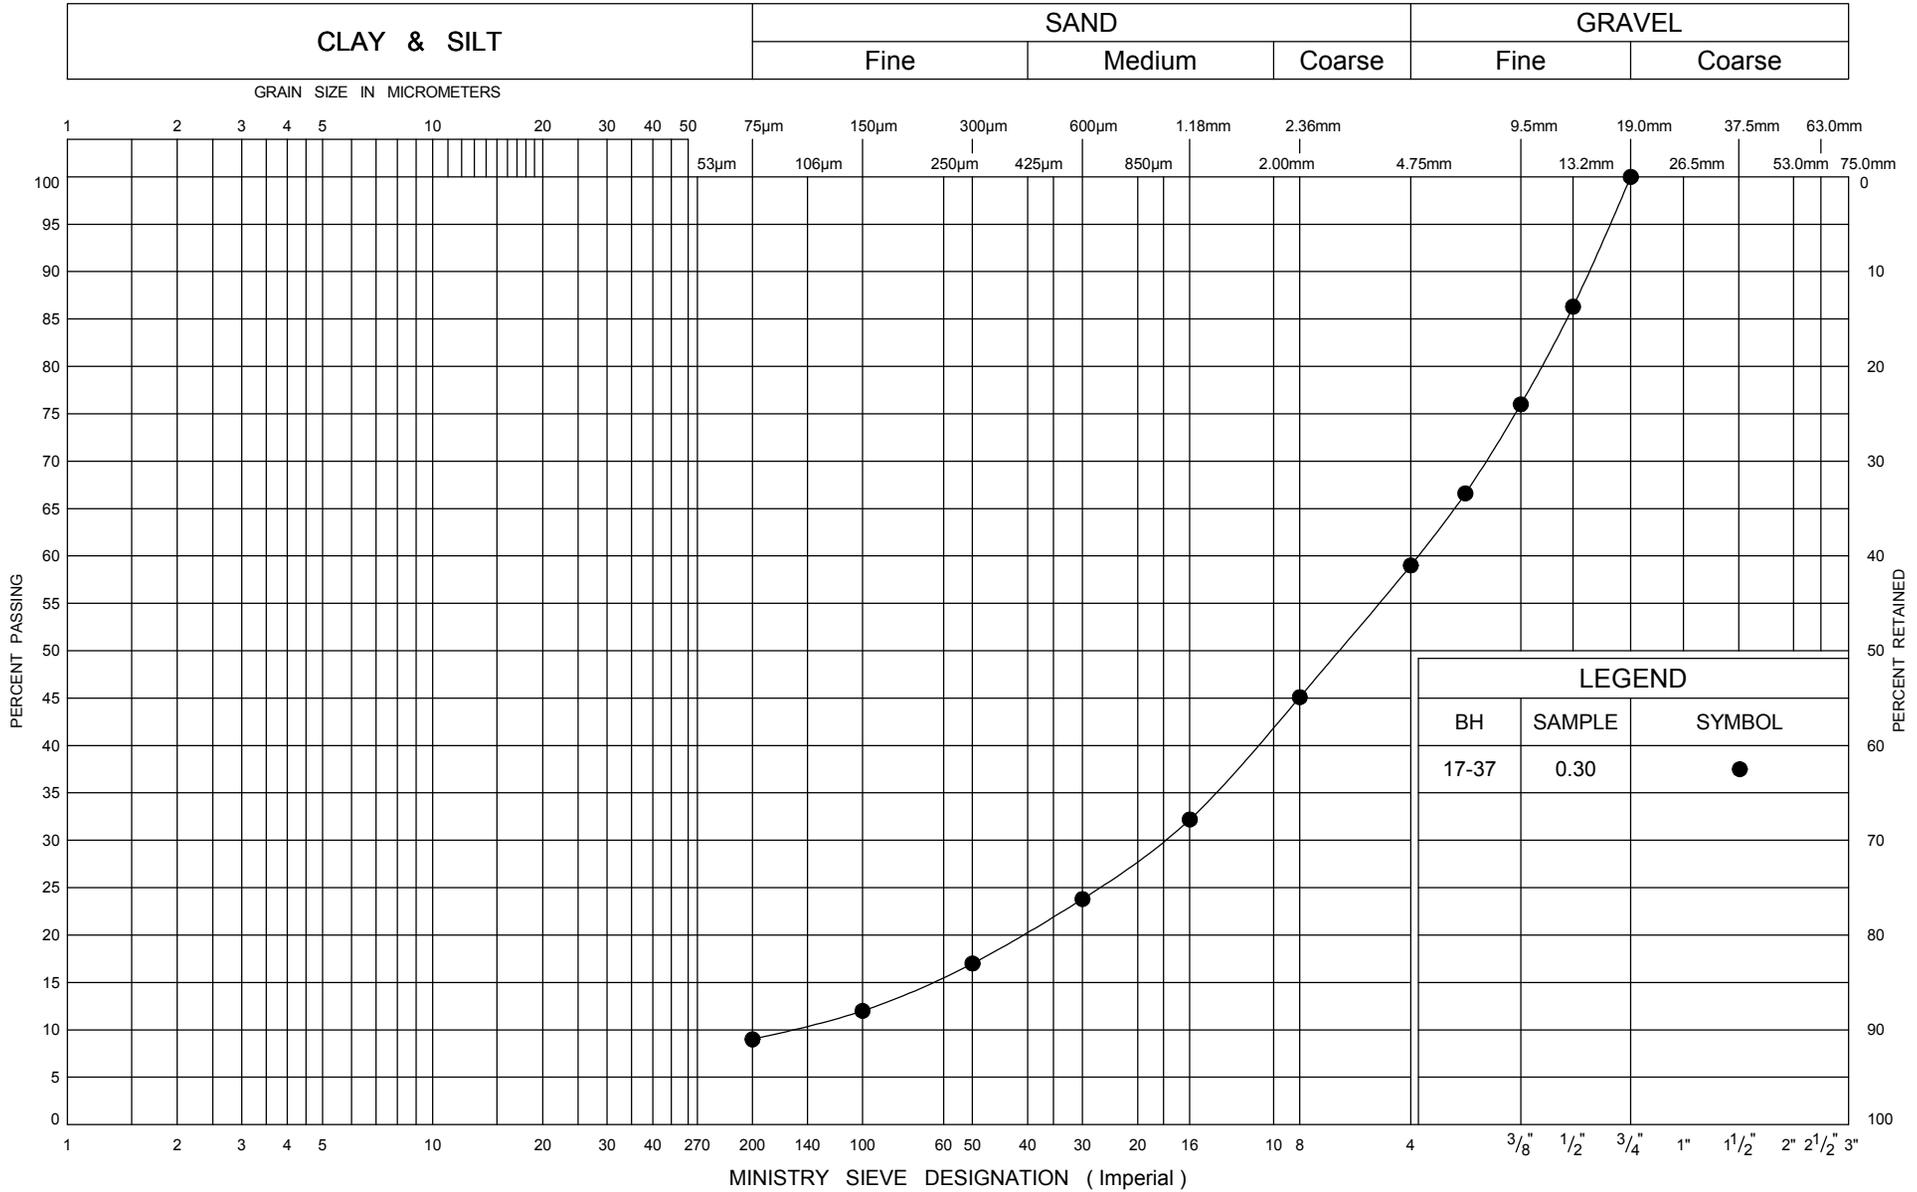

UNIFIED SOIL CLASSIFICATION SYSTEM

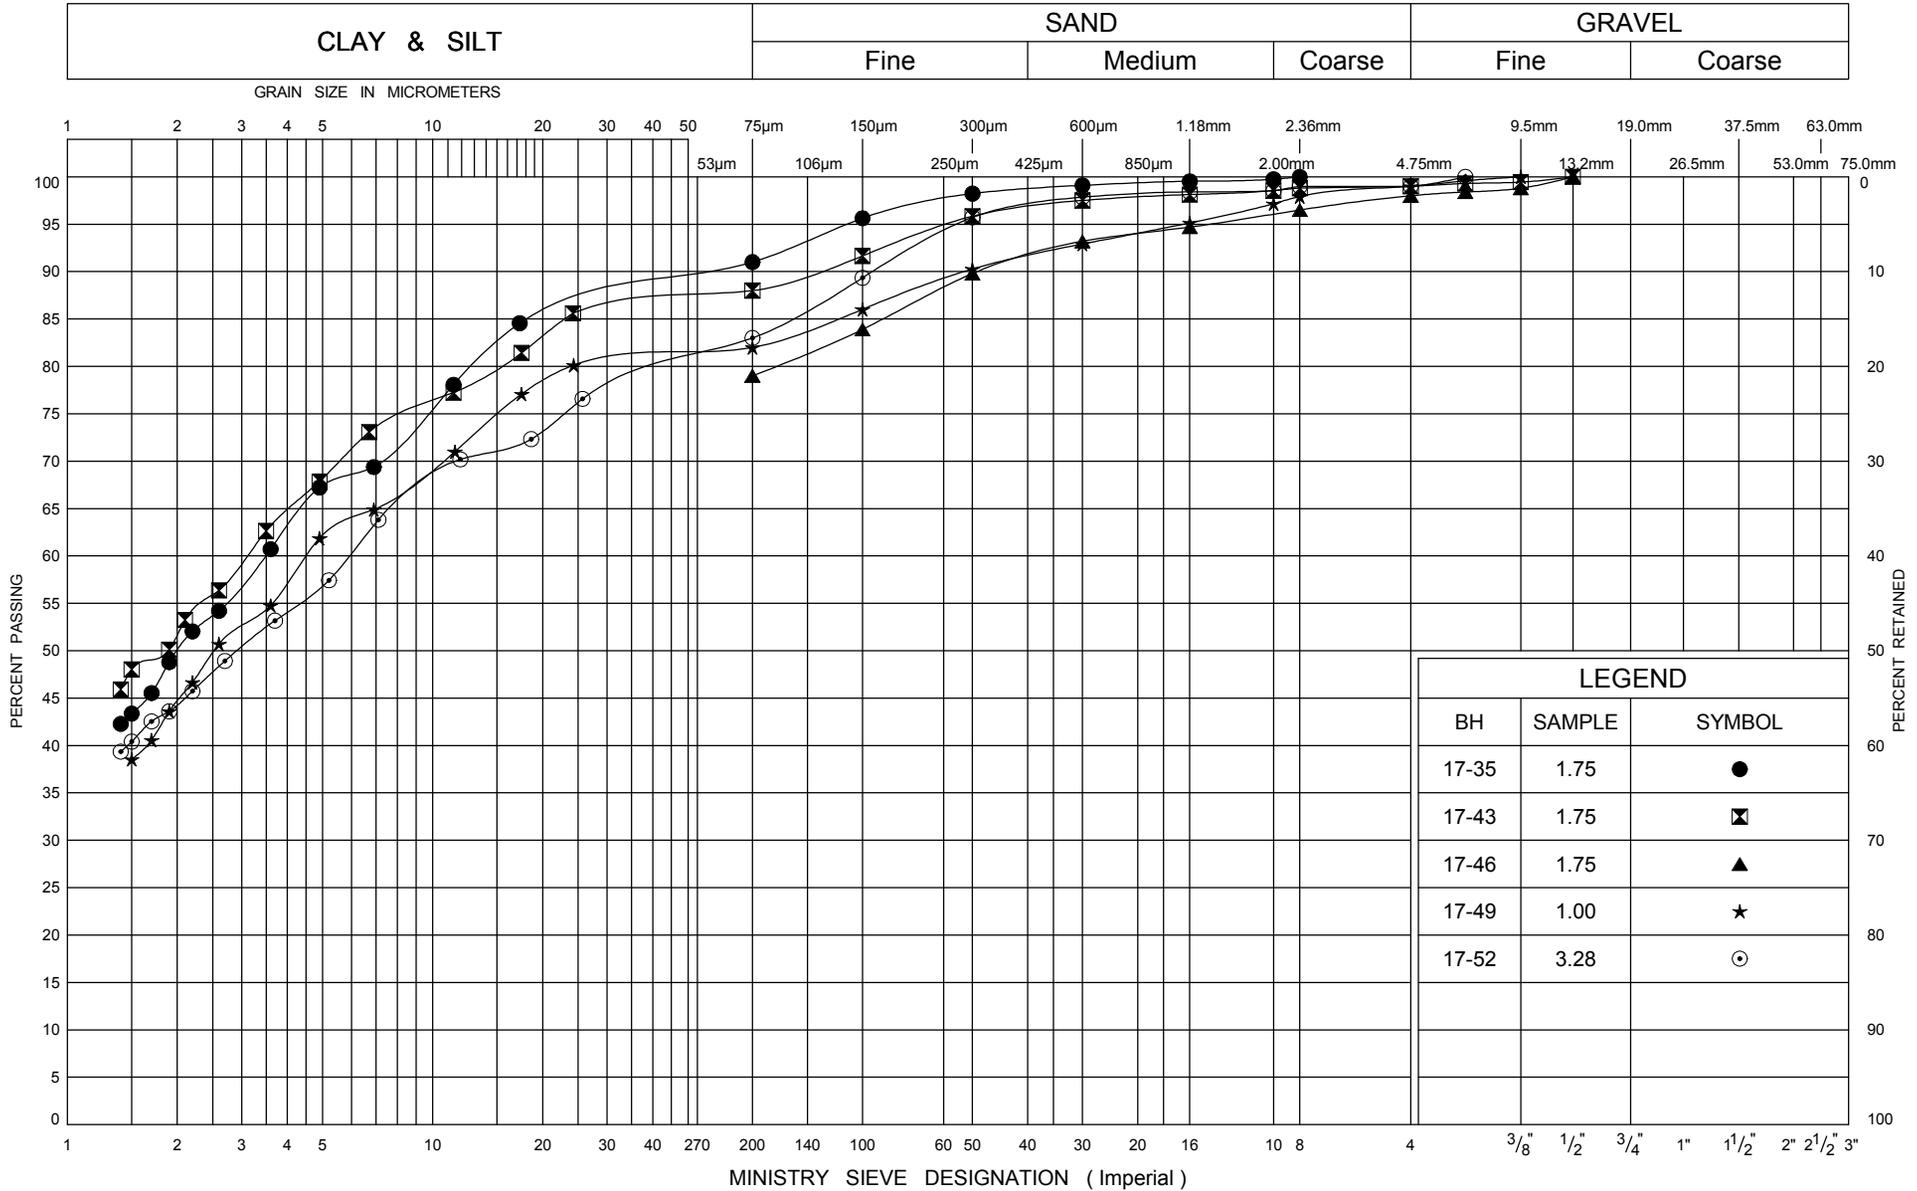


GRAIN SIZE DISTRIBUTION

Fill: Silty Clay

FIG No 2

W PWP 3102-15-00

3015-E-0017, Assignment 8

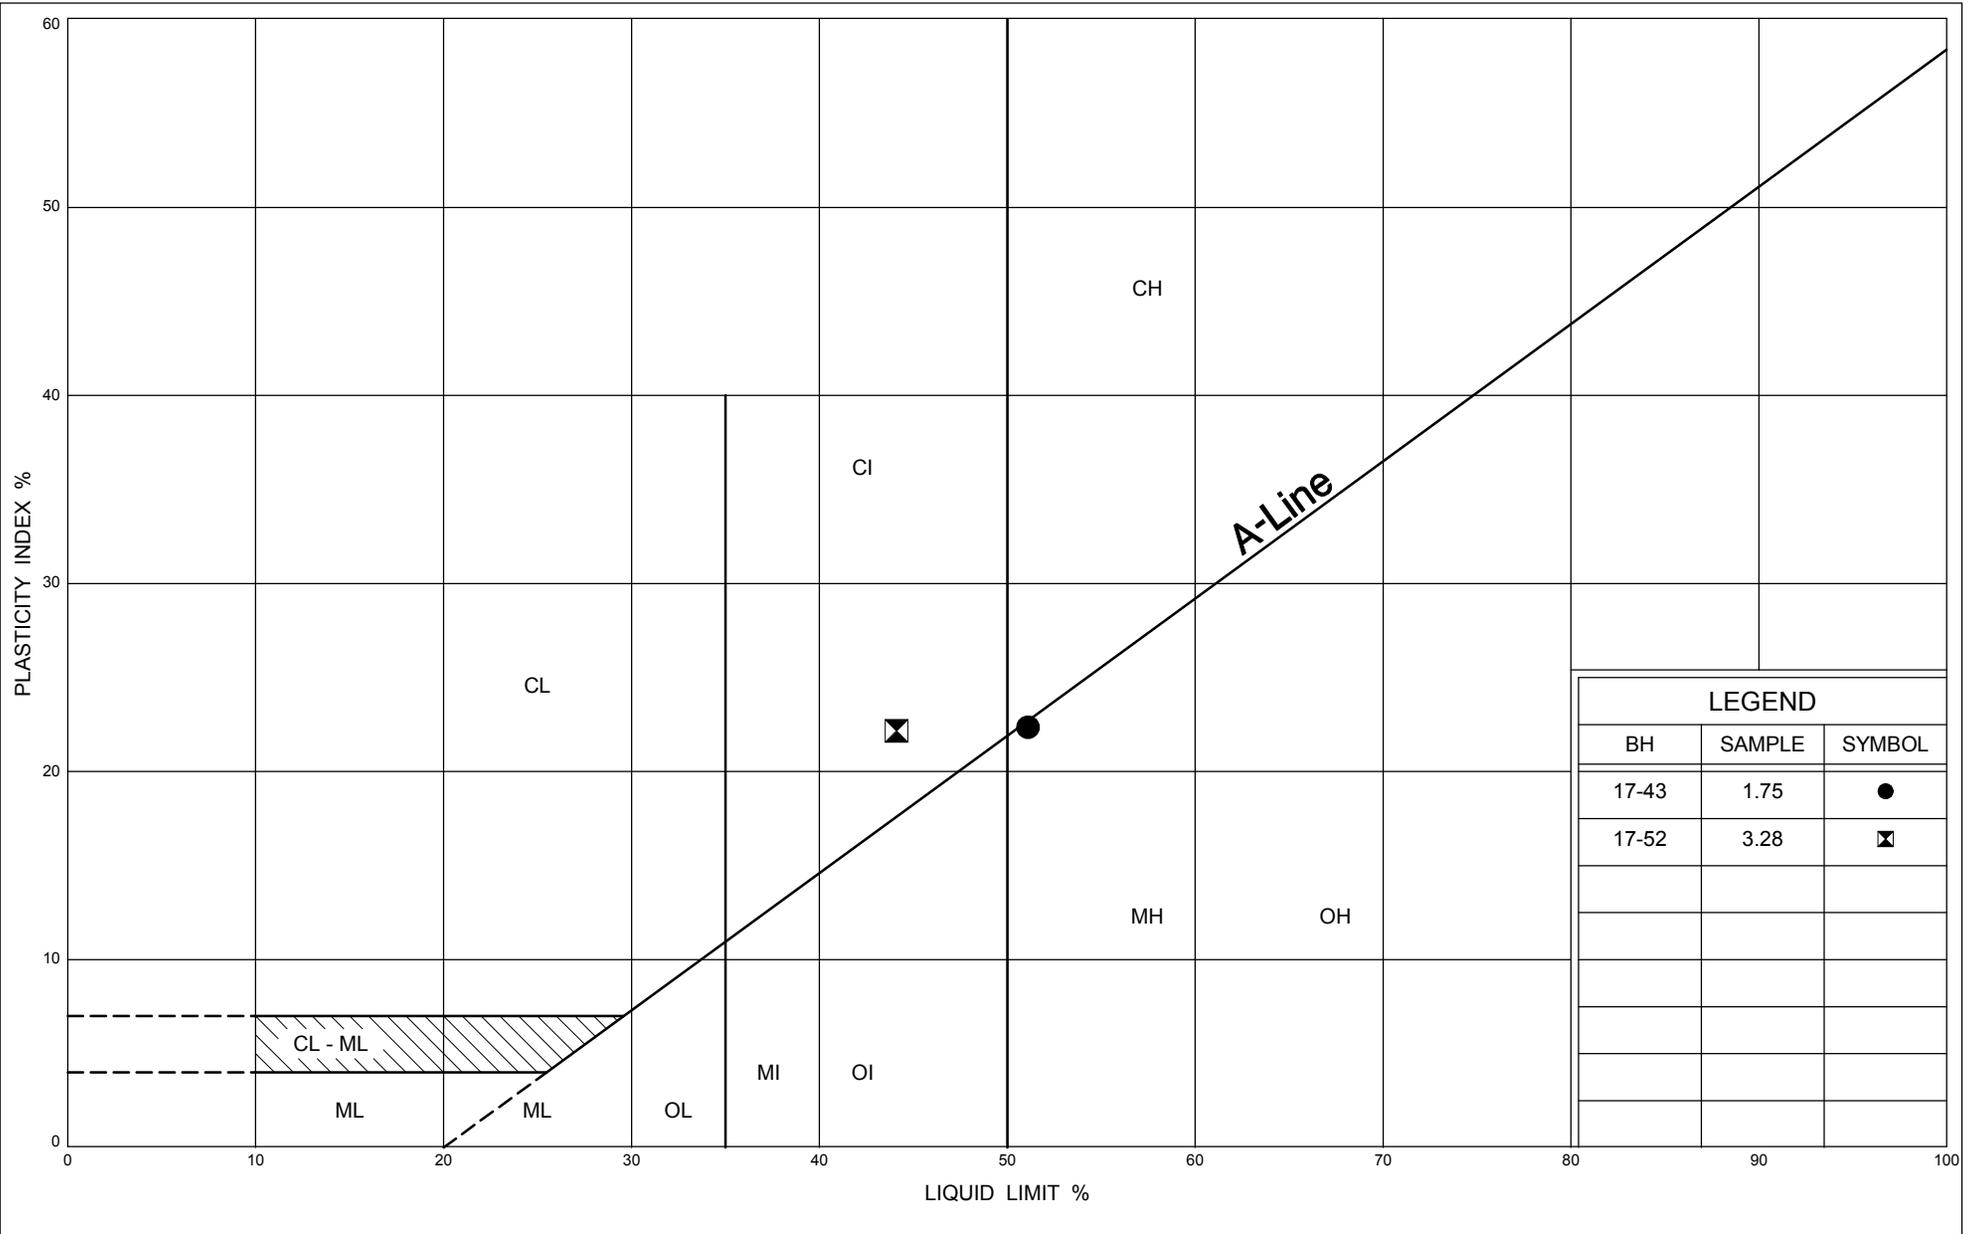


LEGEND		
BH	SAMPLE	SYMBOL
17-43	1.75	●
17-52	3.28	⊠



PLASTICITY CHART
Fill: Silty Clay

FIG No 3
W PWP 3102-15-00
3015-E-0017, Assignment 8

UNIFIED SOIL CLASSIFICATION SYSTEM

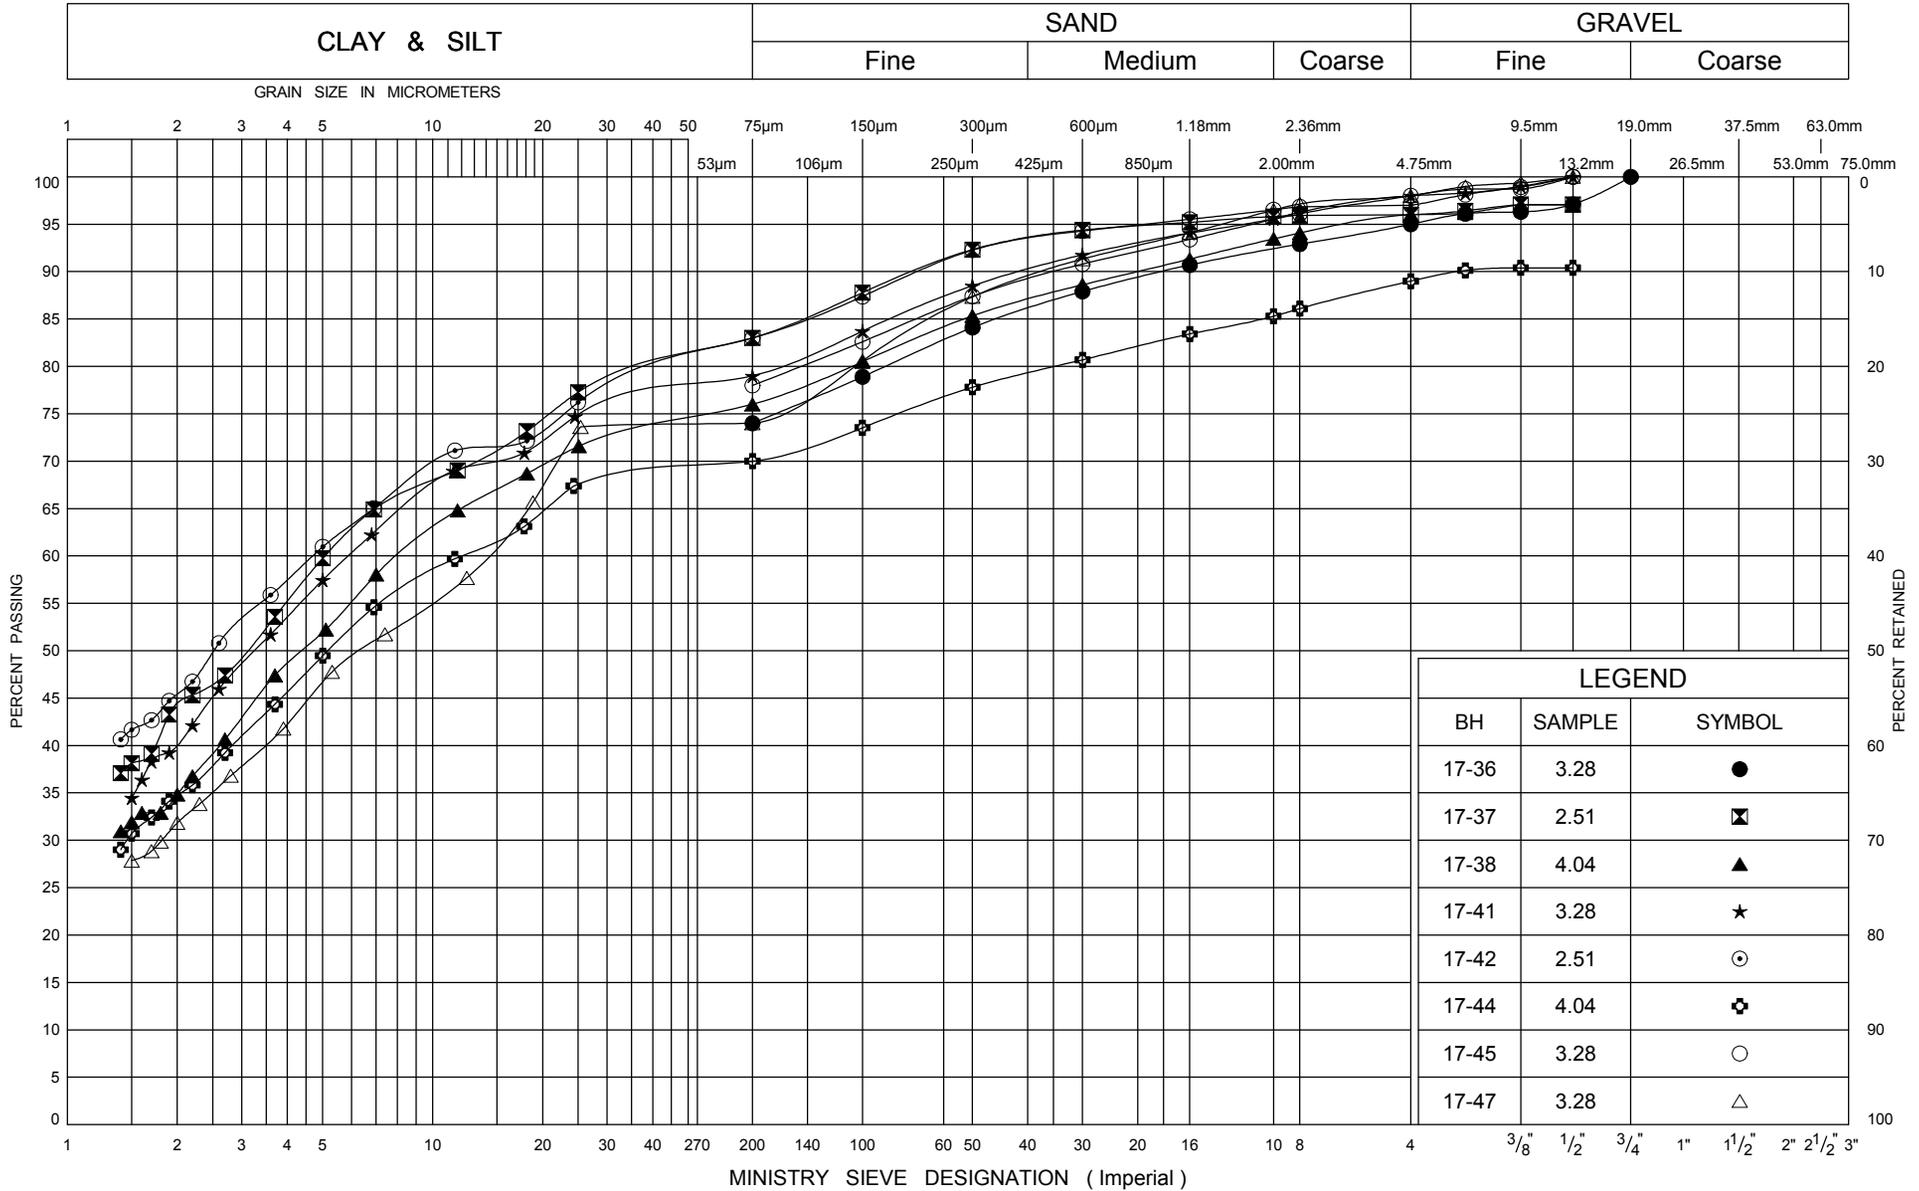

GRAIN SIZE DISTRIBUTION


Silty Clay/Clayey Silt

FIG No 4

W PWP 3102-15-00


3015-E-0017, Assignment 8

UNIFIED SOIL CLASSIFICATION SYSTEM

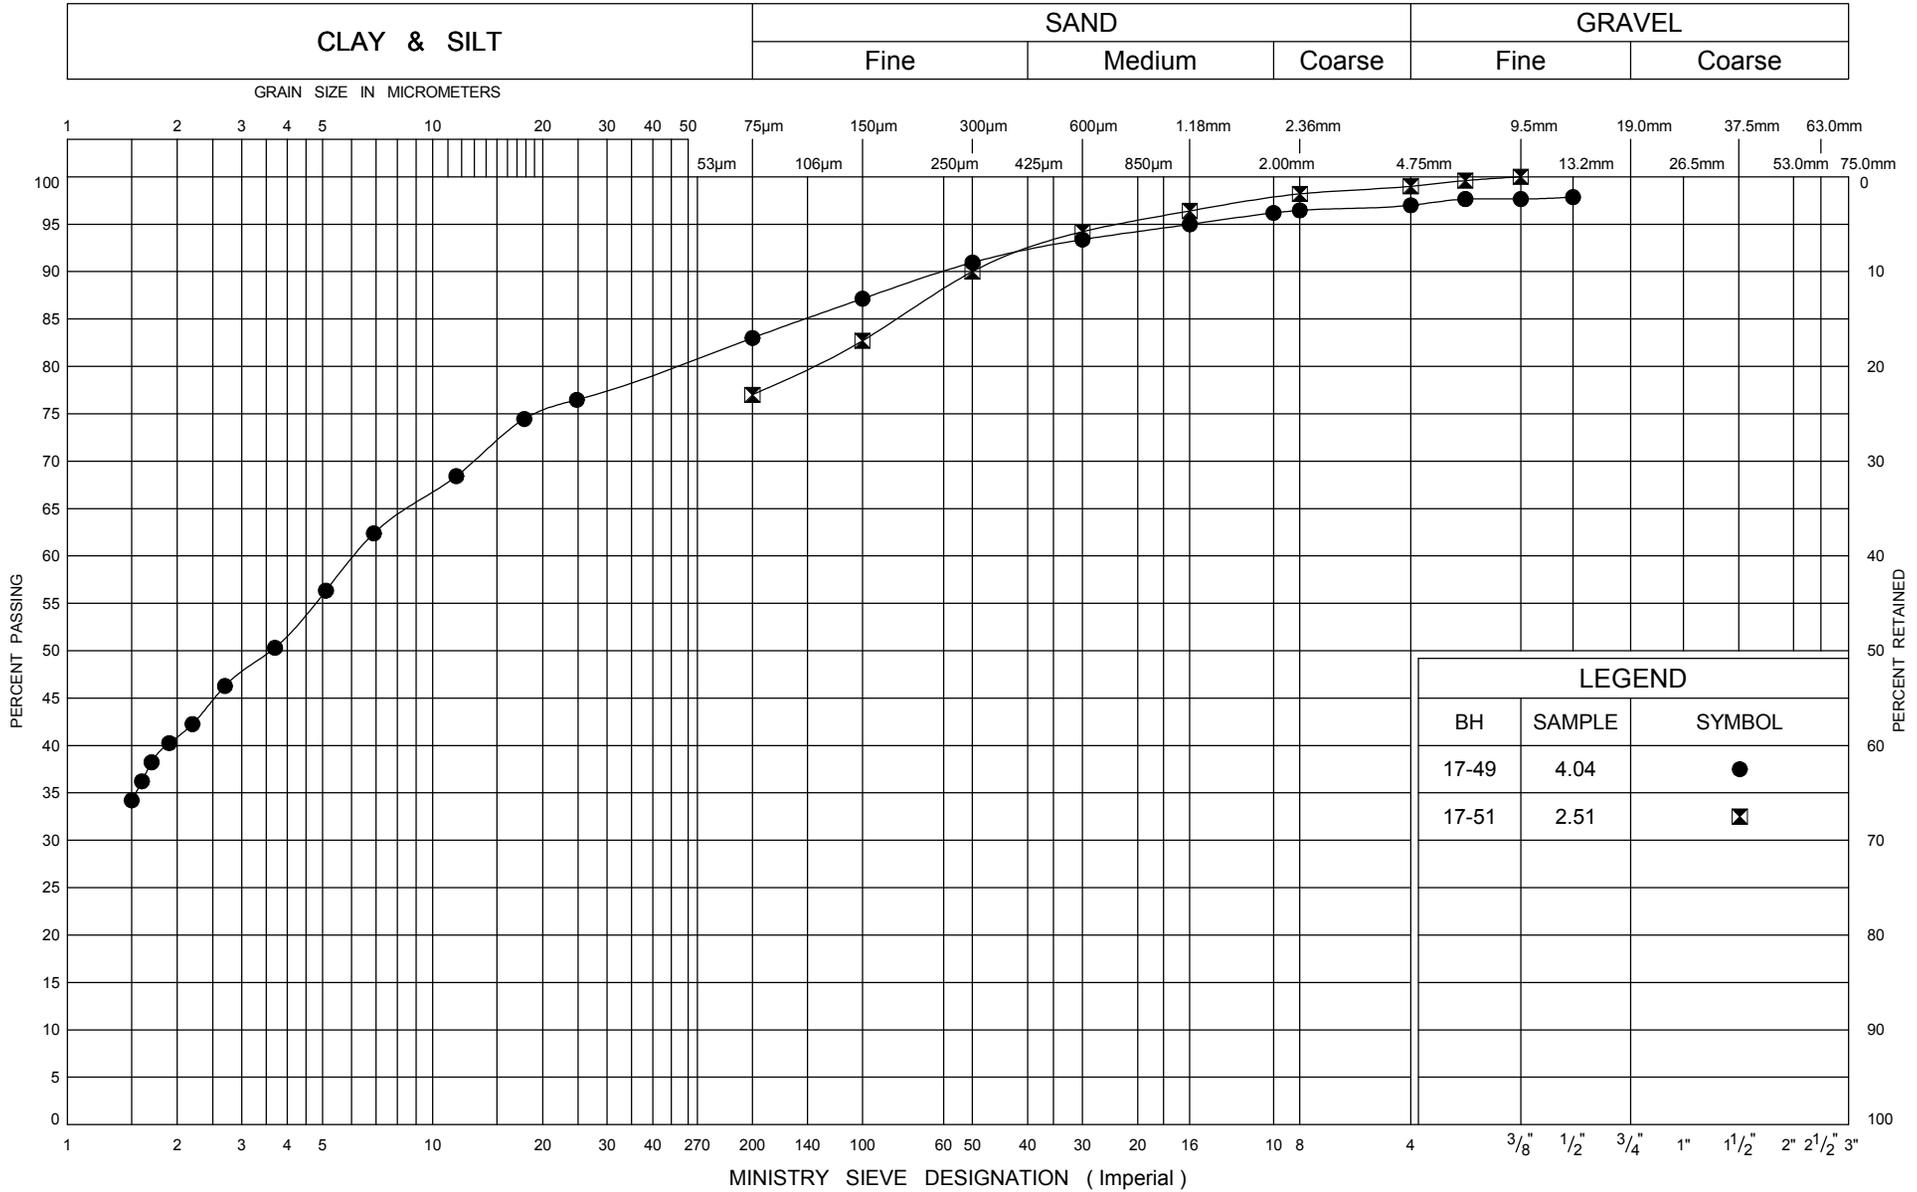

GRAIN SIZE DISTRIBUTION
Silty Clay/Clayey Silt

FIG No 5
W PWP 3102-15-00
3015-E-0017, Assignment 8

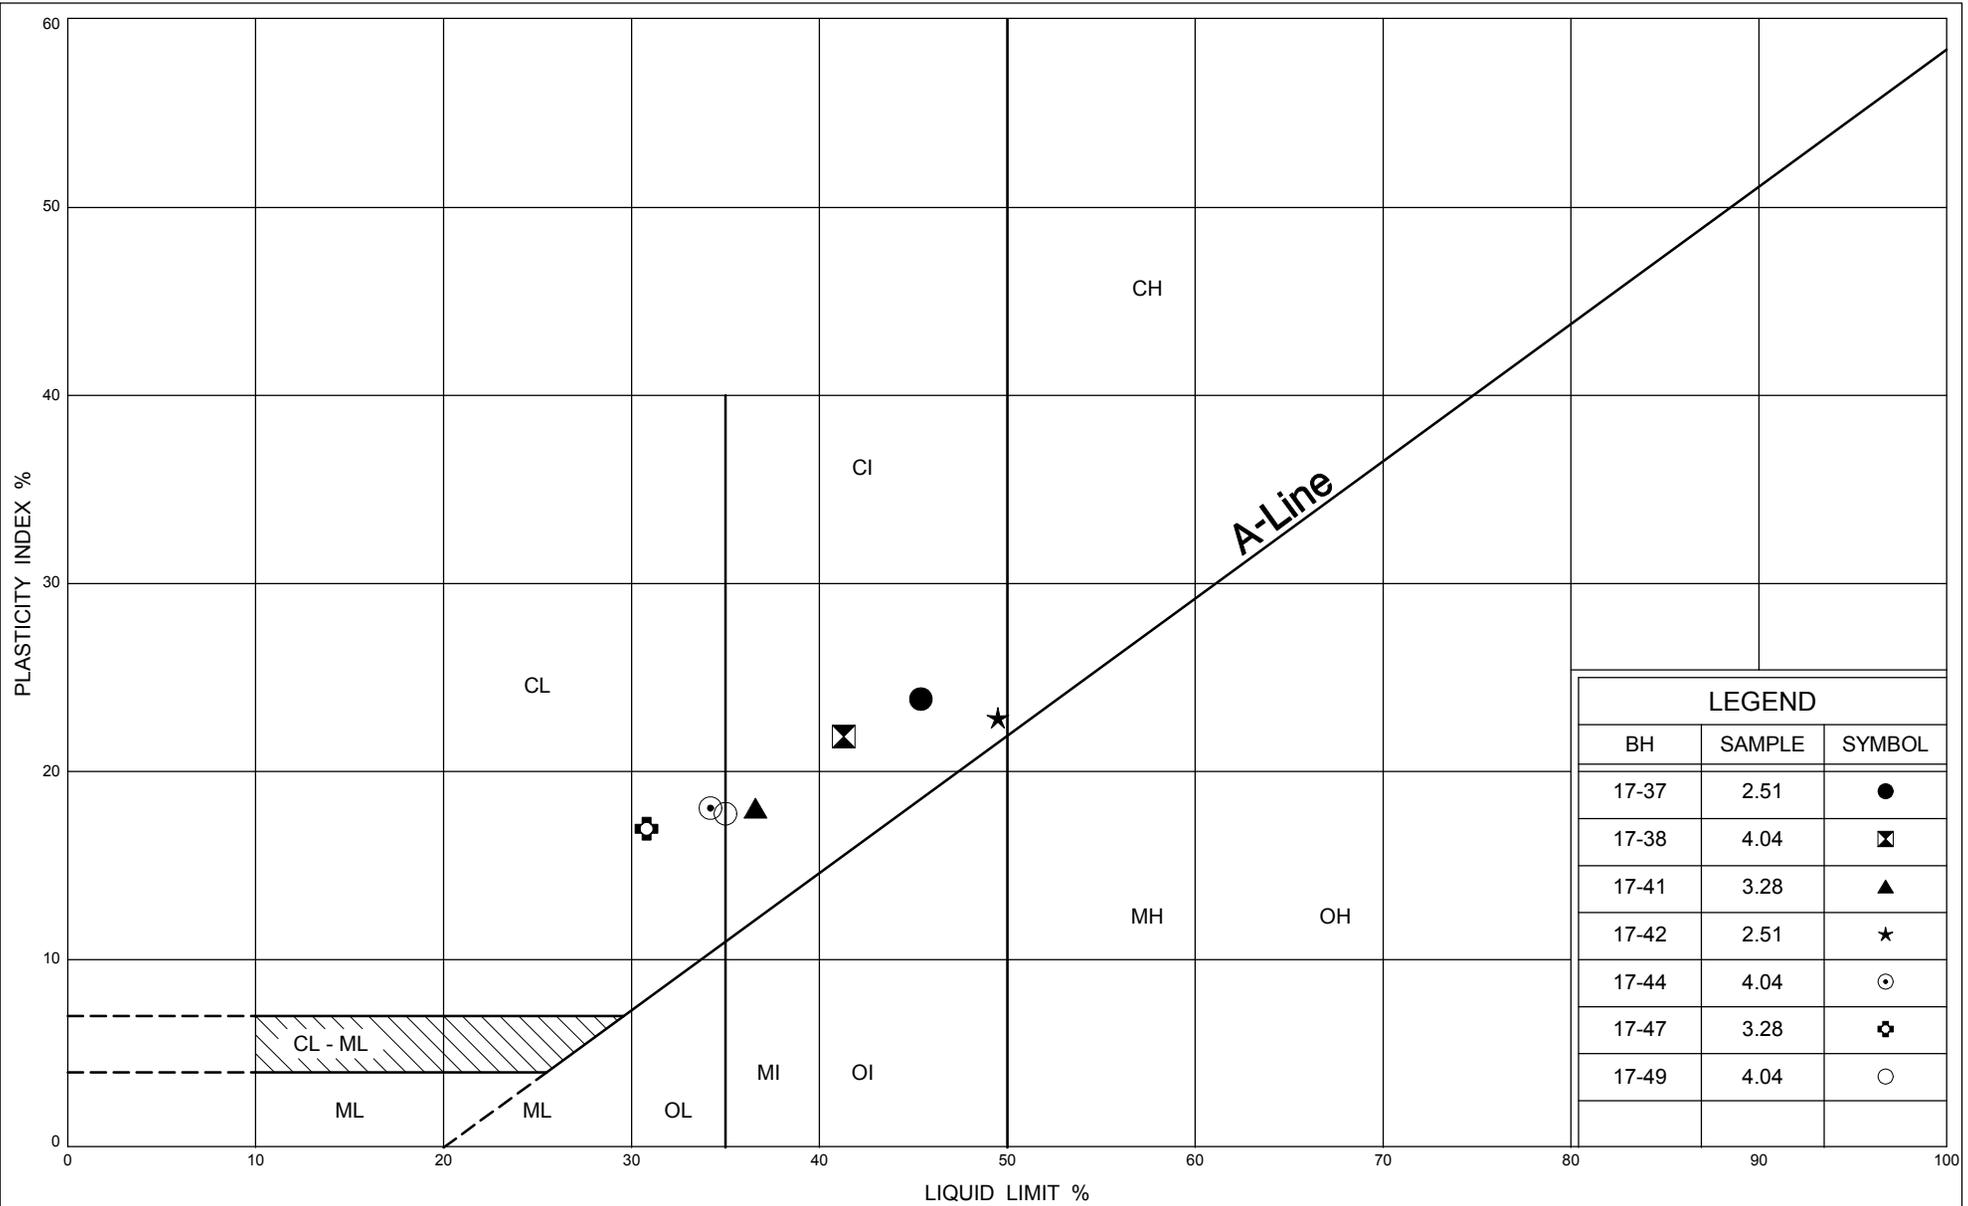


PLASTICITY CHART
Silty Clay/Clayey Silt

FIG No 6

W PWP 3102-15-00

3015-E-0017, Assignment 8


UNIFIED SOIL CLASSIFICATION SYSTEM

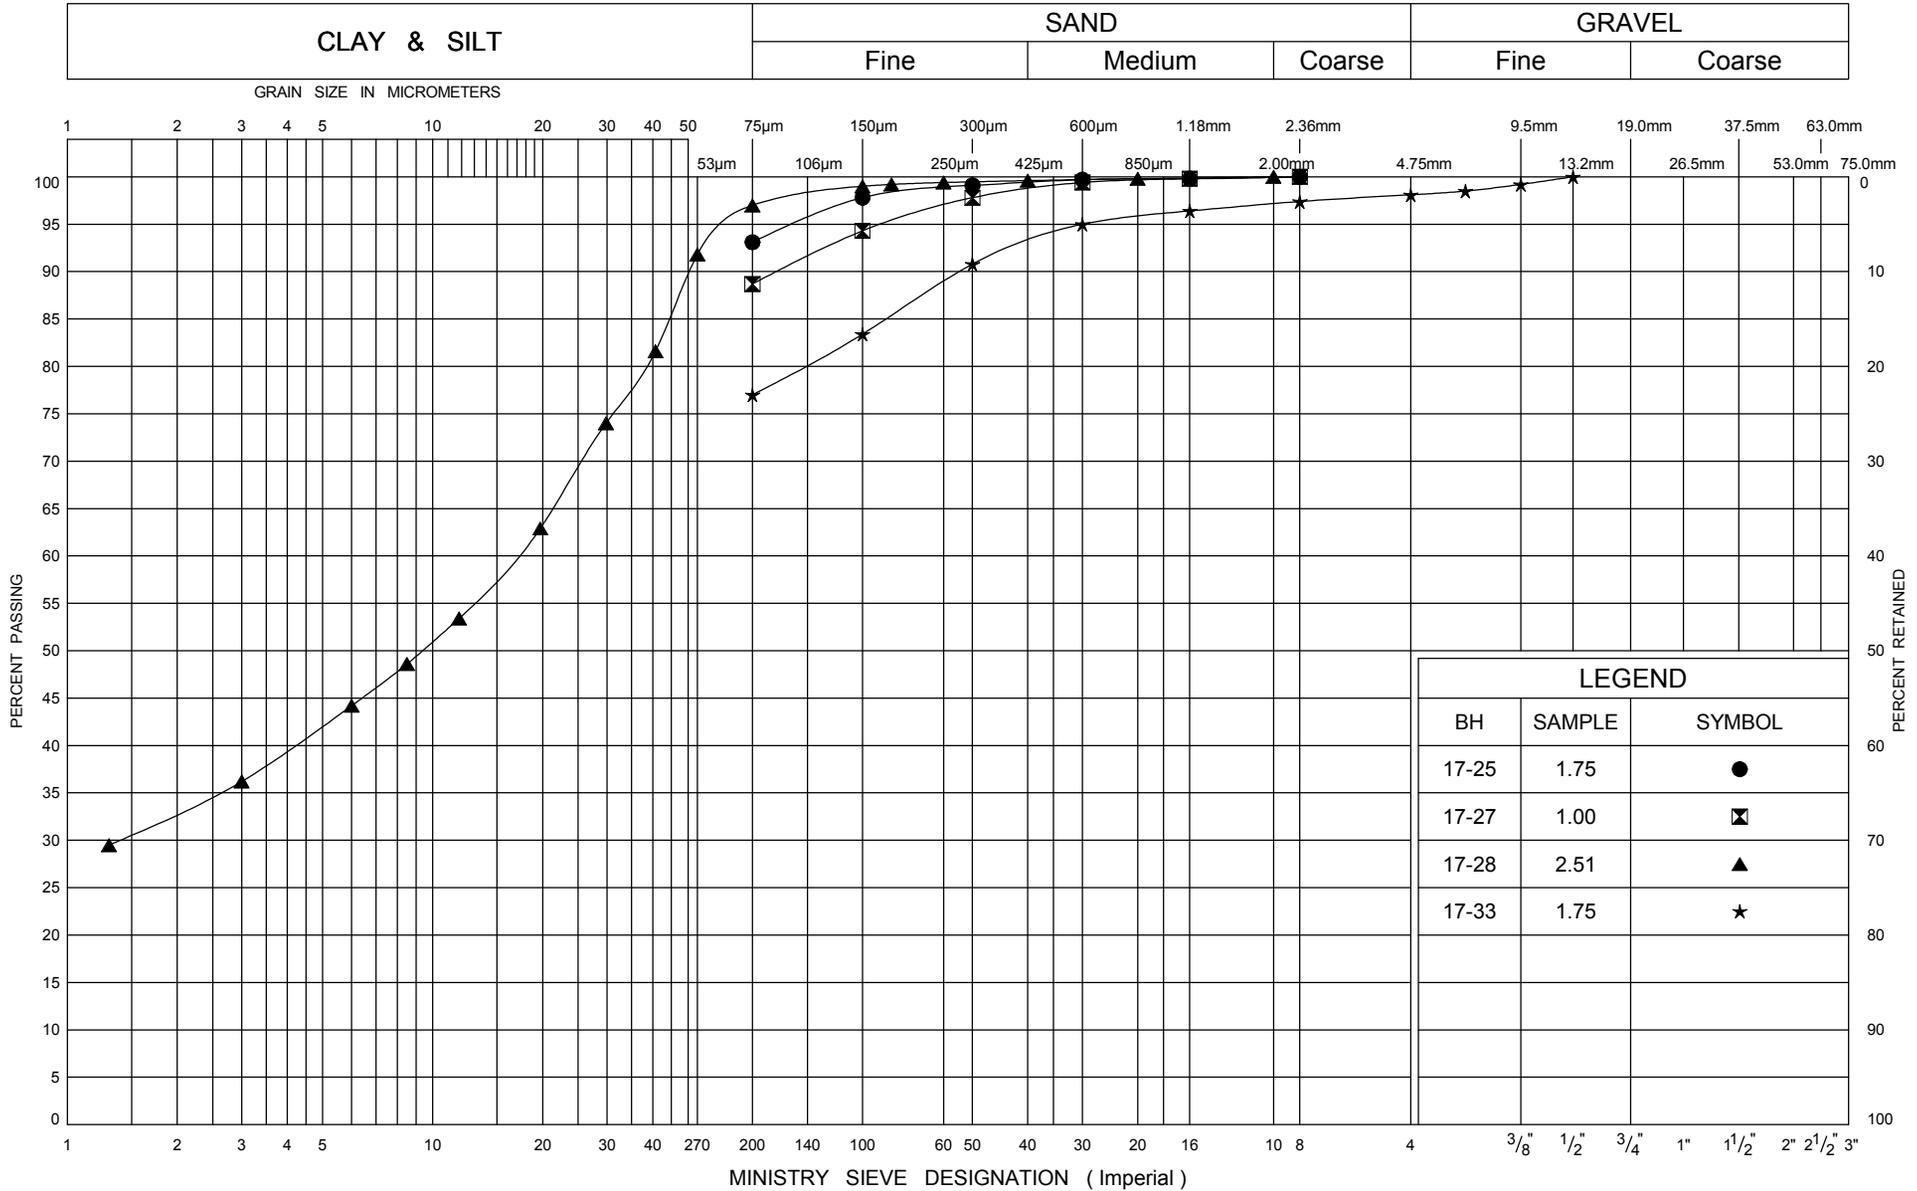

GRAIN SIZE DISTRIBUTION
Fill: Silty Clay/Clayey Silt

FIG No 7
 W PWP 3102-15-00
 3015-E-0017, Assignment 8

UNIFIED SOIL CLASSIFICATION SYSTEM

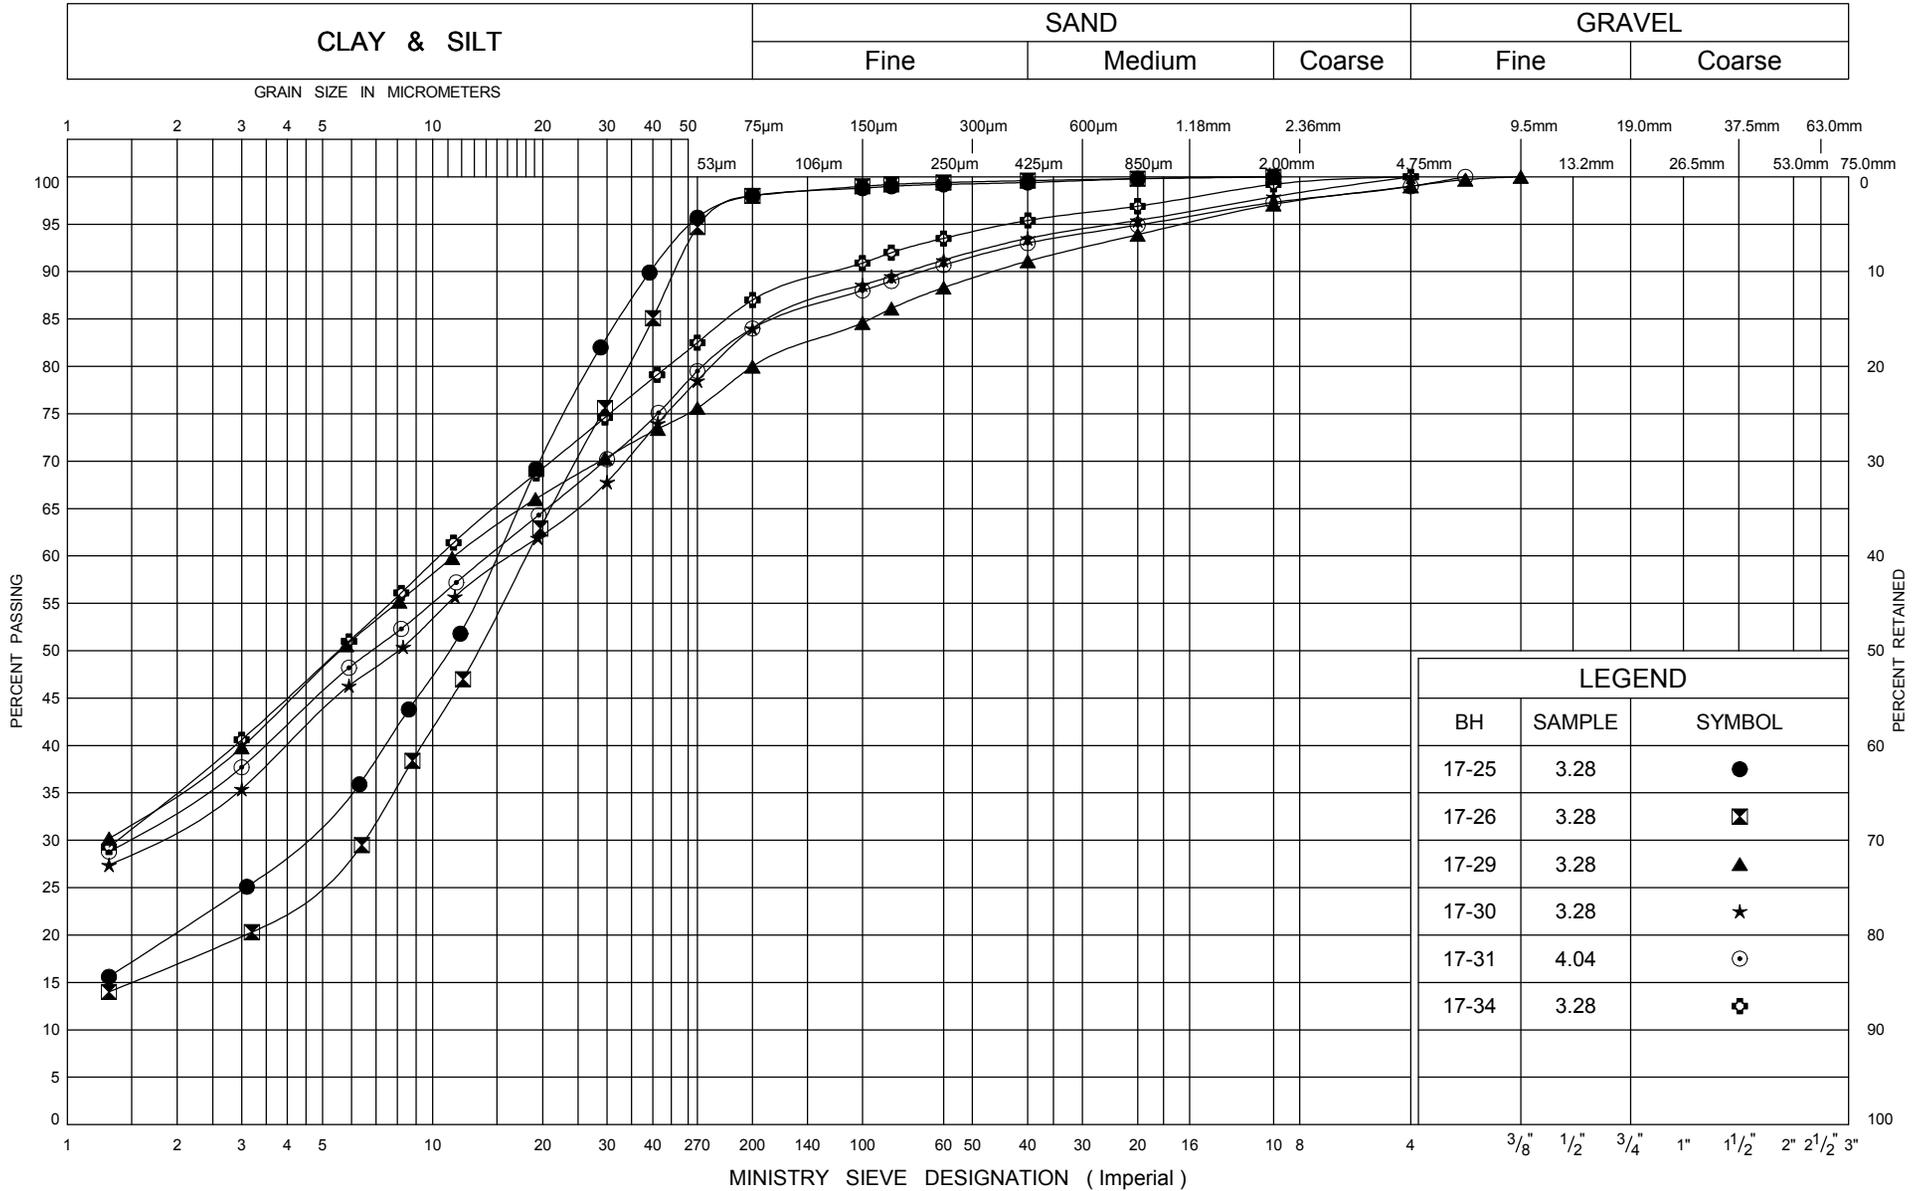


GRAIN SIZE DISTRIBUTION Silty Clay/Clayey Silt

FIG No 8

W PWP 3102-15-00

3015-E-0017, Assignment 8

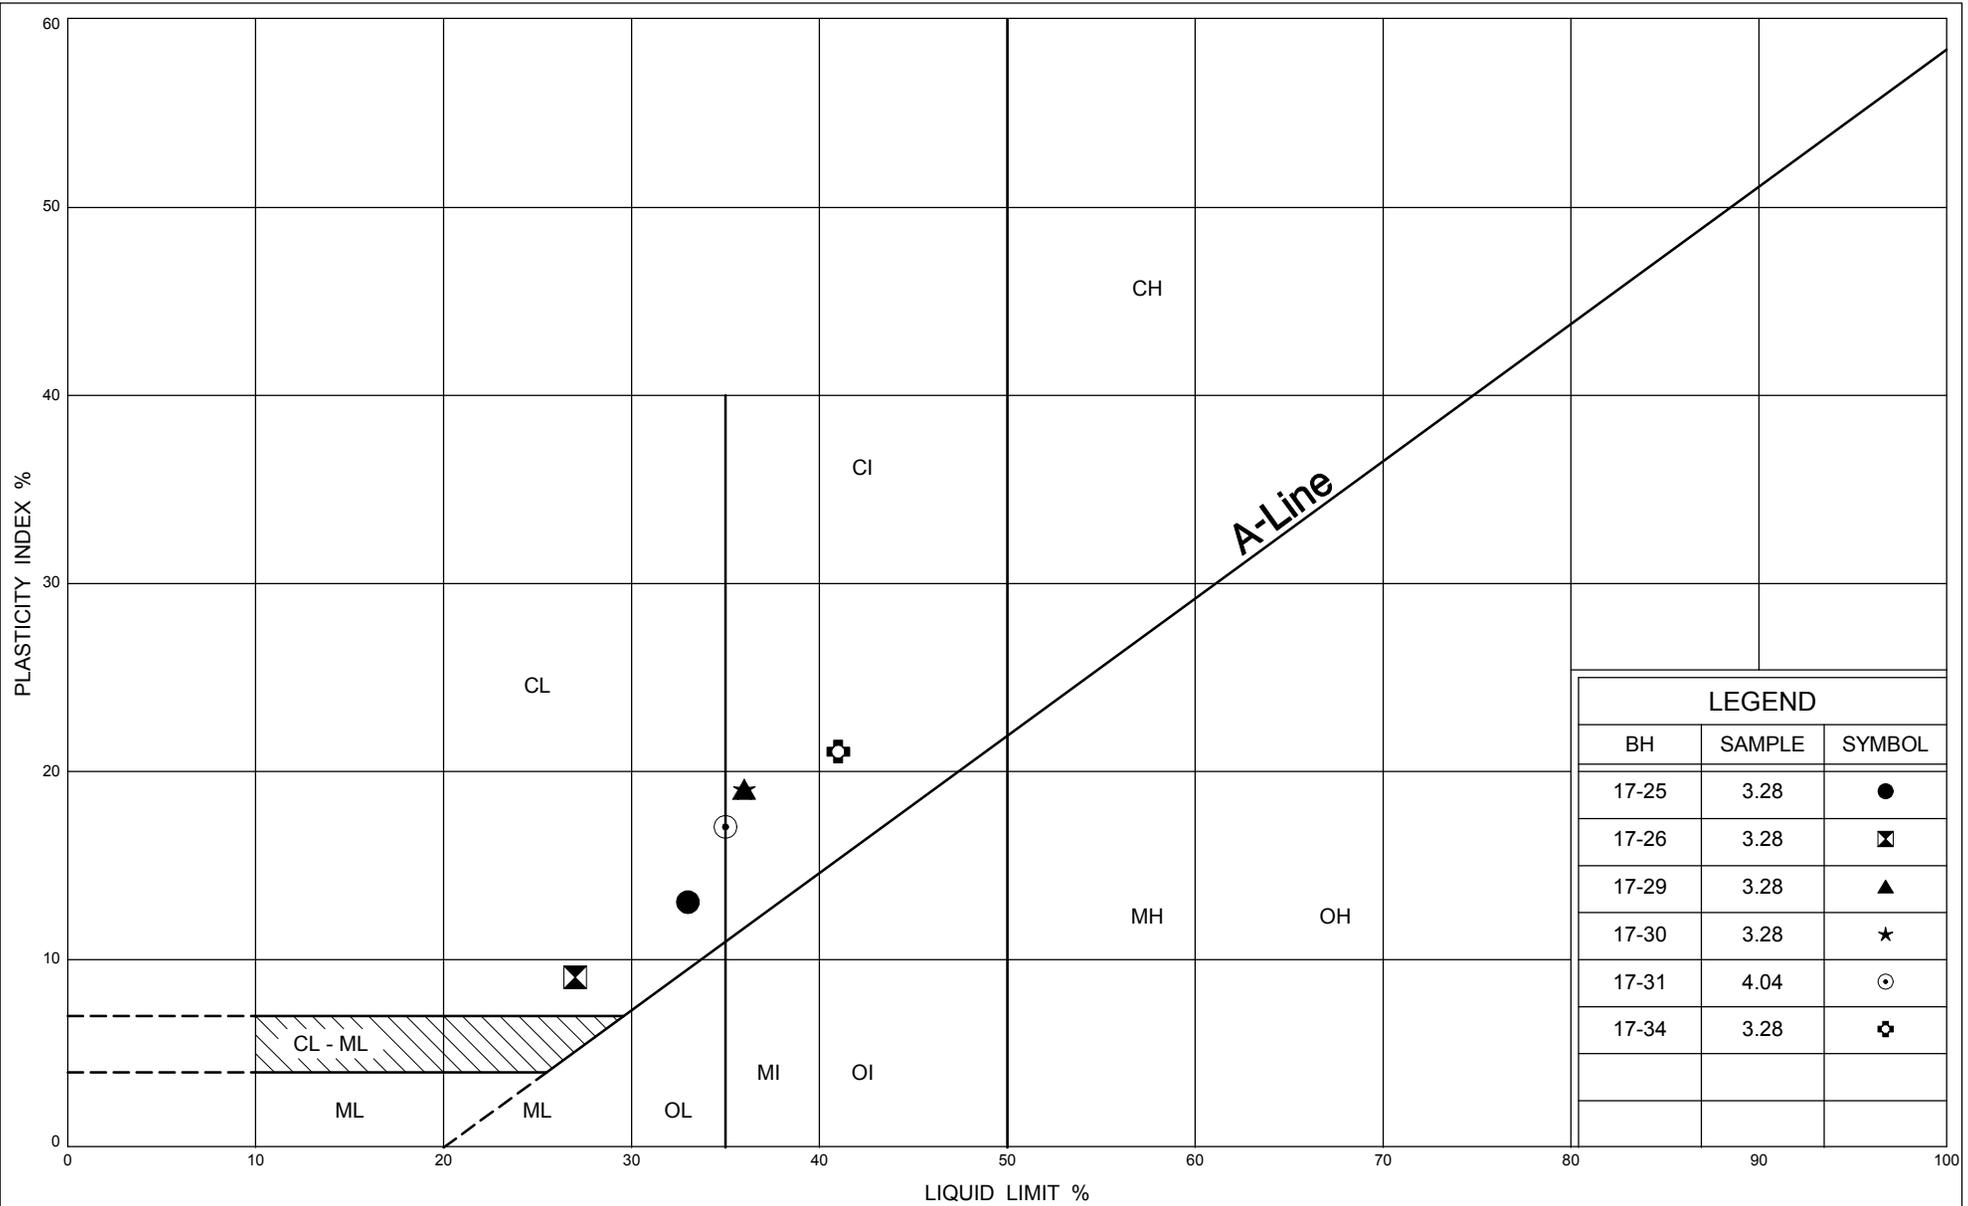


PLASTICITY CHART
Silty Clay/Clayey Silt

FIG No 9

W PWP 3102-15-00

3015-E-0017, Assignment 8

UNIFIED SOIL CLASSIFICATION SYSTEM

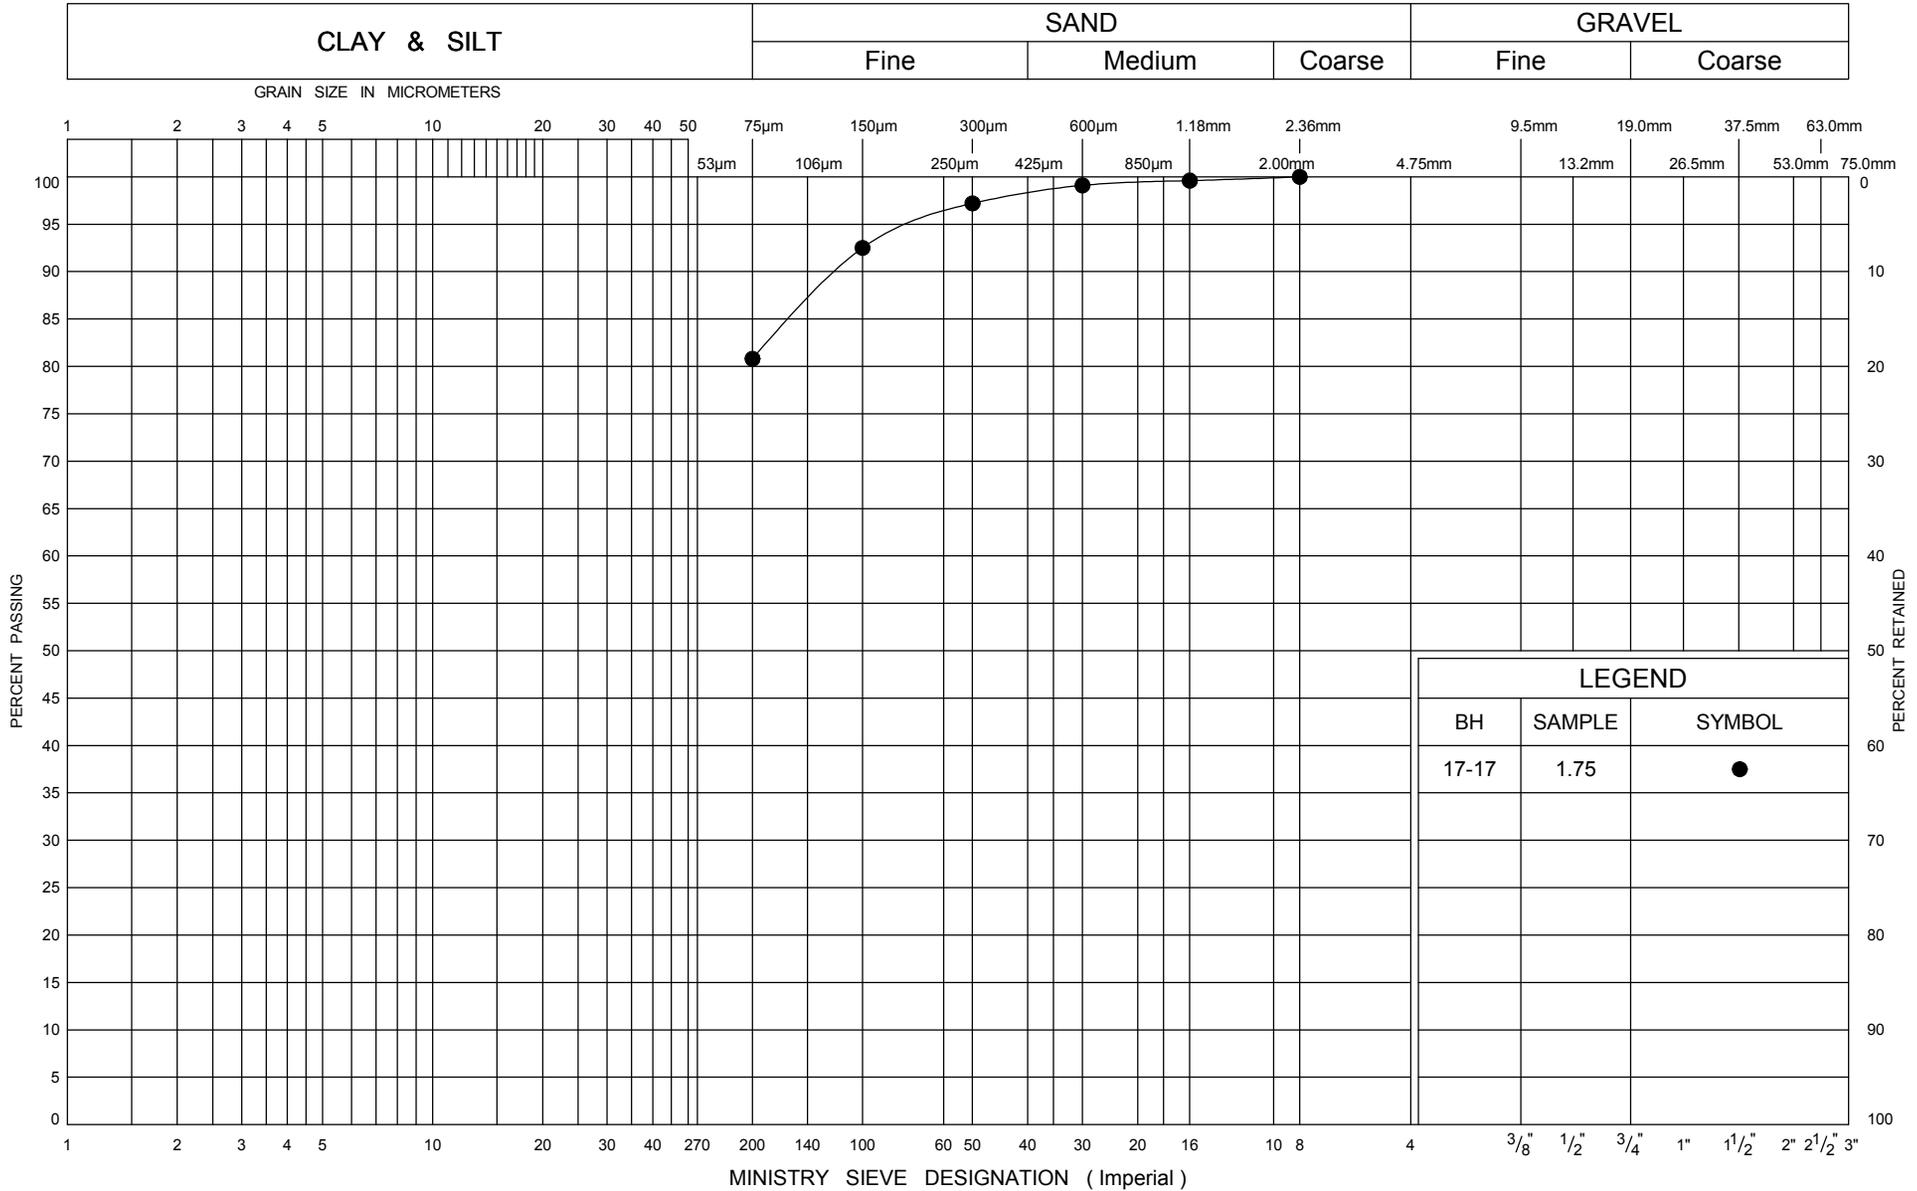


GRAIN SIZE DISTRIBUTION

Fill: Silty Clay/Clayey Silt

FIG No 10
W PWP 3102-15-00
3015-E-0017, Assignment 8

UNIFIED SOIL CLASSIFICATION SYSTEM

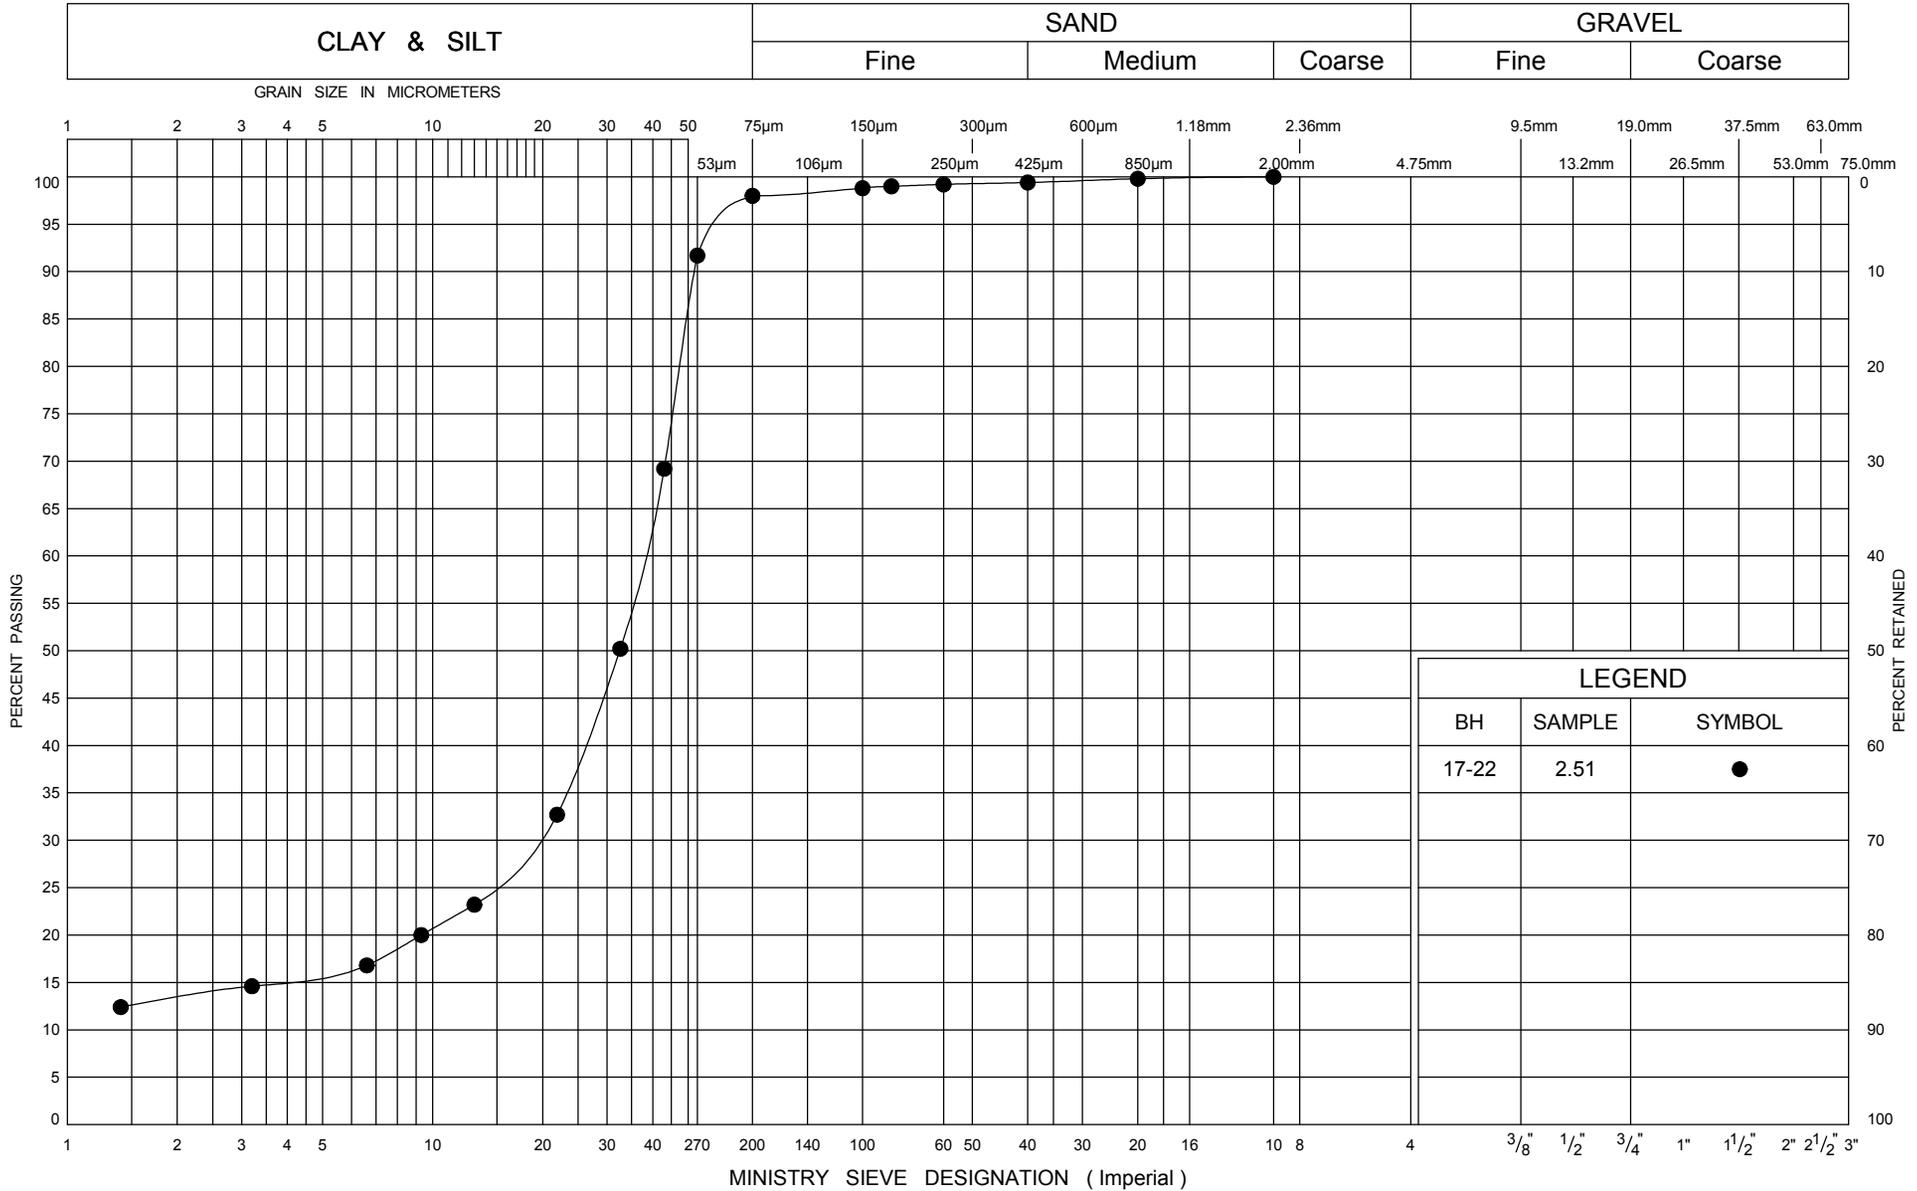


GRAIN SIZE DISTRIBUTION

Fill: Silt

FIG No 11
W PWP 3102-15-00
3015-E-0017, Assignment 8


UNIFIED SOIL CLASSIFICATION SYSTEM

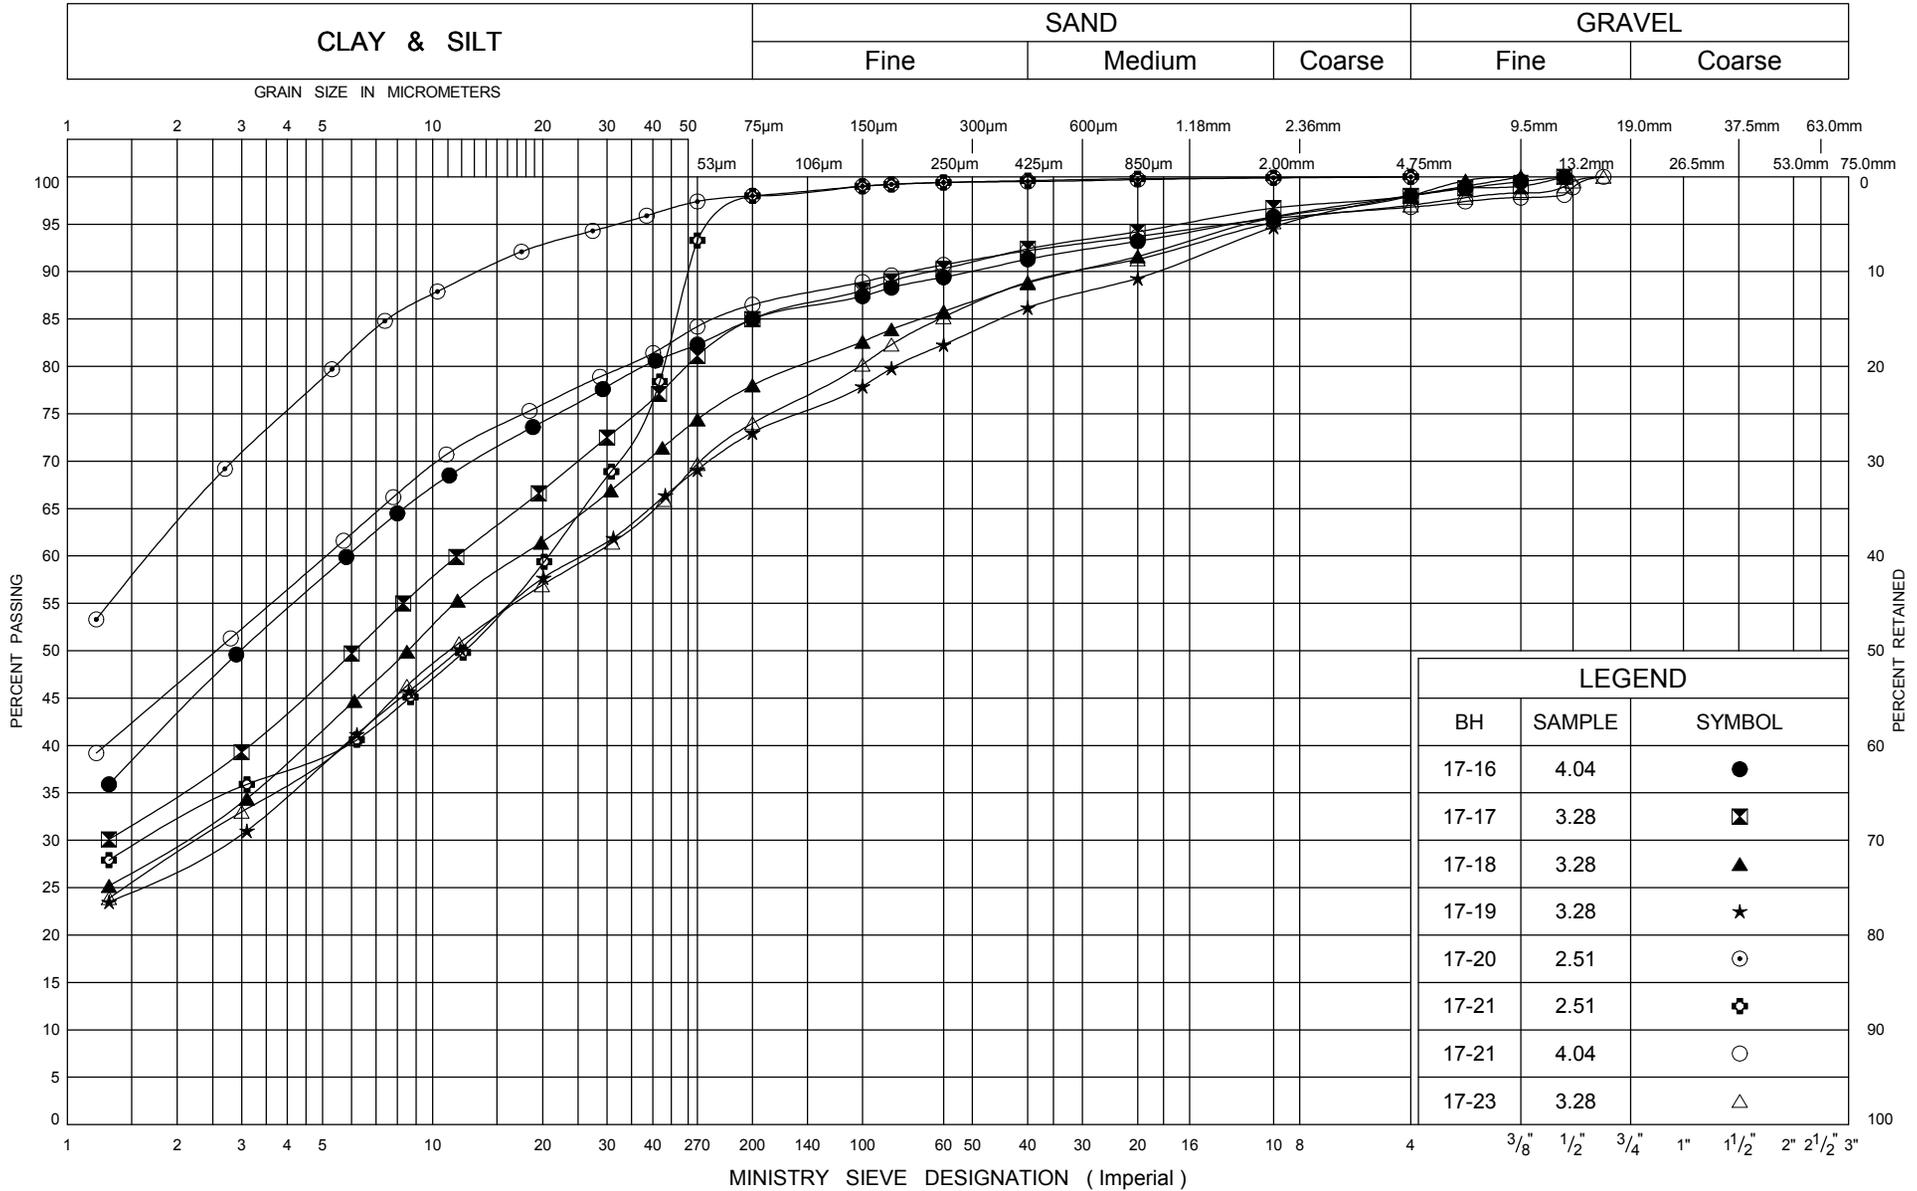

GRAIN SIZE DISTRIBUTION Silty Clay/Clayey Silt

FIG No 12
 W PWP 3102-15-00
 3015-E-0017, Assignment 8


UNIFIED SOIL CLASSIFICATION SYSTEM

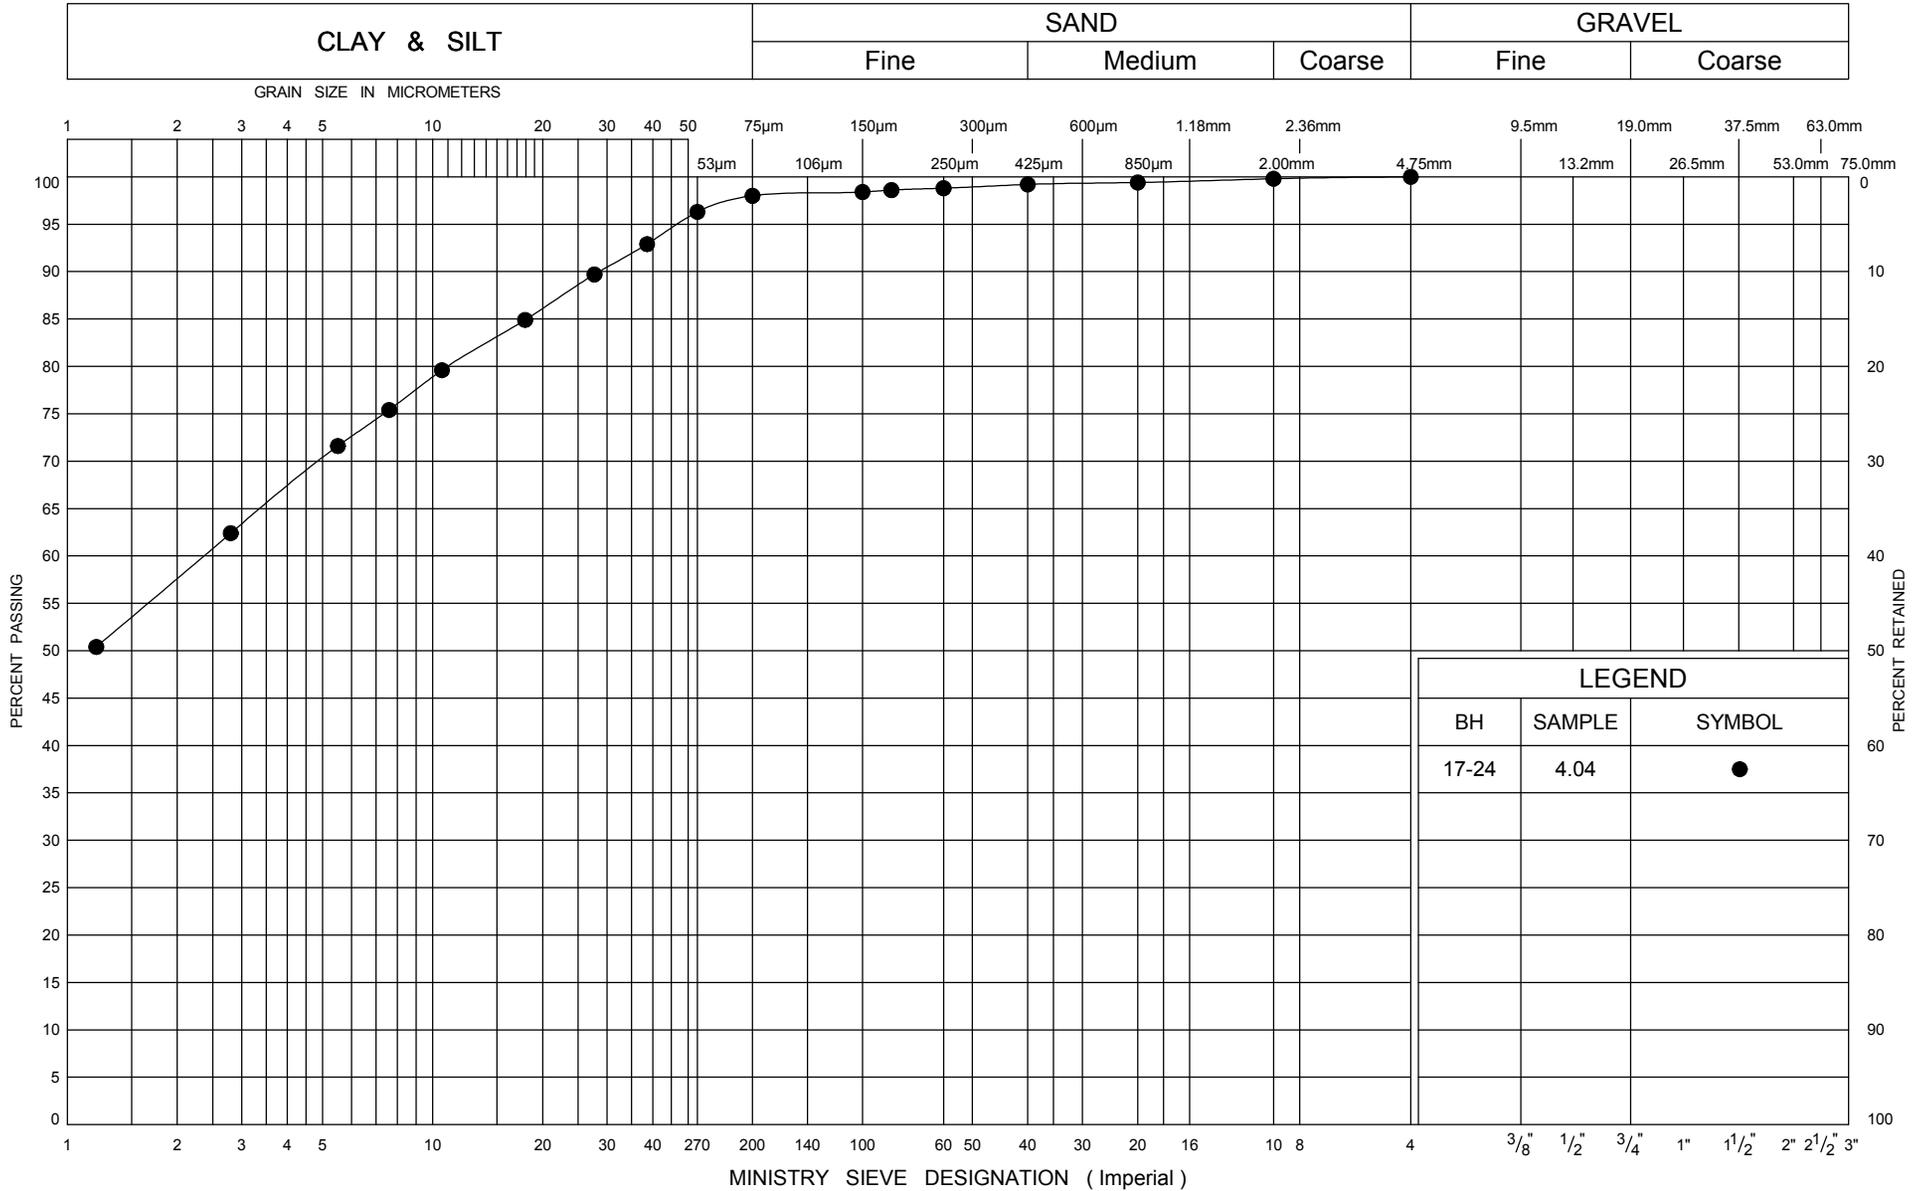

GRAIN SIZE DISTRIBUTION

Silty Clay/Clayey Silt

FIG No 13
W PWP 3102-15-00
3015-E-0017, Assignment 8

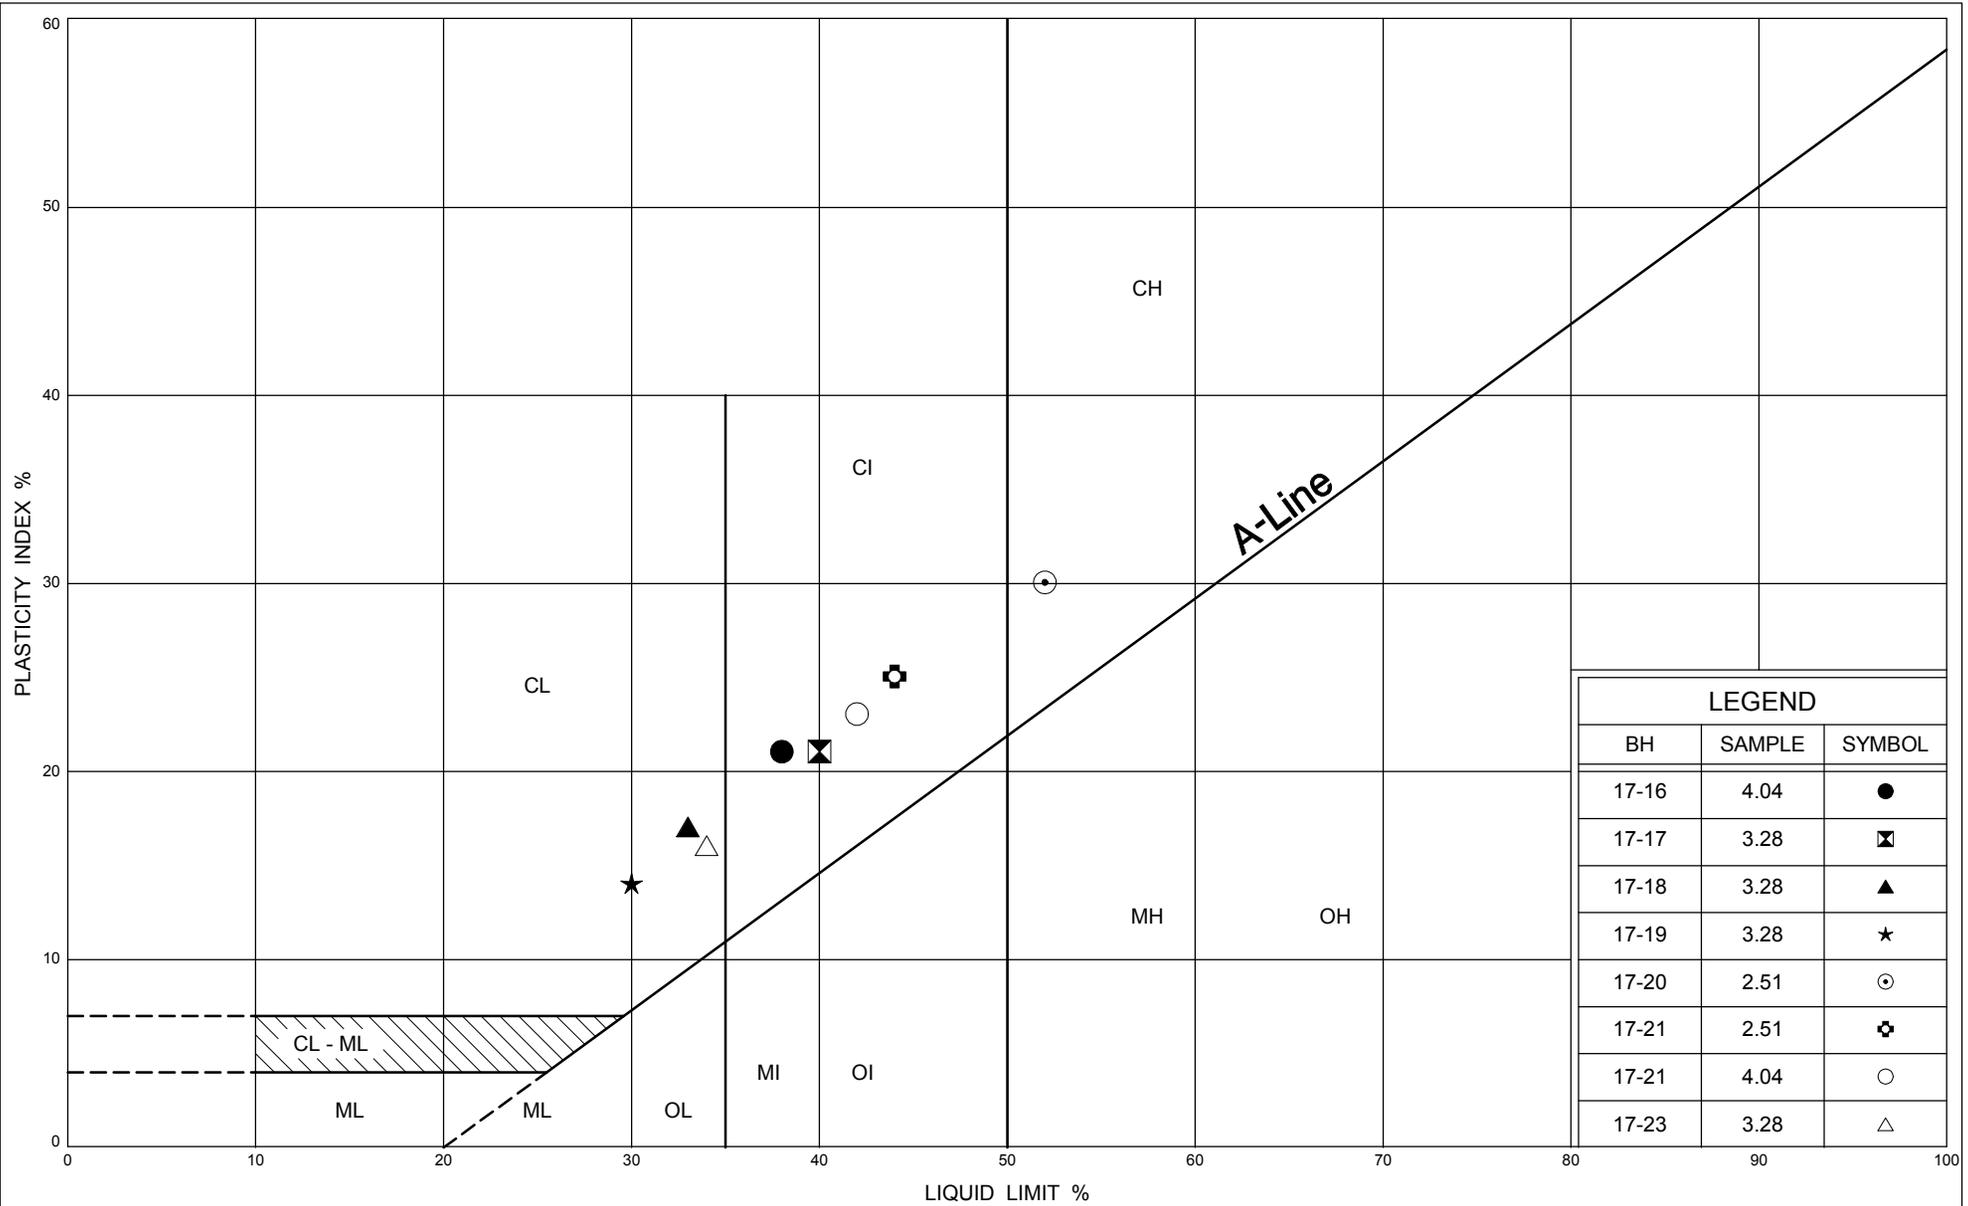


LEGEND		
BH	SAMPLE	SYMBOL
17-16	4.04	●
17-17	3.28	⊠
17-18	3.28	▲
17-19	3.28	★
17-20	2.51	⊙
17-21	2.51	⊕
17-21	4.04	○
17-23	3.28	△



PLASTICITY CHART
Silty Clay/Clayey Silt


FIG No 14
 W PWP 3102-15-00
 3015-E-0017, Assignment 8

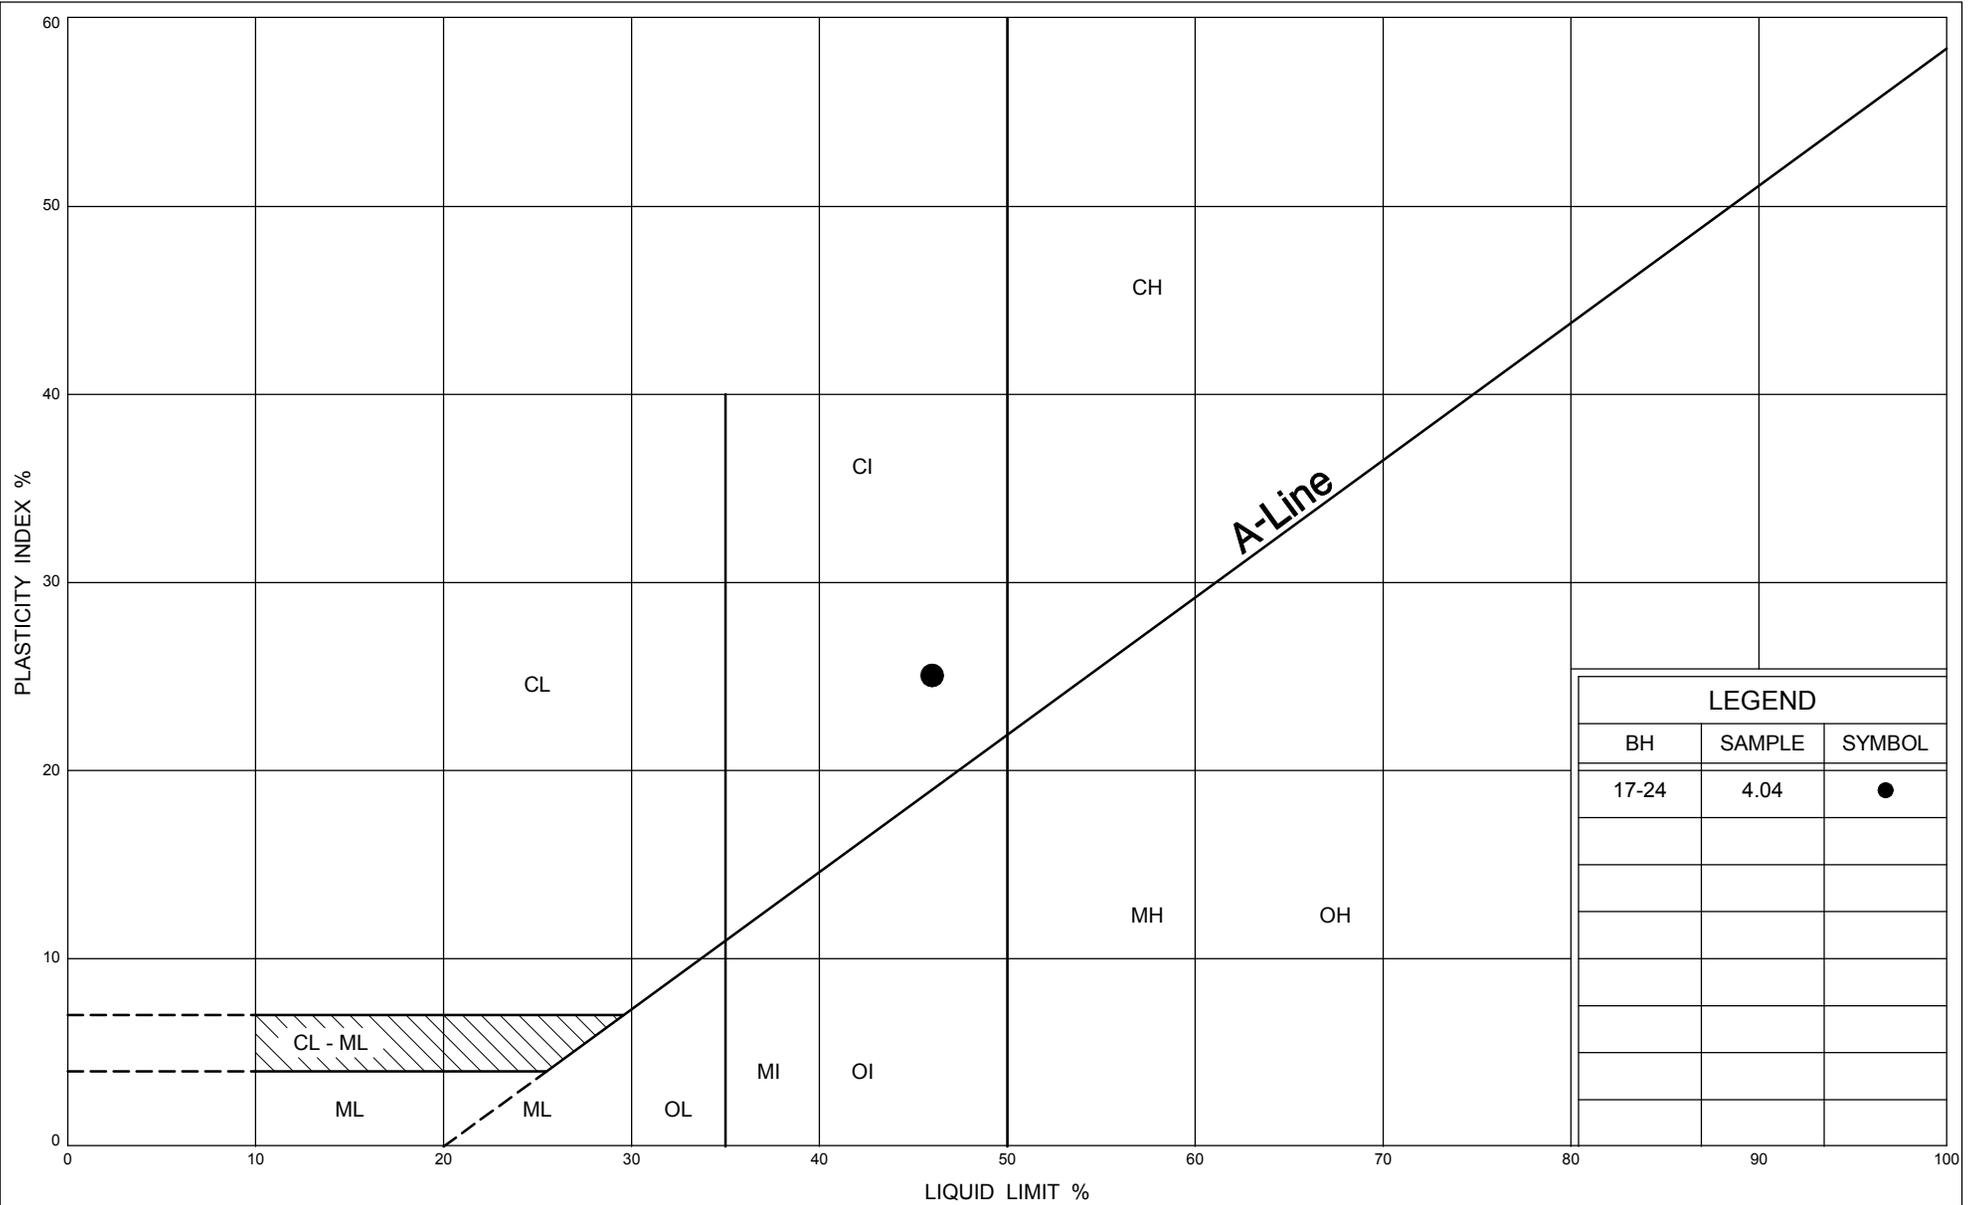

PLASTICITY CHART
Silty Clay/Clayey Silt

FIG No 15
 W PWP 3102-15-00
 3015-E-0017, Assignment 8

UNIFIED SOIL CLASSIFICATION SYSTEM

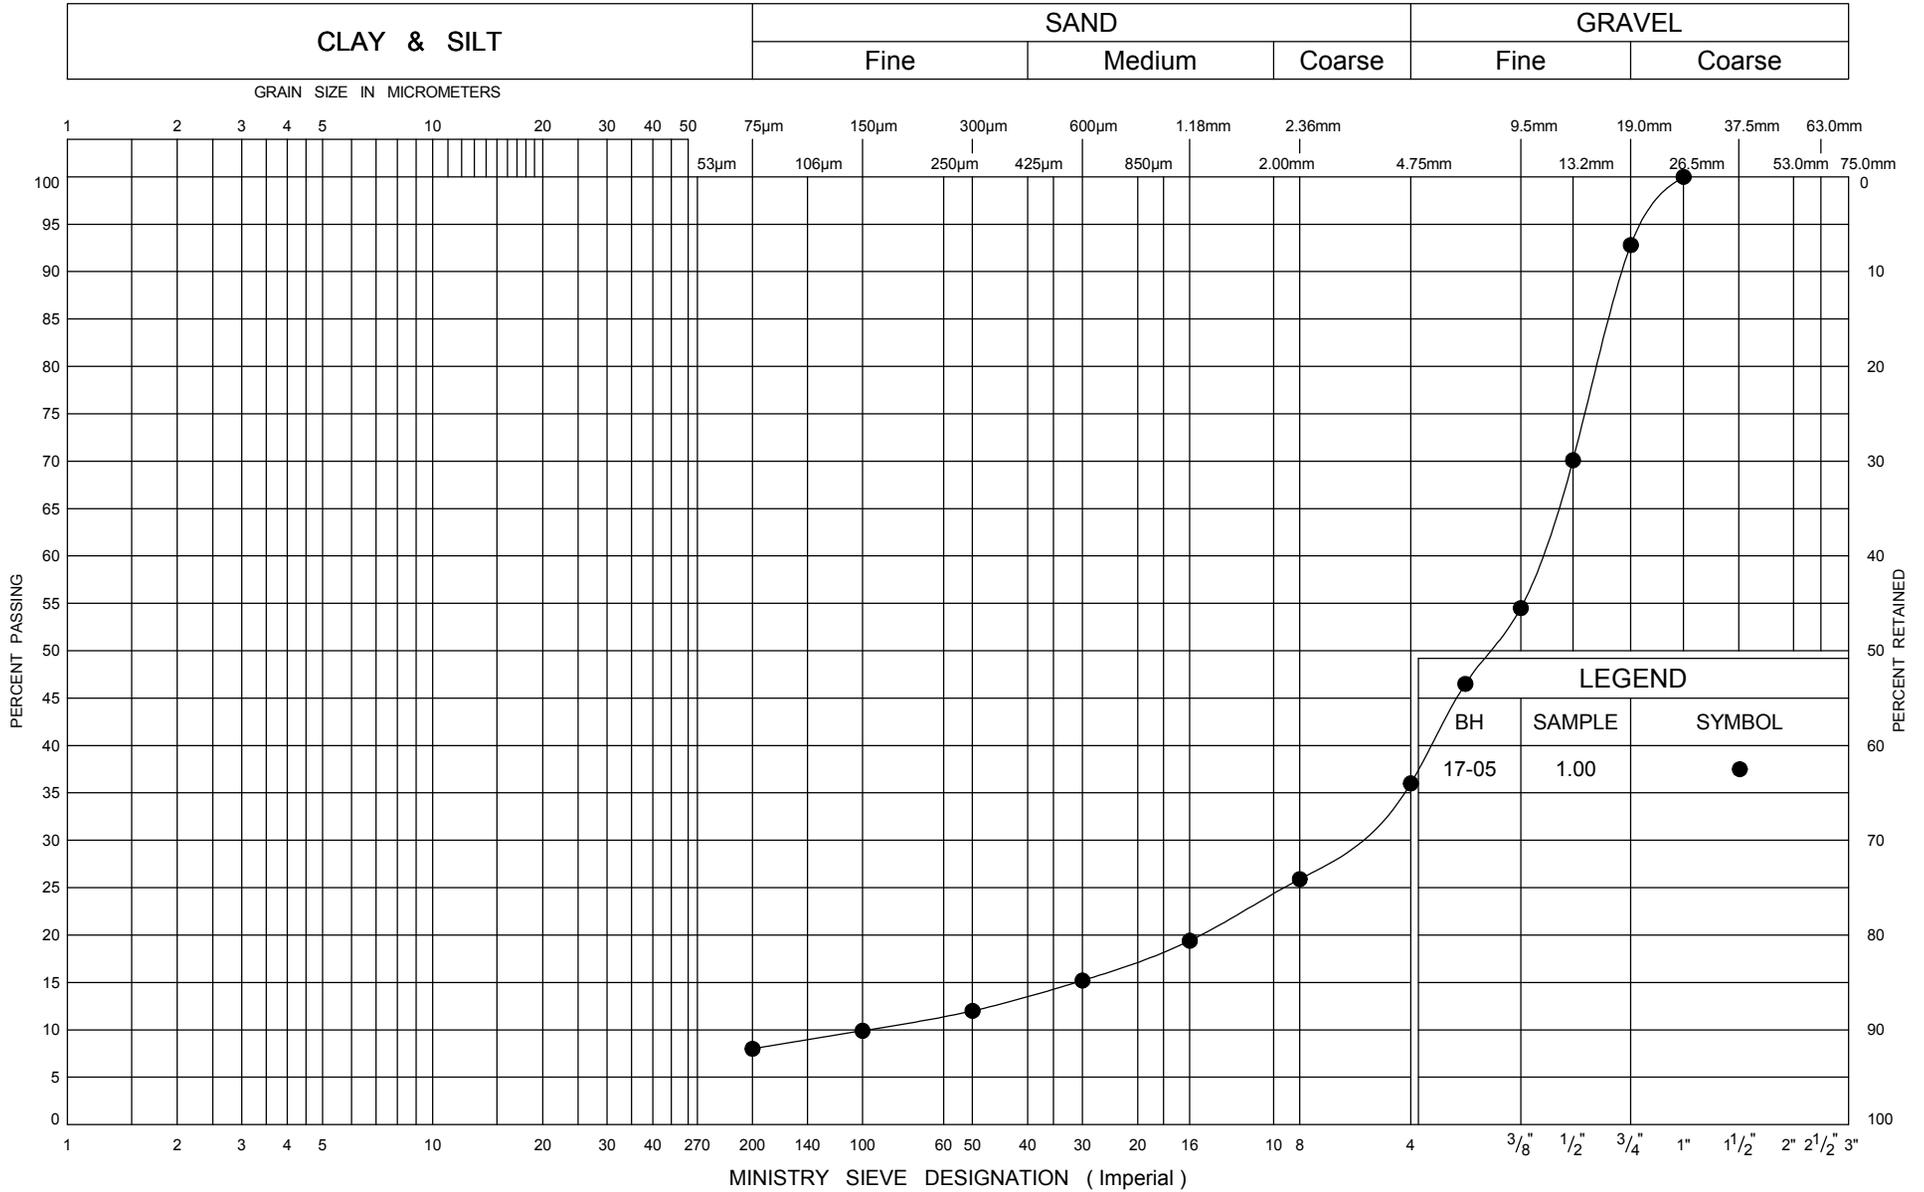

LEGEND		
BH	SAMPLE	SYMBOL
17-05	1.00	●



GRAIN SIZE DISTRIBUTION


Fill: Sand and Gravel

FIG No 16

W PWP 3102-15-00

3015-E-0017, Assignment 8

UNIFIED SOIL CLASSIFICATION SYSTEM

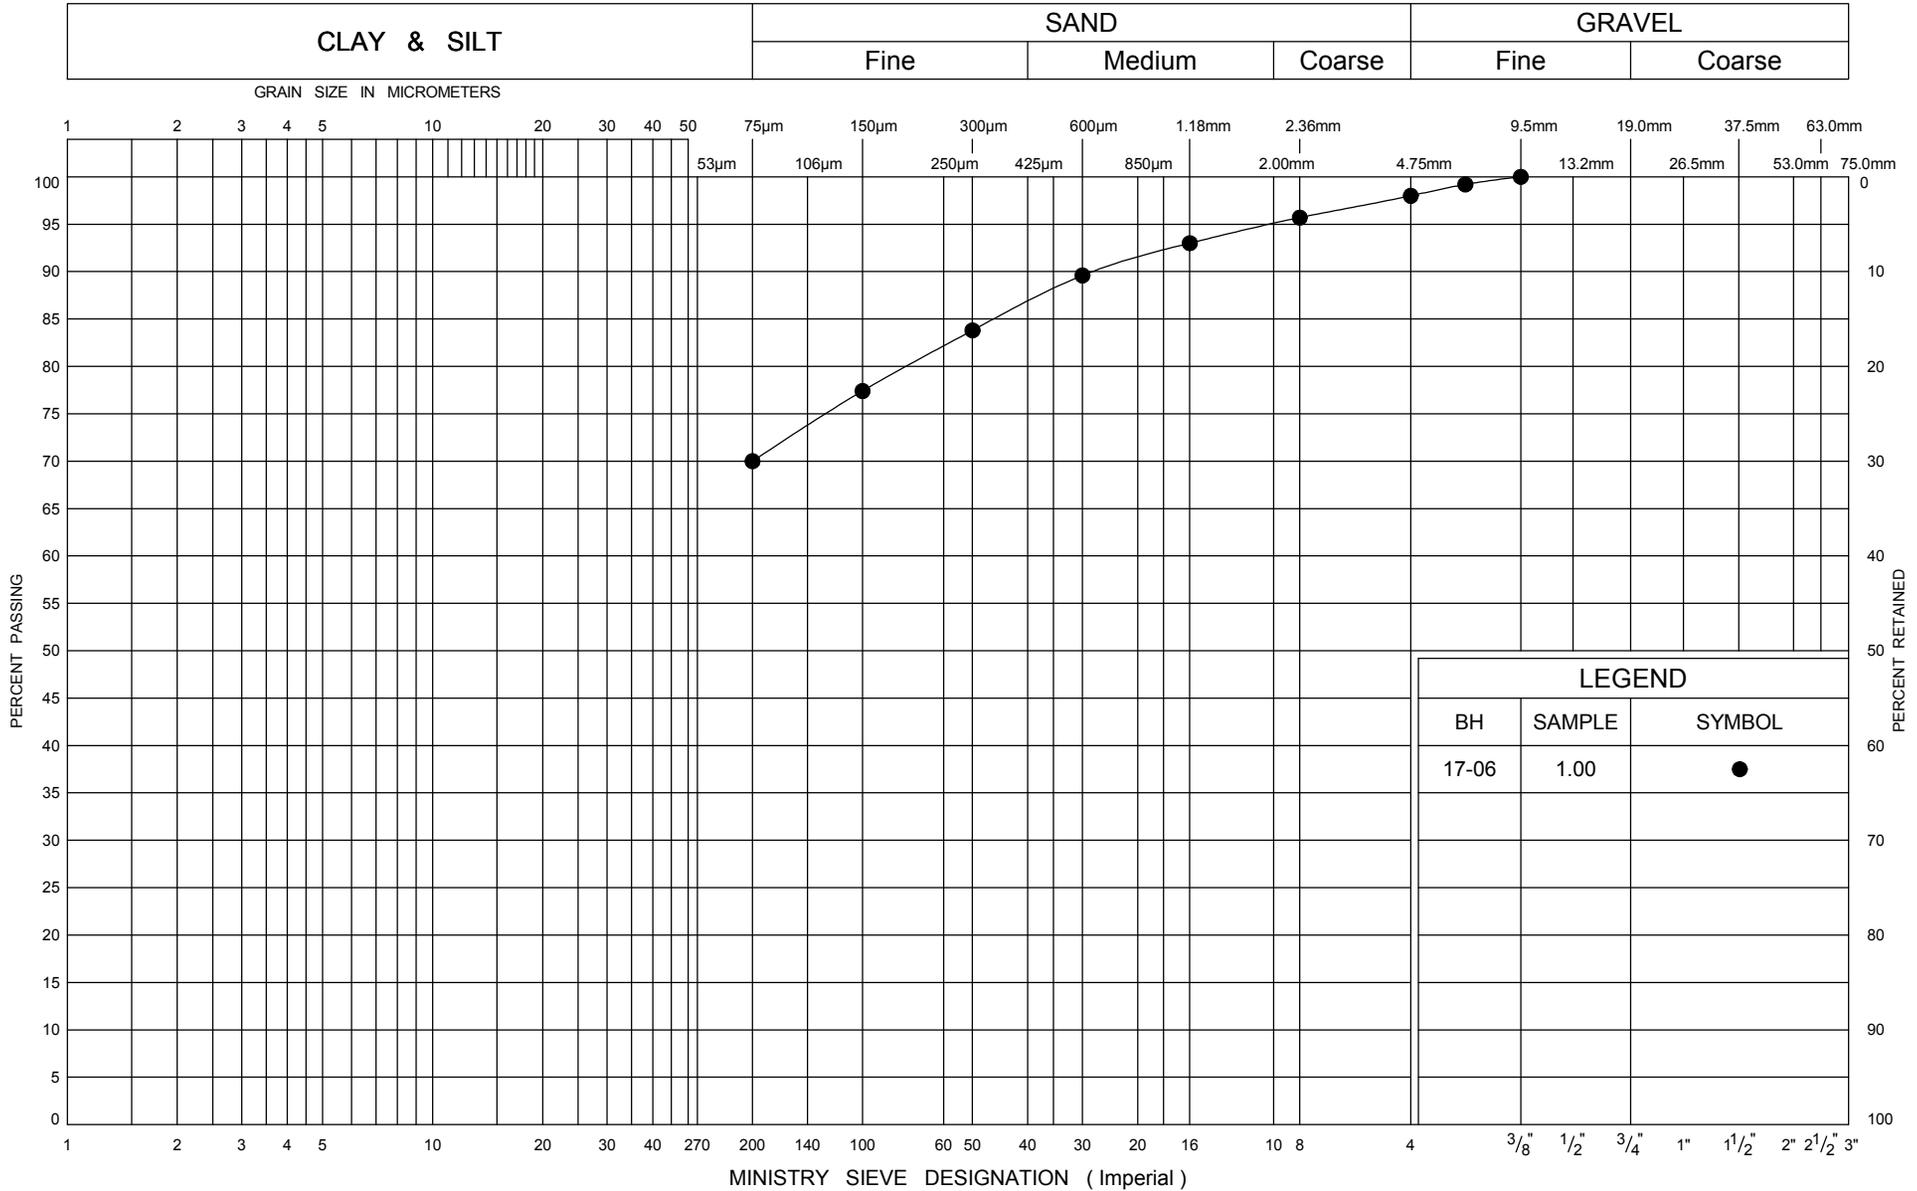

GRAIN SIZE DISTRIBUTION


Fill: Silty Clay/Clayey Silt

FIG No 17

W PWP 3102-15-00

3015-E-0017, Assignment 8

UNIFIED SOIL CLASSIFICATION SYSTEM

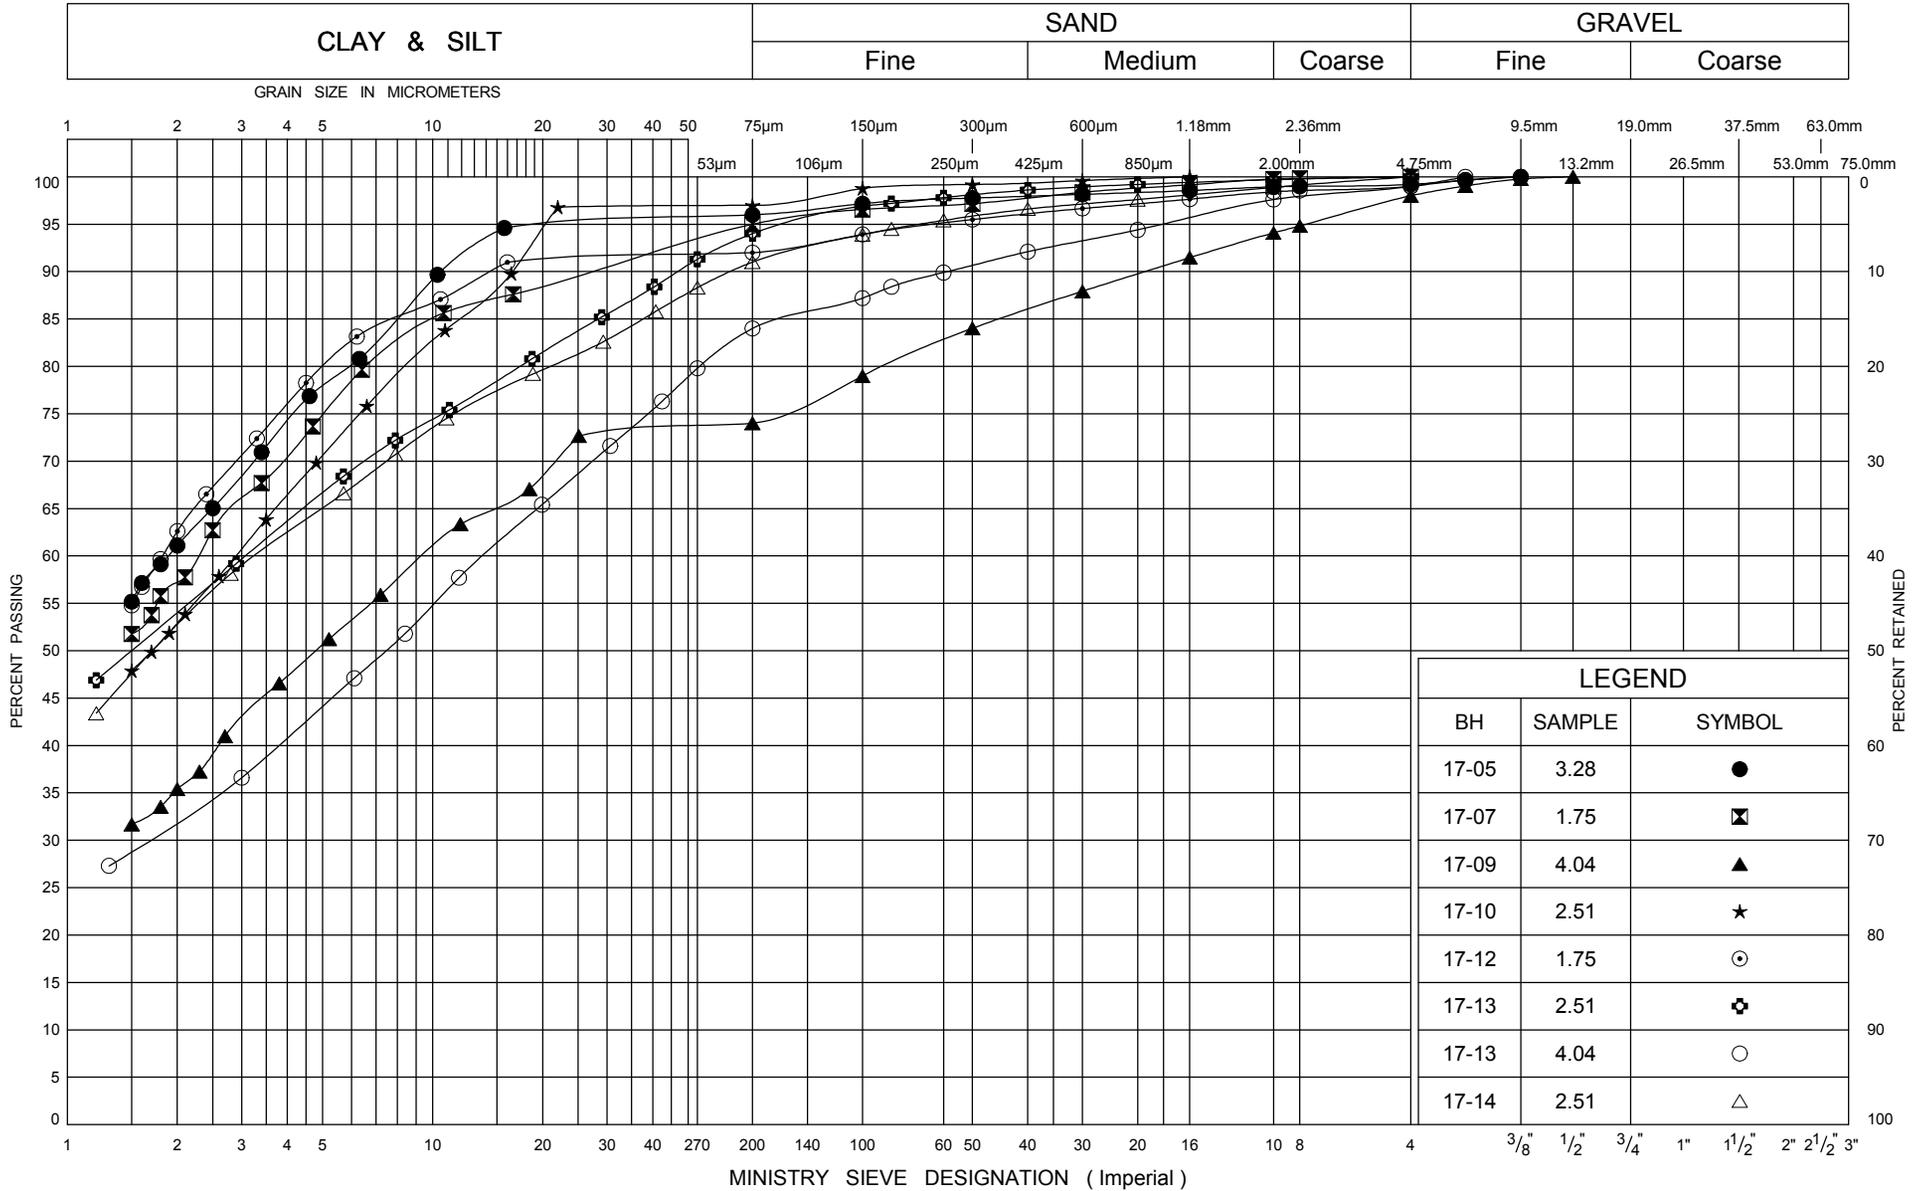

LEGEND		
BH	SAMPLE	SYMBOL
17-05	3.28	●
17-07	1.75	⊠
17-09	4.04	▲
17-10	2.51	★
17-12	1.75	⊙
17-13	2.51	⊕
17-13	4.04	○
17-14	2.51	△




GRAIN SIZE DISTRIBUTION **Silty Clay/Clayey Silt**

FIG No 18

W PWP 3102-15-00


3015-E-0017, Assignment 8

UNIFIED SOIL CLASSIFICATION SYSTEM

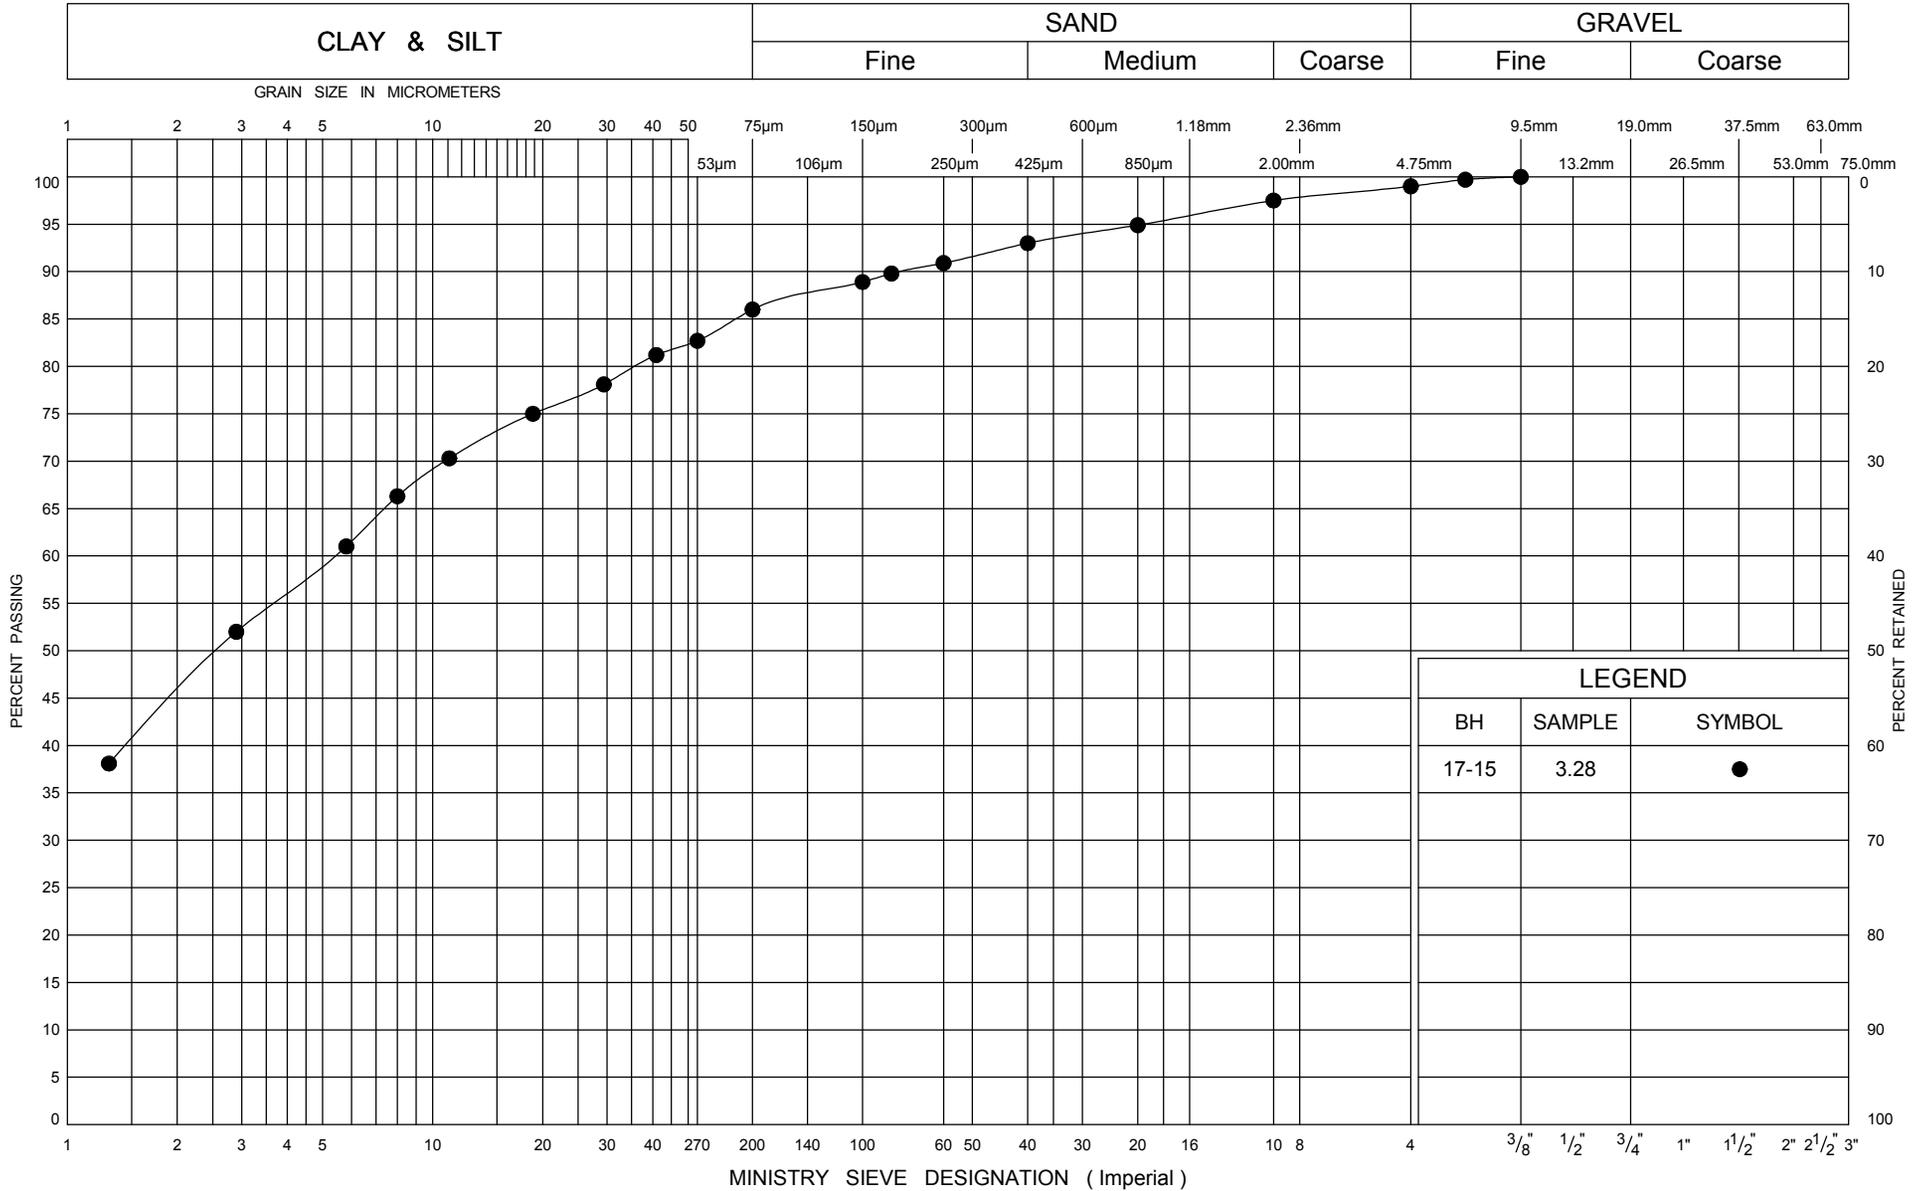

GRAIN SIZE DISTRIBUTION **Silty Clay/Clayey Silt**

FIG No 19
W PWP 3102-15-00
3015-E-0017, Assignment 8

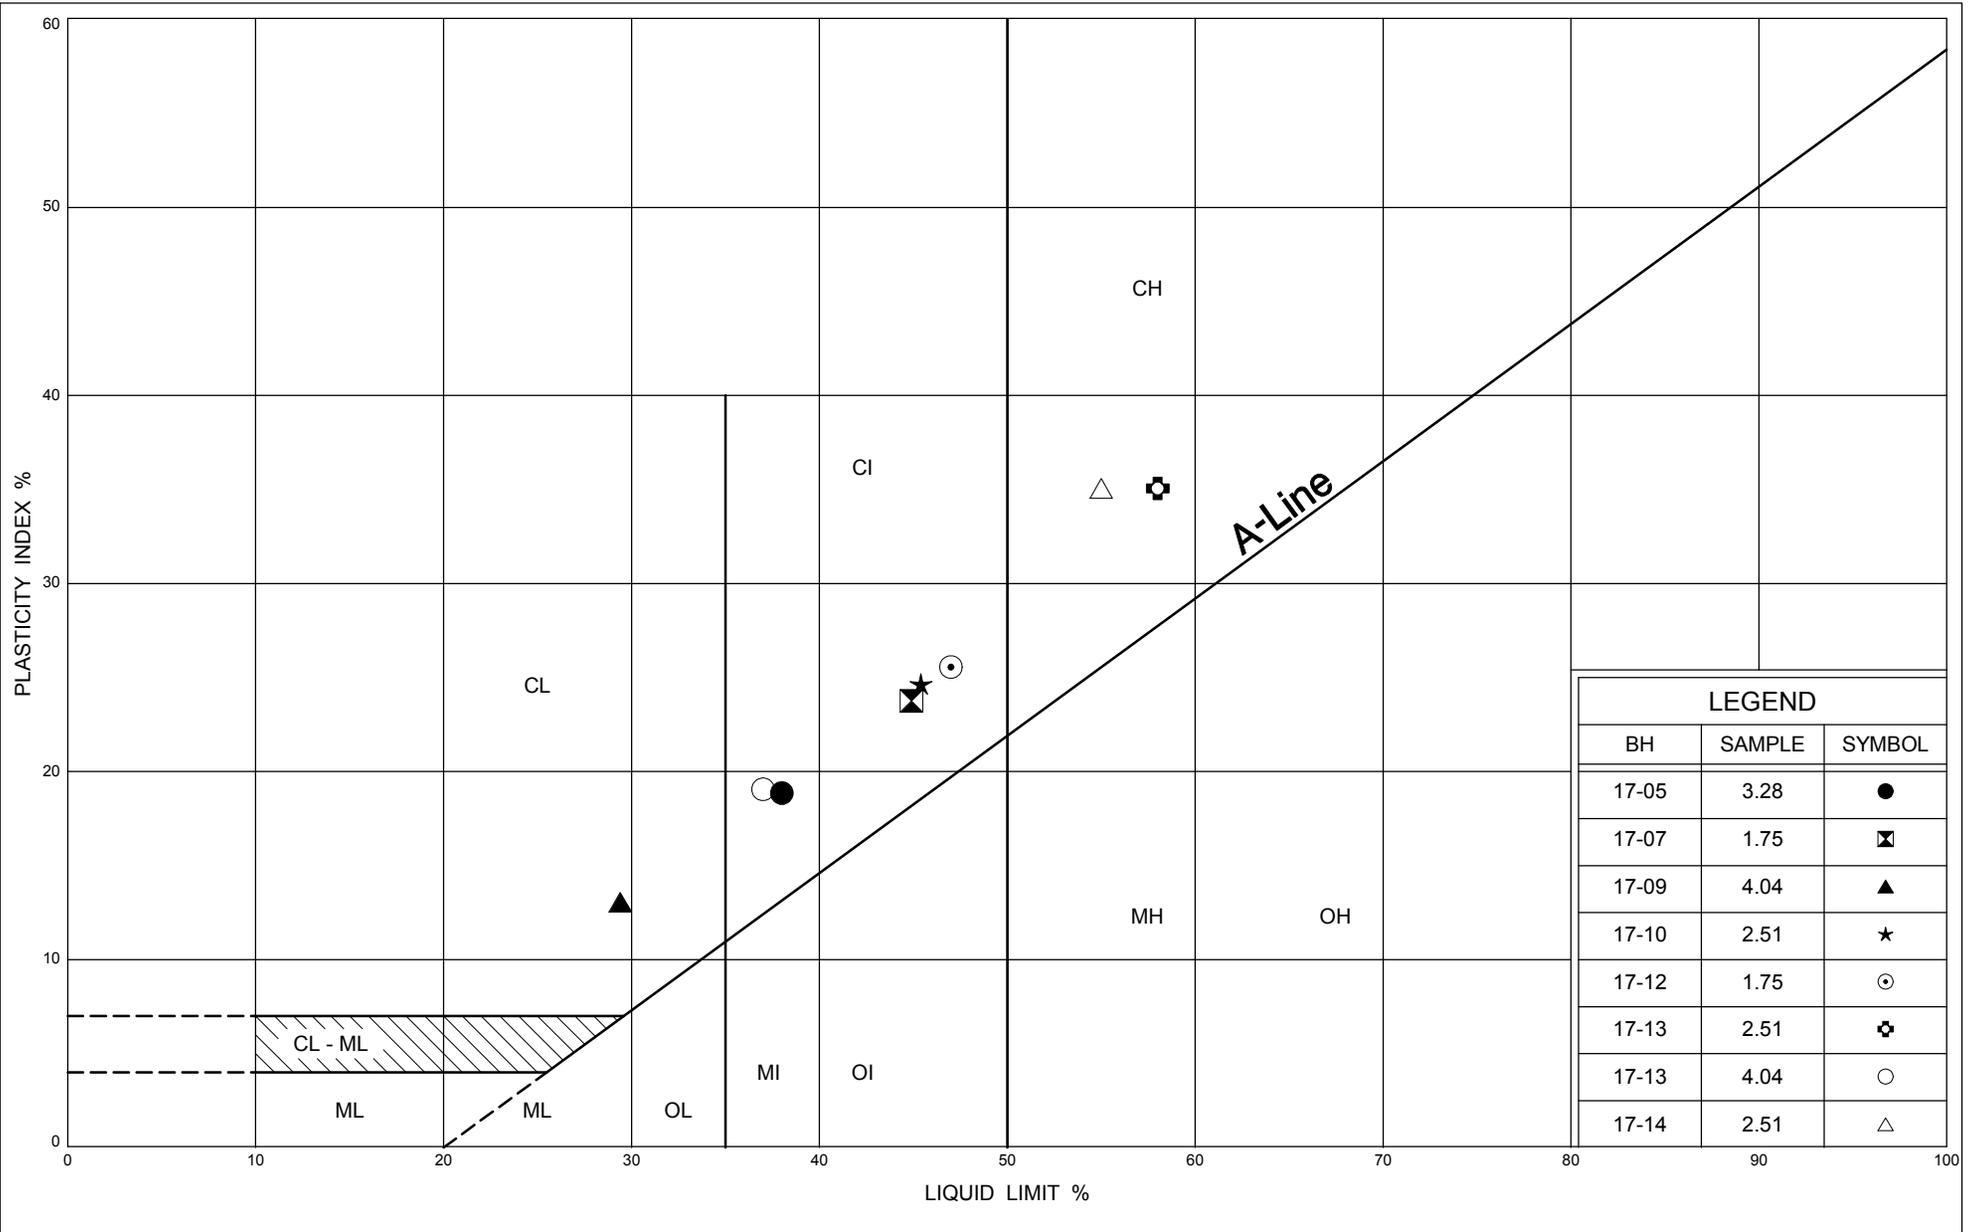


LEGEND		
BH	SAMPLE	SYMBOL
17-05	3.28	●
17-07	1.75	⊠
17-09	4.04	▲
17-10	2.51	★
17-12	1.75	⊙
17-13	2.51	⊕
17-13	4.04	○
17-14	2.51	△



PLASTICITY CHART
Silty Clay/Clayey Silt

FIG No 20
W PWP 3102-15-00
3015-E-0017, Assignment 8

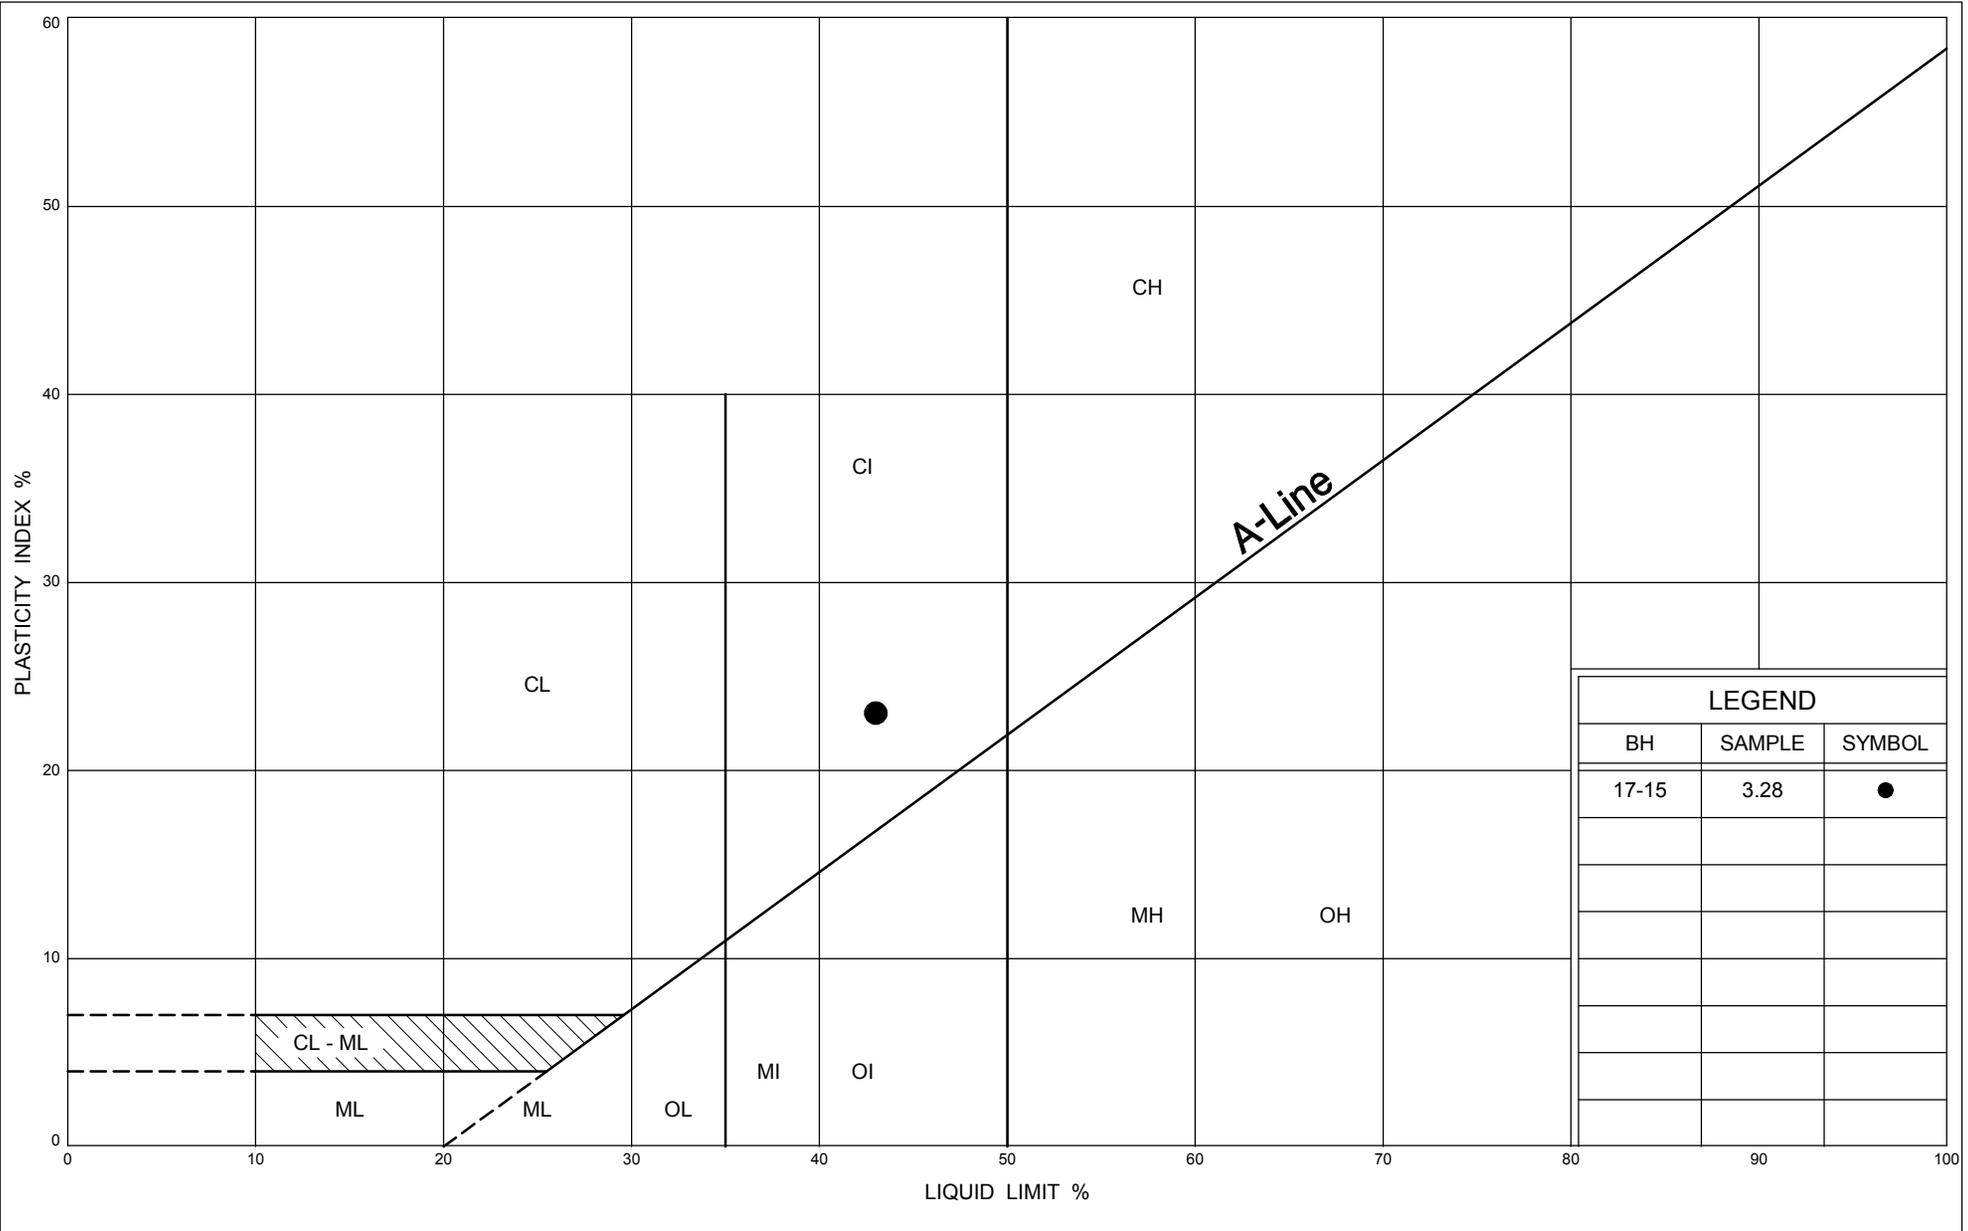


LEGEND		
BH	SAMPLE	SYMBOL
17-15	3.28	●



PLASTICITY CHART
Silty Clay/Clayey Silt

FIG No 21
W PWP 3102-15-00
3015-E-0017, Assignment 8

UNIFIED SOIL CLASSIFICATION SYSTEM

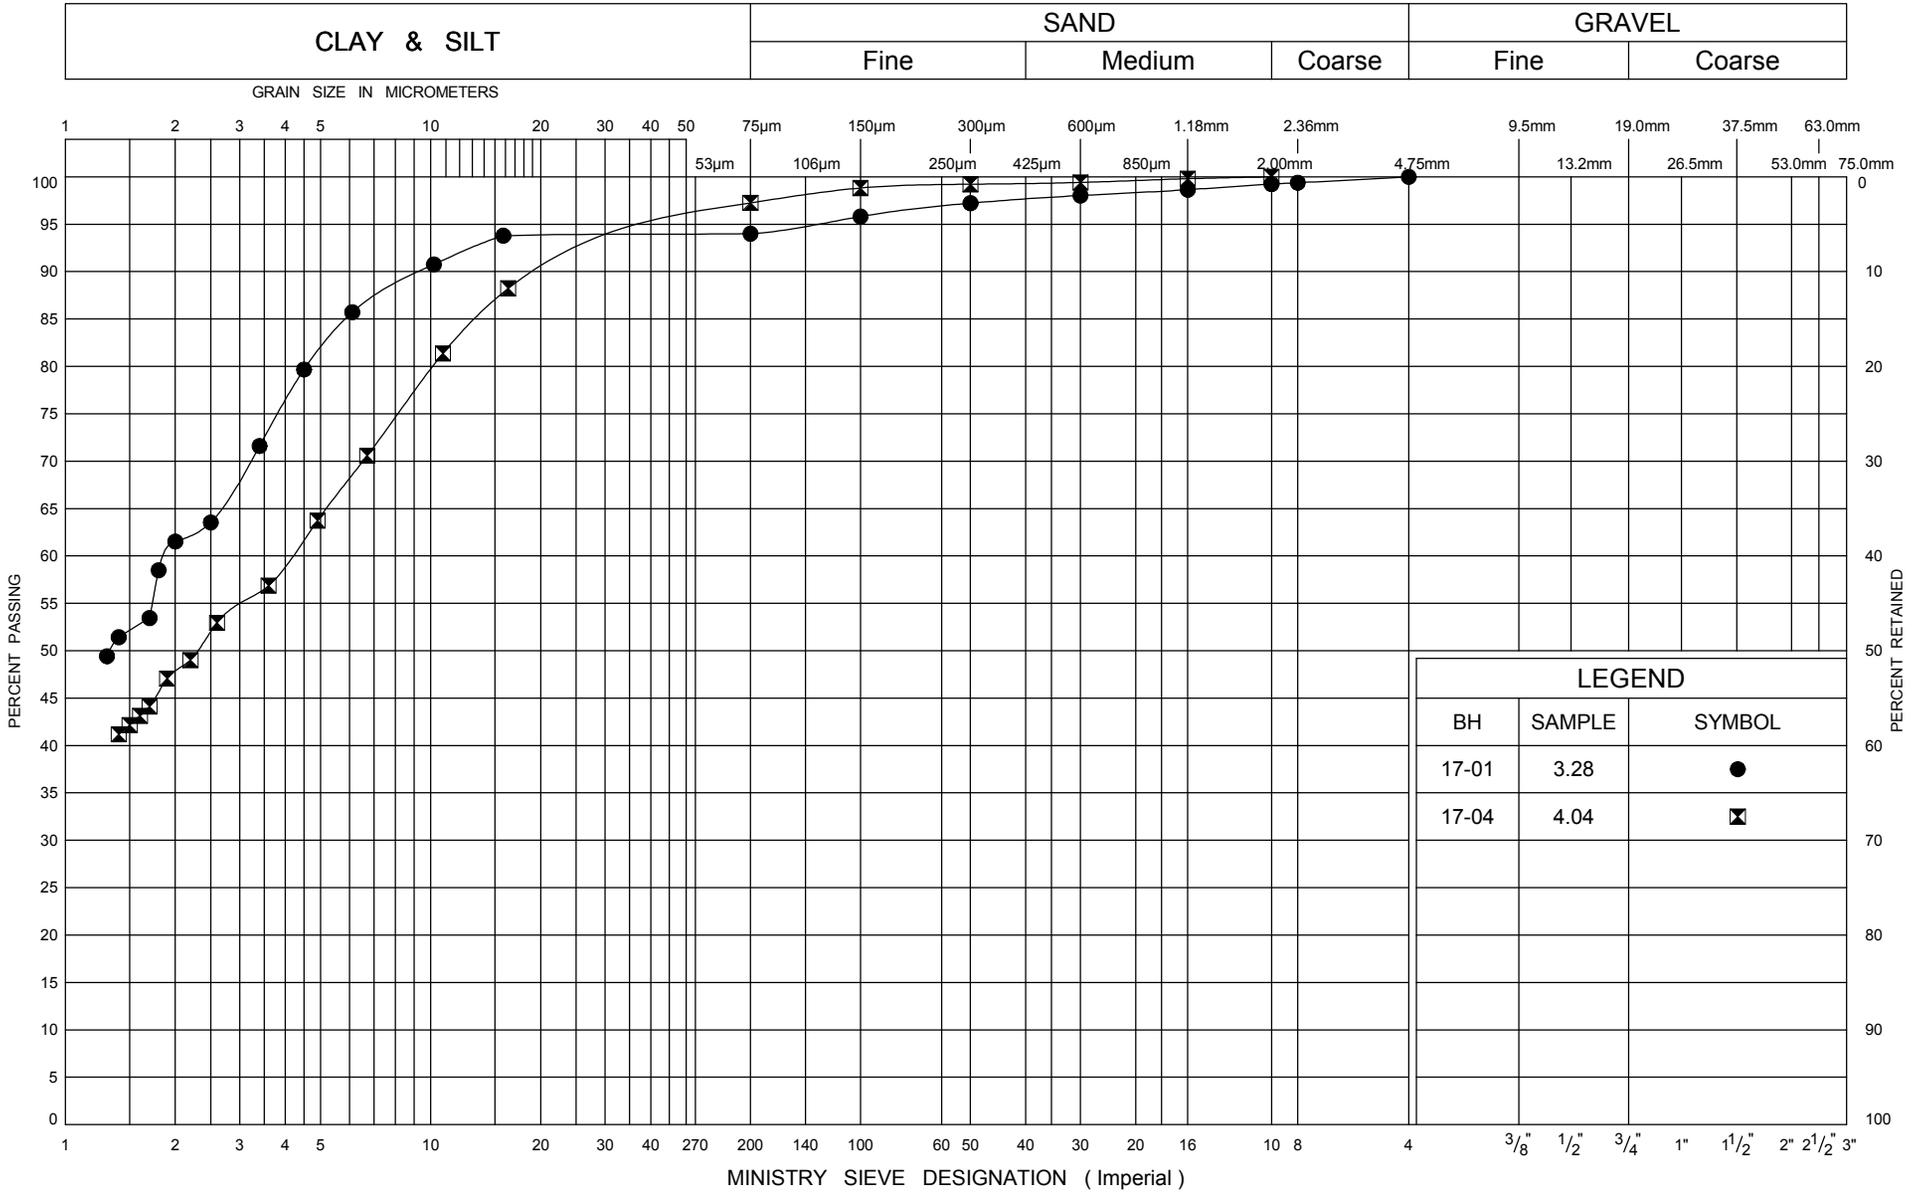


GRAIN SIZE DISTRIBUTION

Silty Clay/Clayey Silt

FIG No 22

W PWP 3102-15-00

3015-E-0017, Assignment 8

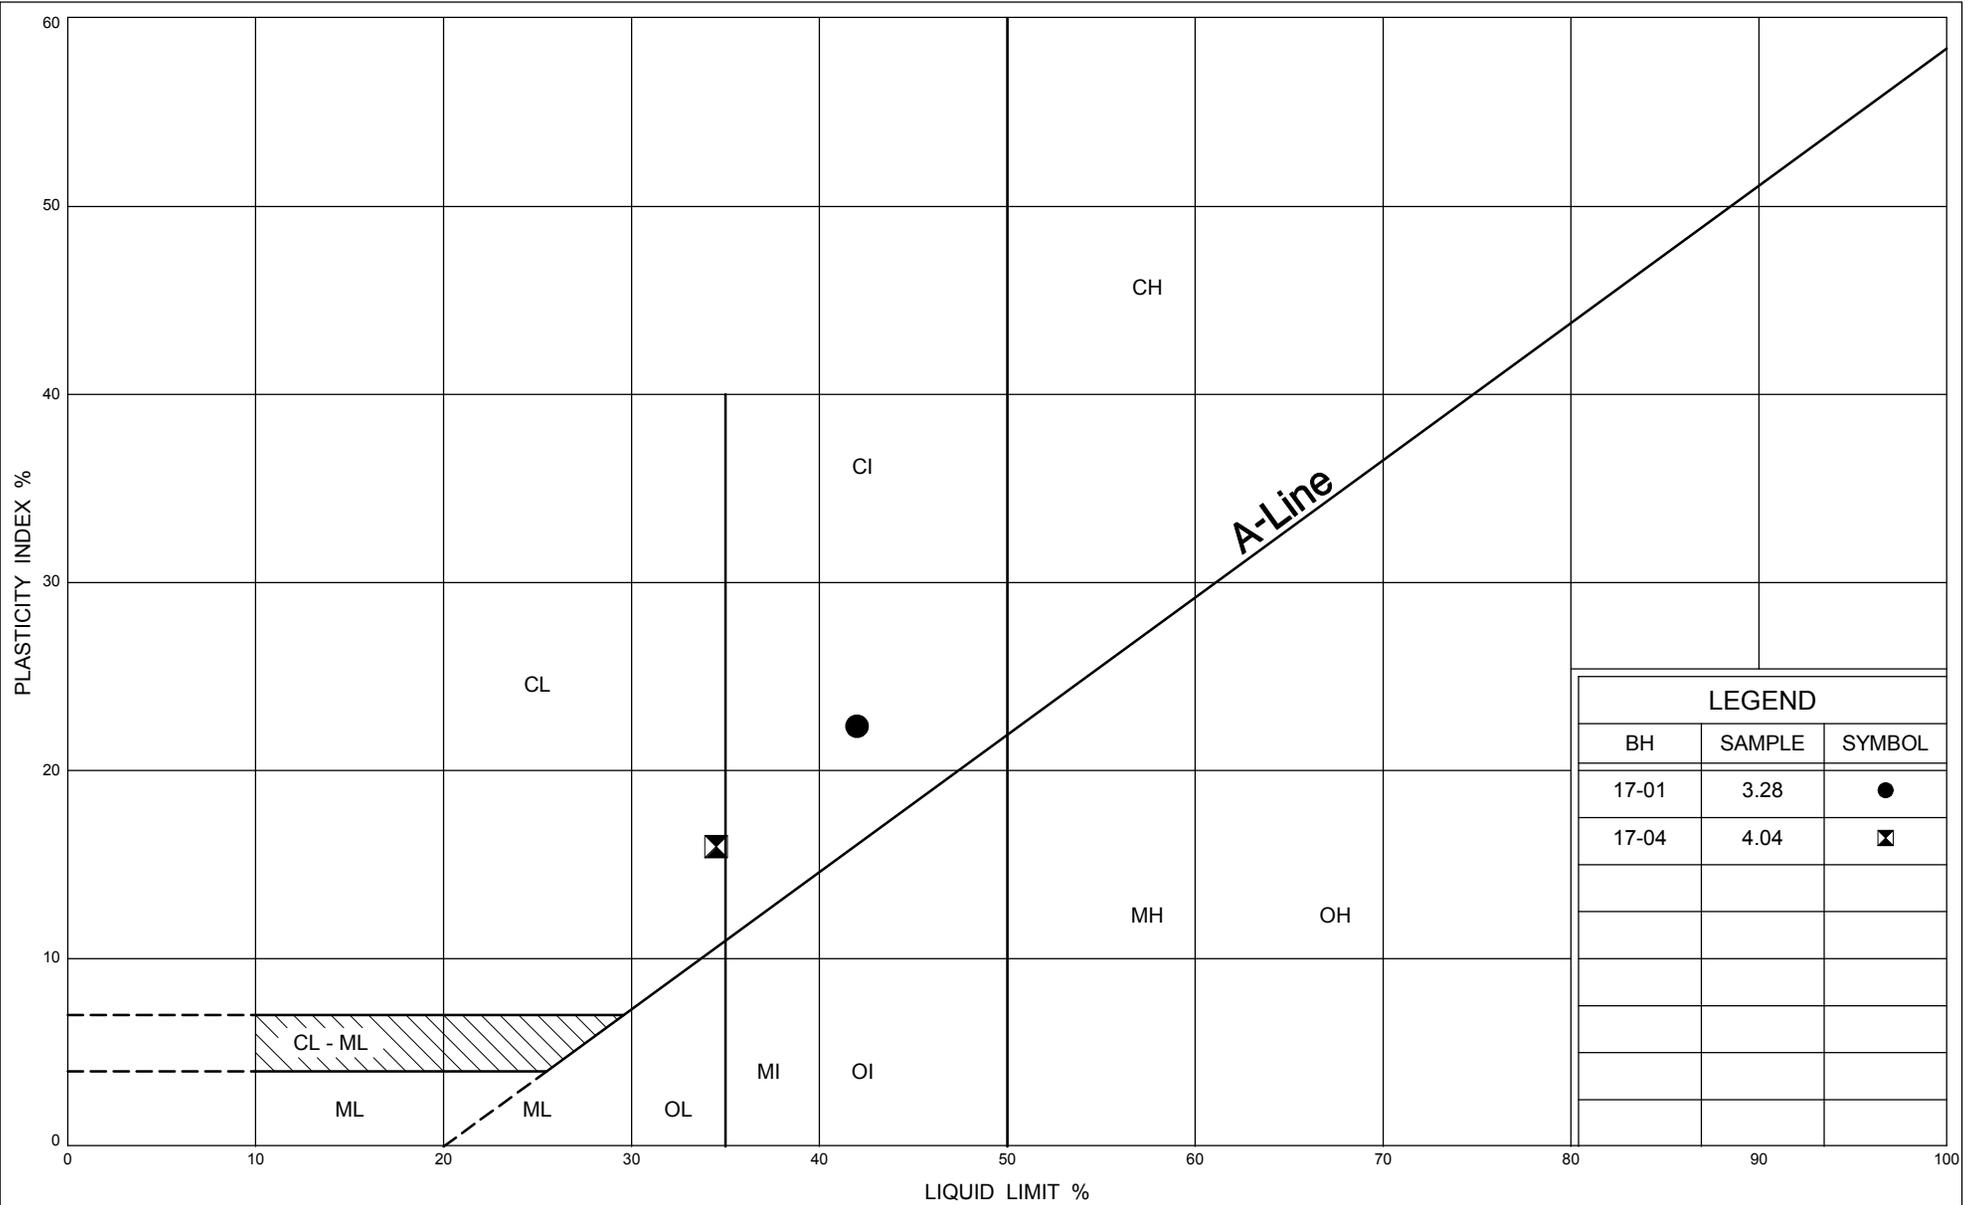


LEGEND		
BH	SAMPLE	SYMBOL
17-01	3.28	●
17-04	4.04	⊠



PLASTICITY CHART
Silty Clay/Clayey Silt

FIG No 23
 W PWP 3102-15-00
 3015-E-0017, Assignment 8

UNIFIED SOIL CLASSIFICATION SYSTEM

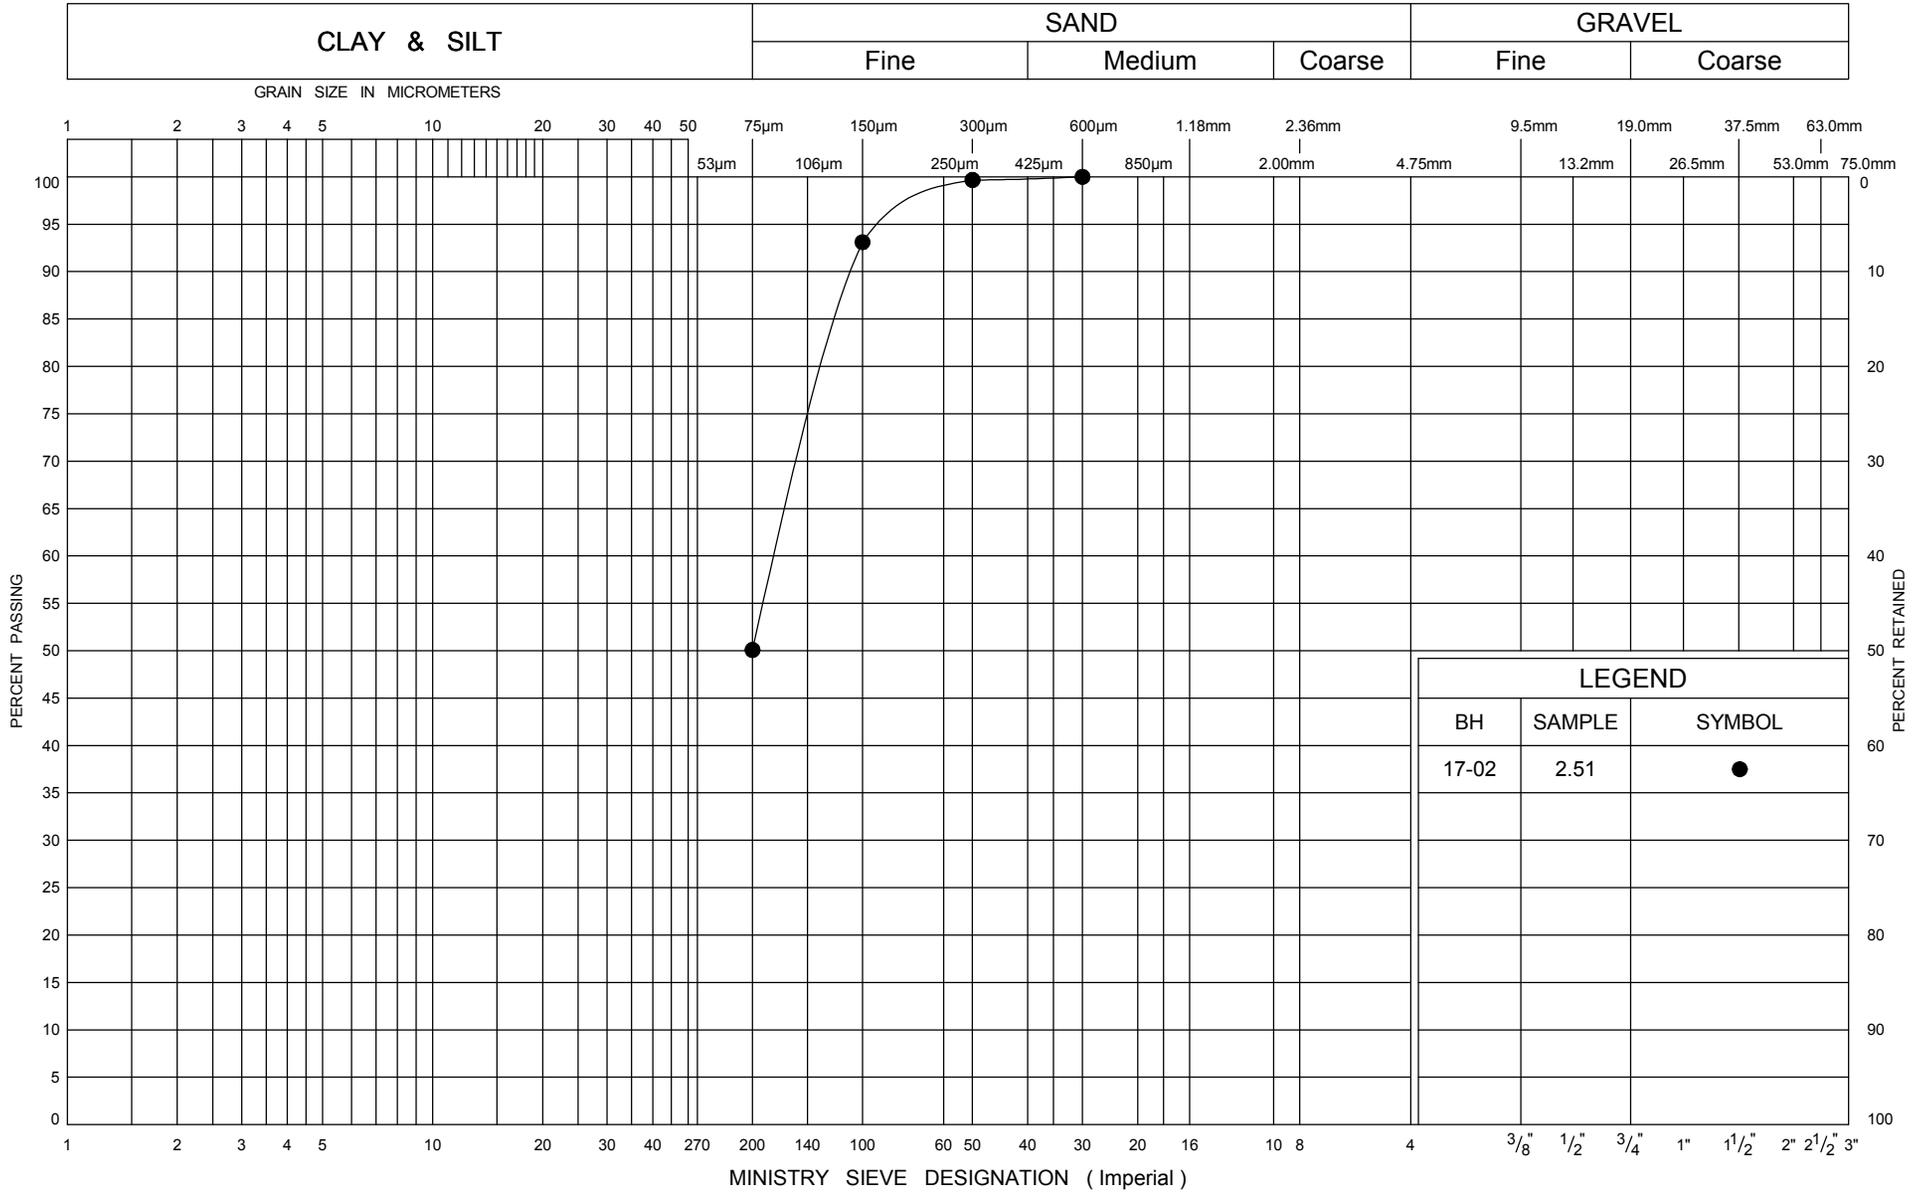

GRAIN SIZE DISTRIBUTION
Silty Sand

FIG No 24

W PWP 3102-15-00

3015-E-0017, Assignment 8