



THURBER ENGINEERING LTD.

Foundation Investigation Report

Highway 35 Maintenance Patrol Yard

Kawartha Lakes, Ontario

Agreement No. 4021-E-0018

G.W.P No. 4044-22-00

Latitude: 44.519924°, Longitude: -78.792568°

GEOCREs No. 31D-828

Client Name: Dillon Consulting Limited

Date: October 12, 2023

File: 36708

TABLE OF CONTENTS

PART A: FACTUAL INFORMATION

1.	INTRODUCTION.....	1
2.	SITE DESCRIPTION.....	1
3.	INVESTIGATION PROCEDURES	1
3.1	2021 Investigation (GEOCRETS No. 31D-775).....	1
3.2	Current Investigation	2
4.	SITE GEOLOGY AND SUBSURFACE CONDITIONS.....	5
4.1	Regional Geology	5
4.2	General Description of Subsurface Conditions.....	5
4.3	Fill.....	6
4.4	Silty Sand to Sandy Silt	6
4.5	Sandy Gravel Clayey Silt Till	7
4.6	Groundwater Conditions.....	8
4.7	Hydrogeological Testing	8
4.7.1	Guelph Permeameter Tests in the Stormwater Management Pond Area .	8
4.7.2	Percolation (T-time) Tests – Septic Field Area	9
4.7.3	Borehole Infiltration Tests – Dry monitoring wells.....	9
4.8	Analytical Laboratory Testing	9
5.	MISCELLANEOUS.....	11

STATEMENT OF LIMITATIONS AND CONDITIONS

IN-TEXT TABLES

Table 3.1:	2021 Foundation Investigation (by Others).....	2
Table 3.2:	2023 Foundation Investigation.....	3
Table 4.1:	Grain Size Distribution of Silty Sand to Silt and Sand Fill	6
Table 4.2:	Grain Size Distribution of Silty Sand to Sandy Silt Deposit.....	7
Table 4.3:	Atterberg Limits of Sandy Gravel Clayey Silt Till	7
Table 4.4:	Measured Groundwater Levels in Monitoring Wells	8
Table 4.5:	Results of Guelph Permeameter Tests.....	8
Table 4.6:	Results of Corrosivity Tests	10

APPENDICES

APPENDIX A

- Record of Borehole Sheets (Golder)
- Geotechnical Laboratory Test Results (Golder)
- Certificate of Analysis Report – Corrosivity Test Results (Golder)

APPENDIX B

- Borehole Locations and Soil Strata (Thurber)
- Record of Borehole Sheets (Thurber)
- Test Pit Logs (Thurber)
- Geotechnical Laboratory Test Results (Thurber)
- Certificate of Analysis Report – Corrosivity Test Results (SGS for Thurber)
- Site Photographs (Thurber)

APPENDIX C

- Hydrogeological Test Results

PART A – FACTUAL INFORMATION

1. INTRODUCTION

This report presents the data obtained from a foundation investigation carried out by Thurber Engineering Ltd (Thurber) near the proposed maintenance patrol yard, west of Fenelon Falls, in Kawartha Lakes, Ontario.

The purpose of this investigation was to explore the subsurface conditions at the proposed maintenance patrol yard and, based on the data obtained, to provide a borehole location plan, record of borehole, laboratory test results, and a written description of the subsurface conditions.

Thurber carried out the investigation as a subconsultant to Dillon Consulting Limited (Dillon), under the Ministry of Transportation, Ontario (MTO) Assignment No. 4021-E-0018.

It is a condition of this report that Thurber's performance of its professional services is subject to the attached Statement of Limitations and Conditions.

2. SITE DESCRIPTION

The proposed maintenance patrol yard is located on Glenarm Road approximately 800 m west of the intersection of Highway 35 and Glenarm Road in Kawartha Lakes, Ontario. The site and the surrounding area are agricultural lands, with an active sand and gravel pit on the southwest side of the intersection of Highway 35 and Glenarm Road.

The ground surface across the existing site is generally flat, varying between Elevation 270 m and Elevation 273 m from west to east.

3. INVESTIGATION PROCEDURES

3.1 2021 Investigation (GEOCRES No. 31D-775)

In April 2021, a foundation investigation was carried out by Golder Associates Ltd. (Golder), during which time a total of seven boreholes were advanced, designated Boreholes 21-1 to 21-5A, 21-5B, and 21-5C). the results of this investigation are contained in the report titled, "Foundation Investigation and Design Report, Highway 35 Patrol Yard, Kawartha Lakes, Ontario, MTO Assignment No. 4017-E-0023, G.W.P. 4071-19-00.', dated July 8, 2021 (GEOCRES No. 31D-775).

The location of boreholes, ground surface elevation, and depth of boreholes are summarized in Table 3.1. These boreholes are shown on Drawing 1 and the record of boreholes and figures for laboratory test results are presented in Appendix A.

Table 3.1: 2021 Foundation Investigation (by Others)

Borehole	Northing (Latitude, °)	Easting (Longitude, °)	Ground Surface Elevation (m)	Depth of Borehole (m)
21-1	4,931,350.2 (44.519981)	360,989.0 (-78.793174)	271.2	9.8
21-2	4,931,324.6 (44.519748)	361,026.0 (-78.792711)	269.7	9.8
21-3	4,931,362.3 (44.520084)	361,060.8 (-78.792270)	271.0	9.4
21-4	4,931,361.4 (44.520075)	361,089.6 (-78.791908)	271.0	9.3
21-5A	4,931,383.2 (44.520265)	361,154.4 (-78.791091)	272.5	3.8
21-5B	4,931,382.3 (44.520258)	361,152.1 (-78.791119)	272.4	2.1
21-5C	4,931,381.4 (44.520250)	361,150.2 (-78.791143)	272.4	9.7

3.2 Current Investigation

The foundation and hydrogeology investigation were carried out between May 30 and June 8, 2023, consisting of nine boreholes and one test pit.

The Record of Borehole and Test Pit sheets are included in Appendix B.

The borehole and test pit locations and elevations were surveyed using a Trimble R12 GPS Unit. In accordance with the requirements for surveying of foundation boreholes, the survey readings have a vertical and horizontal accuracy of 0.1 m and 0.5 m, respectively. The locations of the boreholes and test pit as presented on the record of boreholes and test pit, and as shown on Drawing 1 in Appendix B, are positioned relative to coordinate system MTM NAD 83, Zone 10. The geographic coordinates, ground surface elevations and depths of boreholes/test pit prior to termination is summarized in Table 3.2. Site photographs showing site features, borehole drilling and test-pitting are provided in Appendix B.

Table 3.2: 2023 Foundation Investigation

Borehole/Test Pit	MTM Northing (Latitude, °)	MTM Easting (Longitude, °)	Ground Surface Elevation (m)	Depth of Borehole/Test Pit (m)
FST-01	4,931,408.7 (44.520494)	361,060.5 (-78.792266)	263.8	8.2
MSB-01	4,931,324.2 (44.519738)	361,007.0 (-78.792948)	257.4	12.8
MSB-02	4,931,368.0 (44.520129)	361,029.4 (-78.792661)	258.5	12.8
SEP-01	4,931,332.1 (44.519799)	361,133.4 (-78.791357)	266.0	5.2
SWMP-01	4,931,286.4 (44.519396)	361,012.5 (-78.792883)	263.2	6.7
SWMP-02	4,931,303.1 (44.519542)	361,068.2 (-78.79218)	262.9	6.7
SWMP-03	4,931,253.9 (44.519101)	361,059.0 (-78.792301)	263.3	6.7
VMG-01	4,931,374.7 (44.520184)	361,101.4 (-78.791755)	258.4	12.8
VMG-02	4,931,406.6 (44.52047)	361,119.1 (-78.791529)	259.6	12.8
TP-01	4,931,294 (44.51946)	361,035 (-78.792598)	270.4	2.0

Boreholes were advanced using a track-mounted CME-75 drill rig, which was supplied and operated by Drilltech Drill Limited of Newmarket, Ontario, using 150 mm outside diameter solid stem augers. Soil samples were obtained at selected intervals using a split-spoon sampler driven by automatic hammers in general accordance with ASTM D1586 Standard Penetration Testing (SPT) procedures. The maximum particle size that can be sampled from the standard split-spoon hammer used in the investigation is limited to 35 mm and therefore, particles that may exist within the soils larger than this dimension would not be recovered or represented in the grain size analyses.

Monitoring wells were installed in Boreholes FST-01 and SWMP-02. Each well consists of a 32 mm inside diameter Schedule 40 PVC pipe with a 3 m long slotted screen, enclosed in a column of filtered sand to permit the monitoring of groundwater level and infiltration testing. The bottom of each well was sealed with a well cap. Well installation details, groundwater level readings are shown on the record of borehole sheets.

For boreholes without monitoring well installations, each borehole was abandoned in accordance with O.Reg. 903 (as amended) by means of backfilling with bentonite.

Infiltration testing was carried out in the monitoring wells installed in Boreholes FST-01 and SWMP-02, which were screened across a native sand to silt deposit. Both wells were dry at the time of the tests and therefore, distilled water was introduced into the wells. During the tests, both electronic measurements from the datalogger and manual measurements were recorded until the water level in the wells dropped to the well bottom. The electronic and manual measurements were then compared for quality control.

The test pitting was carried out using a B95 Backhoe Loader, which was supplied and operated by Young's Construction Limited of Fenelon Falls, Ontario. Guelph permeameter testing was carried out in hand augered boreholes through the bottom of the test pit excavated to depths of 0.5 m and 2.0 m below existing ground surface. Upon completion of the testing, the test pit was backfilled with the excavated native sands and silts.

Percolation (T-time) tests were carried out in the proposed septic field area near Borehole SEP-01. The tests were carried out in shallow holes that were approximately 15 cm in diameter and 20 cm in depth. The bottom and sides of the pits were scarified with a knife blade to remove any smeared soil surfaces and loose materials to provide a natural soil interface. Prior to performing the tests, the shallow holes were soaked for approximately 30 minutes with distilled water to the top of the hole and readjusted the water level as needed. After the soaking process, the holes were refilled with water to a depth of approximately 15 cm above the bottom. A meter stick was placed in each hole at a fixed reference point to record water level throughout the testing period. During the tests, the water level was readjusted to the initial height when needed.

The investigation was supervised by members of our technical staff, who located the boreholes and test pit, arranged for the clearance of underground services, observed the drilling, sampling, and in situ testing operations, logged the boreholes and test pit, and examined and cared for the soil samples. The samples identified in the field were placed in appropriate containers, labelled, and transported to our Pickering geotechnical laboratory where the samples underwent further visual examination and laboratory testing. All laboratory tests were carried out to MTO and/or ASTM standards, as appropriate.

4. SITE GEOLOGY AND SUBSURFACE CONDITIONS

4.1 Regional Geology

In general, the site is located within the physiographic region of Peterborough Drumlin Field as delineated in the Physiography of Southern Ontario (Chapman and Putnam, 1984). The Peterborough Drumlin Field extends from Hasting County Simcoe County and includes drumlins south of the moraine in Northumberland County. This region contains numerous drumlins and drumlinoid hills and is underlain by limestone bedrock of the Lindsay and Verulam Formations.

More specifically, the site is located within an esker containing stratified deposits of sands and gravel. This esker is oriented from the northeast to the southwest, which compasses the sand and gravel pit located just east of the site.

4.2 General Description of Subsurface Conditions

Details of the soil stratigraphy as encountered in the current investigation are presented on the Record of Borehole sheets included in Appendices A and B. A general description of the stratigraphy, based on the conditions encountered in the boreholes, is given in the following sections. However, the factual data presented on the Record of Borehole sheets takes precedence over this general description for interpretation of the site conditions. Soil classification is in accordance with ASTM D2487. Description of cohesive soils and secondary components are described as outlined in the MTO Guideline for Foundation Services Manual (April 2022).

The results of in-situ testing as presented in the record of boreholes and in this section are uncorrected. The boundaries between soil deposits on the record of boreholes have been inferred from non-continuous sampling, observation of the progress of drilling, and the results of Standard Penetration Testing. Therefore, the boundaries represent the transitions between soil deposits rather than exact planes of geological change. Variation on the stratigraphic boundaries between and beyond boreholes will exist and is to be expected.

In general, the subsurface conditions consist of a surficial layer of silty sand to silt and sand fill, which is in turn underlain by a native deposit of silty sand to sandy silt containing layers of sand and gravel to sand.

4.3 Fill

Fill consisting of silty sand to silt and sand (i.e., reworked native soils), was encountered at ground surface at all borehole locations. The depth of fill varies from 0.3 m to 2.2 m below ground surface (Elevations 272.1 m to 268.2 m) but in general, the depth of fill ranges between 1.4 m and 1.5 m below ground surface (Elevations 271.1 m to 268.2 m).

The SPT N-values measured within the fill ranged from 2 blows to 15 blows per 0.3 m of penetration, indicating a very loose to compact condition.

The moisture content of the silty sand to silt and sand fill ranged from 4 per cent to 21 per cent. The results of grain analysis carried out on samples of the fill are presented in Figure B-1 in Appendix A and Figure B-1 in Appendix B. The results of the tests are summarized in Table 4.1 and on the Record of Boreholes sheets in Appendices A and B.

Table 4.1: Grain Size Distribution of Silty Sand to Silt and Sand Fill

Soil Particle	Percentage (%)
Gravel	0 to 2
Sand	40 to 79
Silt	20 to 57
Clay	0 to 8

4.4 Silty Sand to Sandy Silt

A native deposit of silty sand to sandy silt containing trace to some gravel was encountered at all borehole locations, which extends to a depth of up to 12.8 m below ground surface (Elevation 257.4 m). Within the silty sand to sandy silt, an interlayer of sand and gravel to gravelly silty sand between 5.7 m and 9.8 m thick was encountered in Boreholes 21-5A to 21-5C, and VMG-02. Except for Borehole 21-1, all boreholes were terminated within this deposit.

The SPT N-values measured within the cohesionless deposit ranged from 2 blows per 0.3 m of penetration to 100 blows per 0.07 m of penetration, indicating a very loose to very dense condition.

The moisture content of the silty sand to sandy silt ranged from 1 per cent to 28 per cent. The results of grain analysis carried out on samples of the silty sand to sandy silt as well as interlayer

of sand, and sand and gravel to gravelly silty sand are presented in Figures B-2 and B-4 in Appendix A and Figures B-2 to B-5 in Appendix B.

The results of the tests are summarized in Table 4.2, and presented on the Record of Boreholes sheets in Appendices A and B.

Table 4.2: Grain Size Distribution of Silty Sand to Sandy Silt Deposit

Soil Particle	Silty Sand to Sandy Silt Percentage (%)	Sand Percentage (%)	Sand and Gravel to Gravelly Silty Sand Percentage (%)
Gravel	0 to 16	0 to 2	28 to 39
Sand	23 to 86	88 to 91	48 to 61
Silt	9 to 76	7 to 10	7 to 15
Clay	0 to 8	0 to 4	0 to 5

It should be noted that Atterberg limits tests were carried out on samples of the silty sand to sandy silt from Boreholes MSB-02, SWMP-03, VMG-01, but the results indicate that the material is non-plastic.

4.5 Sandy Gravel Clayey Silt Till

A 0.3 m thick till deposit consisting of sandy gravel clayey silt was encountered beneath the silty sand deposit in Borehole 21-2. Borehole 21-2 was terminated in this deposit.

The SPT N-value measured within the till deposit is 72 blows per 0.3 m of penetration, indicating a hard consistency.

The result of Atterberg limits tests carried out on the sample of the till deposit is presented on Figure B-5 in Appendix A and is summarized in Table 4.3.

Table 4.3: Atterberg Limits of Sandy Gravel Clayey Silt Till

Parameter	Value
Liquid Limit	15
Plastic Limit	10
Plasticity index	5

The results indicate that the material is a clayey silt of low plasticity (CL-ML).

4.6 Groundwater Conditions

Details of the water level observed in the monitoring wells installation as part of the current investigation are presented on the record of boreholes in Appendices A and B and summarized in Table 4.4.

Table 4.4: Measured Groundwater Levels in Monitoring Wells

Borehole	Date of Reading	Depth and Elevation of Groundwater (m)	Remarks
21-4	2021-04-28 2021-06-24	Dry at 9.3 / 261.7	Monitoring wells were dry.
FST-01	2023-06-08	Dry at 8.2 / 263.8	
VMS-02	2023-06-08	Dry at 6.7 / 262.9	

It should be noted that the groundwater level is subject to seasonal fluctuations and should be expected to be higher elevation after periods of significant or prolonged precipitation.

4.7 Hydrogeological Testing

4.7.1 Guelph Permeameter Tests in the Stormwater Management Pond Area

The Guelph Permeameter tests were carried out in hand augered boreholes advanced at the bottom of the test pit. At each depth interval, two 75 mm diameter boreholes were augered at approximately 1.5 m apart. In each test hole, two sets of readings were obtained using the combined reservoirs method. The two sets of readings were processed using the single head method. The average of the two single head test results were reported as the field saturated hydraulic conductivity (K_{fs}) at the subject test hole location.

The Guelph Permeameter calculation sheets are presented in Appendix C. A summary of the test results is presented in Table 4.5.

Table 4.5: Results of Guelph Permeameter Tests

Test Depth	Test 1	Test 2	Average
0.7 m ⁽¹⁾	1.2×10^{-5} m/s	3.0×10^{-6} m/s	7.7×10^{-6} m/s
2.4 m ⁽²⁾	1.0×10^{-4} m/s	2.7×10^{-5} m/s	6.3×10^{-5} m/s

1. Test conducted in a 0.2 m deep borehole advanced through the base of a 0.5 m deep test pit.
2. Test conducted in a 0.4 m deep borehole advanced through the base of a 2 m deep test pit.

4.7.2 Percolation (T-time) Tests – Septic Field Area

Two percolation tests were carried out in two shallow holes approximately 1.5 m apart. Each test continued for approximately 70 to 75 minutes and during which time, water was introduced four times to near the top of the shallow holes. The time it took for the water level to drop by one centimeter (i.e., T-time) varied between 1.0 and 1.7 minutes for one test, and between 2.4 and 3.1 minutes for the other.

4.7.3 Borehole Infiltration Tests – Dry monitoring wells

Borehole infiltration tests were carried out in each dry monitoring well. The monitoring wells installed in Boreholes FST-01 and SWMP-02 were dry and as such, a total of 18 L and 24 L of distilled water was introduced into wells in Boreholes FST-01 and SWMP-02, respectively, for the purpose of the infiltration tests. Due to the high rate of infiltration, the highest recorded water level was approximately 0.8 m above the bottom in each well, which was observed to dropped to the bottom of the well in approximately 1.5 minutes. A water level-time plot for each test is included in Appendix C.

In addition, the data were also analyzed as a slug test using the Hvorslev method. Although the assumption that the surrounding soil is saturated is not valid as a result of the wells being dry, the results were in the order of 10^{-5} m/s, which are in general agreement with Guelph Permeameter results.

4.8 Analytical Laboratory Testing

Samples of the native silty sand to sandy silt was submitted for analytical testing for corrosivity analysis and sulphide content. The analytical test results for the soils are presented in Appendices A and B and summarized in Table 4.6.



Table 4.6: Results of Corrosivity Tests

Borehole / Sample	Depth / Elevation (m)	Resistivity (ohm-cm)	Electrical Conductivity ($\mu\text{S}/\text{cm}$)	Soluble Sulphate Content ($\mu\text{g}/\text{g}$)	Chloride Content ($\mu\text{g}/\text{g}$)	pH
21-2 SS2	1.1 / 268.8	11,000	88	<20	<20	7.9
21-3 SS4	2.6 / 268.4	13,000	76	<20	<20	7.8
21-5C SS4	2.6 / 269.8	7,200	138	<20	<20	5.8
VMG-02 SS3	1.9 / 270.5	20,800	48	< 0.4	1.1	8.82
MSB-02 SS2	1.0 / 270.3	83,300	12	< 0.4	0.6	7.87



THURBER ENGINEERING LTD.

5. MISCELLANEOUS

The foundation and hydrogeology investigation were supervised on a full-time basis by Vihang Patel, EIT, and Klayton Irvine, EIT, respectively. The Foundation Investigation Report was prepared by Ms. Yidan (Eda) Cui, P.Eng., and Messrs. Ali Rajaei, P. Eng. and Christopher Ng, P.Eng. The report was reviewed by Messrs. and David Hill, P.Geo., P.Eng., Senior Hydrogeological Engineer, and Jason Lee, P.Eng., a Designated Principal Contact for MTO Foundations Projects.

Ali Rajaei, P.Eng.,
Geotechnical Engineer



Christopher Ng, P.Eng.,
Senior Geotechnical Engineer



Jason Lee, P.Eng.,
Review Principal,
Designated MTO Contact

Date: **October 12, 2023**

File: **36708**



STATEMENT OF LIMITATIONS AND CONDITIONS

1. STANDARD OF CARE

This Report has been prepared in accordance with generally accepted engineering or environmental consulting practices in the applicable jurisdiction. No other warranty, expressed or implied, is intended or made.

2. COMPLETE REPORT

All documents, records, data and files, whether electronic or otherwise, generated as part of this assignment are a part of the Report, which is of a summary nature and is not intended to stand alone without reference to the instructions given to Thurber by the Client, communications between Thurber and the Client, and any other reports, proposals or documents prepared by Thurber for the Client relative to the specific site described herein, all of which together constitute the Report.

IN ORDER TO PROPERLY UNDERSTAND THE SUGGESTIONS, RECOMMENDATIONS AND OPINIONS EXPRESSED HEREIN, REFERENCE MUST BE MADE TO THE WHOLE OF THE REPORT. THURBER IS NOT RESPONSIBLE FOR USE BY ANY PARTY OF PORTIONS OF THE REPORT WITHOUT REFERENCE TO THE WHOLE REPORT.

3. BASIS OF REPORT

The Report has been prepared for the specific site, development, design objectives and purposes that were described to Thurber by the Client. The applicability and reliability of any of the findings, recommendations, suggestions, or opinions expressed in the Report, subject to the limitations provided herein, are only valid to the extent that the Report expressly addresses proposed development, design objectives and purposes, and then only to the extent that there has been no material alteration to or variation from any of the said descriptions provided to Thurber, unless Thurber is specifically requested by the Client to review and revise the Report in light of such alteration or variation.

4. USE OF THE REPORT

The information and opinions expressed in the Report, or any document forming part of the Report, are for the sole benefit of the Client. NO OTHER PARTY MAY USE OR RELY UPON THE REPORT OR ANY PORTION THEREOF WITHOUT THURBER'S WRITTEN CONSENT AND SUCH USE SHALL BE ON SUCH TERMS AND CONDITIONS AS THURBER MAY EXPRESSLY APPROVE. Ownership in and copyright for the contents of the Report belong to Thurber. Any use which a third party makes of the Report, is the sole responsibility of such third party. Thurber accepts no responsibility whatsoever for damages suffered by any third party resulting from use of the Report without Thurber's express written permission.

5. INTERPRETATION OF THE REPORT

- a) Nature and Exactness of Soil and Contaminant Description: Classification and identification of soils, rocks, geological units, contaminant materials and quantities have been based on investigations performed in accordance with the standards set out in Paragraph 1. Classification and identification of these factors are judgmental in nature. Comprehensive sampling and testing programs implemented with the appropriate equipment by experienced personnel may fail to locate some conditions. All investigations utilizing the standards of Paragraph 1 will involve an inherent risk that some conditions will not be detected and all documents or records summarizing such investigations will be based on assumptions of what exists between the actual points sampled. Actual conditions may vary significantly between the points investigated and the Client and all other persons making use of such documents or records with our express written consent should be aware of this risk and the Report is delivered subject to the express condition that such risk is accepted by the Client and such other persons. Some conditions are subject to change over time and those making use of the Report should be aware of this possibility and understand that the Report only presents the conditions at the sampled points at the time of sampling. If special concerns exist, or the Client has special considerations or requirements, the Client should disclose them so that additional or special investigations may be undertaken which would not otherwise be within the scope of investigations made for the purposes of the Report.
- b) Reliance on Provided Information: The evaluation and conclusions contained in the Report have been prepared on the basis of conditions in evidence at the time of site inspections and on the basis of information provided to Thurber. Thurber has relied in good faith upon representations, information and instructions provided by the Client and others concerning the site. Accordingly, Thurber does not accept responsibility for any deficiency, misstatement or inaccuracy contained in the Report as a result of misstatements, omissions, misrepresentations, or fraudulent acts of the Client or other persons providing information relied on by Thurber. Thurber is entitled to rely on such representations, information and instructions and is not required to carry out investigations to determine the truth or accuracy of such representations, information and instructions.
- c) Design Services: The Report may form part of design and construction documents for information purposes even though it may have been issued prior to final design being completed. Thurber should be retained to review final design, project plans and related documents prior to construction to confirm that they are consistent with the intent of the Report. Any differences that may exist between the Report's recommendations and the final design detailed in the contract documents should be reported to Thurber immediately so that Thurber can address potential conflicts.
- d) Construction Services: During construction Thurber should be retained to provide field reviews. Field reviews consist of performing sufficient and timely observations of encountered conditions in order to confirm and document that the site conditions do not materially differ from those interpreted conditions considered in the preparation of the report. Adequate field reviews are necessary for Thurber to provide letters of assurance, in accordance with the requirements of many regulatory authorities.

6. RELEASE OF POLLUTANTS OR HAZARDOUS SUBSTANCES

Geotechnical engineering and environmental consulting projects often have the potential to encounter pollutants or hazardous substances and the potential to cause the escape, release or dispersal of those substances. Thurber shall have no liability to the Client under any circumstances, for the escape, release or dispersal of pollutants or hazardous substances, unless such pollutants or hazardous substances have been specifically and accurately identified to Thurber by the Client prior to the commencement of Thurber's professional services.

7. INDEPENDENT JUDGEMENTS OF CLIENT

The information, interpretations and conclusions in the Report are based on Thurber's interpretation of conditions revealed through limited investigation conducted within a defined scope of services. Thurber does not accept responsibility for independent conclusions, interpretations, interpolations and/or decisions of the Client, or others who may come into possession of the Report, or any part thereof, which may be based on information contained in the Report. This restriction of liability includes but is not limited to decisions made to develop, purchase or sell land.

APPENDIX A

- Record of Borehole Sheets (Golder)
- Geotechnical Laboratory Test Results (Golder)
- Certificate of Analysis Report – Corrosivity Test Results (Golder)

ABBREVIATIONS AND TERMS USED ON RECORDS OF BOREHOLES AND TEST PITS MINISTRY OF TRANSPORTATION, ONTARIO

PARTICLE SIZES OF CONSTITUENTS

Soil Constituent	Particle Size Description	Millimetres	Inches (US Std. Sieve Size)
BOULDERS	Not Applicable	>200	>8
COBBLES	Not Applicable	75 to 200	3 to 8
GRAVEL	Coarse	19 to 75	0.75 to 3
	Fine	4.75 to 19	(4) to 0.75
SAND	Coarse	2.00 to 4.75	(10) to (4)
	Medium	0.425 to 2.00	(40) to (10)
	Fine	0.075 to 0.425	(200) to (40)
FINES	Classified by plasticity	<0.075	< (200)

MODIFIERS FOR SECONDARY COMPONENTS^{1,2}

Percentage by Mass	Modifier
> 35	Use 'and' to combine primary and secondary component (<i>i.e.</i> , SAND and gravel)
> 20 to 35	Primary soil name prefixed with "gravelly, sandy" as applicable
> 10 to 20	some (<i>i.e.</i> , some sand)
≤ 10	trace (<i>i.e.</i> , trace fines)

- Only applicable to components not described by Primary Group Name.
- Classification of Primary Group Name based on Unified Soil Classification System (ASTM D2487) for coarse-grained soils; fine-grained soils described per current MTO Soil Classification System.

PENETRATION RESISTANCE

Standard Penetration Resistance (SPT), N:

The number of blows by a 63.5 kg (140 lb) hammer dropped 760 mm (30 in.) required to drive a 50 mm (2 in.) split-spoon sampler for a distance of 300 mm (12 in.). Values reported are as recorded in the field and are uncorrected.

Cone Penetration Test (CPT)

An electronic cone penetrometer with a 60° conical tip and a project end area of 10 cm² pushed through ground at a penetration rate of 2 cm/s. Measurements of tip resistance (*q_t*), porewater pressure (*u*) and sleeve friction (*f_s*) are recorded electronically at 25 mm penetration intervals.

Dynamic Cone Penetration Resistance (DCPT); N_d:

The number of blows by a 63.5 kg (140 lb) hammer dropped 760 mm (30 in.) to drive uncased a 50 mm (2 in.) diameter, 60° cone attached to "A" size drill rods for a distance of 300 mm (12 in.).

- PH:** Sampler advanced by hydraulic pressure
PM: Sampler advanced by manual pressure
WH: Sampler advanced by static weight of hammer
WR: Sampler advanced by weight of sampler and rod

SAMPLES

AS	Auger sample
BS	Block sample
CS	Chunk sample
DD	Diamond Drilling
DO or DP	Seamless open ended, driven or pushed tube sampler – note size
DS	Denison type sample
GS	Grab Sample
MC	Modified California Samples
MS	Modified Shelby (for frozen soil)
RC / SC	Rock core / Soil core
SS	Split spoon sampler – note size
ST	Slotted tube
TO	Thin-walled, open – note size (Shelby tube)
TP	Thin-walled, piston – note size (Shelby tube)
WS	Wash sample
OD / ID	Outer Diameter / Inner Diameter
HSA / SSA	Hollow-Stem Augers / Solid-Stem Augers

SOIL TESTS

w	water content
PL, w _p	plastic limit
LL, w _L	liquid limit
C	consolidation (oedometer) test
CHEM	chemical analysis (refer to text)
CID	consolidated isotropically drained triaxial test ¹
CIU	consolidated isotropically undrained triaxial test with porewater pressure measurement ¹
D _R	relative density (specific gravity, G _s)
DS	direct shear test
GS	specific gravity
M	sieve analysis for particle size
MH	combined sieve and hydrometer (H) analysis
MPC	Modified Proctor compaction test
SPC	Standard Proctor compaction test
OC	organic content test
SO ₄	concentration of water-soluble sulphates
UC	unconfined compression test
UU	unconsolidated undrained triaxial test
V (FV)	field vane (LV-laboratory vane test)
Y	unit weight

- Tests anisotropically consolidated prior to shear are shown as CAD, CAU.

COARSE-GRAINED SOILS

Compactness¹

Term	SPT 'N' (blows/0.3m) ²
Very Loose	0 to 4
Loose	4 to 10
Compact	10 to 30
Dense	30 to 50
Very Dense	> 50

- Definition of compactness terms are based on SPT 'N' ranges as provided in Terzaghi, Peck and Mesri (1996). Many factors affect the recorded SPT 'N' value, including hammer efficiency (which may be greater than 60% in automatic trip hammers), overburden pressure, groundwater conditions, and grain size. As such, the recorded SPT 'N' value(s) should be considered only an approximate guide to the soil compactness. These factors need to be considered when evaluating the results, and the stated compactness terms should not be relied upon for design or construction.
- SPT 'N' in accordance with ASTM D1586, uncorrected for the effects of overburden pressure.

FINE-GRAINED SOILS

Consistency

Term	Undrained Shear Strength (kPa)	SPT 'N' ^{1,2} (blows/0.3m)
Very Soft	< 12	0 to 2
Soft	12 to 25	2 to 4
Firm	25 to 50	4 to 8
Stiff	50 to 100	8 to 15
Very Stiff	100 to 200	15 to 30
Hard	> 200	> 30

- SPT 'N' in accordance with ASTM D1586, uncorrected for overburden pressure effects; approximate only.
- SPT 'N' values should be considered ONLY an approximate guide to consistency; for sensitive clays (e.g., Champlain Sea clays), the N-value approximation for consistency terms does NOT apply. Rely on direct measurement of undrained shear strength or other manual observations.

Field Moisture Condition

Term	Description
Dry	Soil flows freely through fingers.
Moist	Soils are darker than in the dry condition and may feel cool.
Wet	As moist, but with free water forming on hands when handled.

PROJECT <u>1786659 (13000)</u>	RECORD OF BOREHOLE No 21-1	SHEET 1 OF 1	METRIC
G.W.P. <u>4071-19-00</u>	LOCATION <u>N 4931350.2; E 360989.0 MTM NAD_ZONE (LAT. 44.519981; LONG. -78.793174)</u>	ORIGINATED BY <u>SC</u>	
DIST <u>Eastern</u> HWY <u>35</u>	BOREHOLE TYPE <u>Power Auger; 100 mm O.D. Solid Stem Augers</u>	COMPILED BY <u>MB</u>	
DATUM <u>HT 2 (Goedetic)</u>	DATE <u>April 29, 2021</u>	CHECKED BY <u>AMP</u>	

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)									
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa									WATER CONTENT (%)								
						20	40	60	80	100	20	40	60	80	100	10	20	30		GR	SA	SI	CL		
271.2	GROUND SURFACE																								
0.0	SILTY SAND (SM), trace rootlets and organics (FILL)		1A	SS	3																				
270.7	Very loose Dark brown Moist		1B																						
0.5	SILTY SAND (SM) Very loose to very dense Brown, oxidation staining to a depth of 2.2 m Moist		2	SS	4																				
			3	SS	7																				
			4	SS	4																				
			5	SS	20																				
			6	SS	21																				
			7	SS	30																				
			8	SS	22																				
			9	SS	40																				
		10	SS	86																					
261.5	END OF BOREHOLE																								
9.8	NOTE: 1. Borehole open and dry upon completion of drilling.																								

GTA-MTO 001 S:\CLIENTS\MT\TOHWY_35_PATROL_YARD\02_DATA\GINT\HWY_35_PATROL_YARD.GPJ GAL-GTA.GDT 6/16/21

PROJECT 1786659 (13000)	RECORD OF BOREHOLE No 21-2	SHEET 1 OF 1	METRIC
G.W.P. 4071-19-00	LOCATION N 4931324.6; E 361026.0 MTM NAD_ZONE (LAT. 44.519748; LONG. -78.792711)	ORIGINATED BY SC	
DIST Eastern HWY 35	BOREHOLE TYPE Power Auger; 100 mm O.D. Solid Stem Augers	COMPILED BY MB	
DATUM HT_2 (Goedetic)	DATE April 28, 2021	CHECKED BY AMP	

ELEV DEPTH	SOIL PROFILE DESCRIPTION	STRAT PLOT	SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ kN/m ³	REMARKS & GRAIN SIZE DISTRIBUTION (%) GR SA SI CL
			NUMBER	TYPE	"N" VALUES			SHEAR STRENGTH kPa									
							20	40	60	80	100						
							○ UNCONFINED + FIELD VANE ● QUICK TRIAXIAL × REMOULDED					WATER CONTENT (%)					
							20	40	60	80	100	10	20	30			
269.7	GROUND SURFACE																
0.0	SILTY SAND (SM), trace rootlets and organics (FILL)		1A	SS	3												
269.2	Very loose Dark brown Moist		1B														
0.5	SAND (SP-SM), trace silt, trace clay		2	SS	4												
	Very loose to dense Brown, oxidation staining to a depth of 3.0 m Moist		3	SS	8												
			4	SS	21												
			5	SS	23												
			6	SS	21											0 89 7 4	
			7	SS	34												
264.1	SILTY SAND (SM), some gravel Dense to very dense Brown Moist		8	SS	43											16 68 12 4	
5.6			9	SS	71												
	- Auger grinding from a depth of 8.5 m to 8.8 m		10A														
260.2	Sandy gravelly CLAYEY SILT-SILT (CL-ML) (TILL)		10B	SS	72												
9.8	Hard Brown Moist END OF BOREHOLE																
	NOTE: 1. Borehole open and dry upon completion of drilling.																

GTA-MTO 001 S:\CLIENTS\MT01HWY_35_PATROL_YARD\02_DATA\02_PATROL_YARD\GPI_GAL-GTA.GDT 6/16/21

+³, ×³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

PROJECT <u>1786659 (13000)</u>	RECORD OF BOREHOLE No 21-3	SHEET 1 OF 1	METRIC
G.W.P. <u>4071-19-00</u>	LOCATION <u>N 4931362.3; E 361060.8 MTM NAD_ZONE (LAT. 44.520084; LONG. -78.792270)</u>	ORIGINATED BY <u>SC</u>	
DIST <u>Eastern</u> HWY <u>35</u>	BOREHOLE TYPE <u>Power Auger; 100 mm O.D. Solid Stem Augers</u>	COMPILED BY <u>MB</u>	
DATUM <u>HT 2 (Goedetic)</u>	DATE <u>April 28, 2021</u>	CHECKED BY <u>AMP</u>	

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)							
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa									WATER CONTENT (%)						
						20	40	60	80	100	20	40	60	80	100	10	20	30	GR	SA	SI	CL	
271.0	GROUND SURFACE																						
0.0	SILTY SAND (SM), trace rootlets and organics to a depth of 0.4 m (FILL) Very loose to loose Dark brown Moist to wet		1A	SS	3																		
			1B																				
			2	SS	7																		2 49 41 8
			3	SS	4																		
268.8																							
2.2	SAND (SP-SM) to SILTY SAND (SM) Compact to dense Brown Moist		4	SS	12																		0 88 7 5
			5	SS	15																		
			6	SS	24																		
			7	SS	15																		
			8	SS	37																		
263.8																							
7.2	Gravelly SILTY SAND (SM) Very dense Brown Moist		9	SS	100/0.15																		28 52 15 5
261.6																							
9.4	END OF BOREHOLE		10	SS	100/0.07																		
	NOTE: 1. Borehole open and dry upon completion of drilling.																						

GTA-MTO 001 S:\CLIENTS\MT\TOHWY_35_PATROL_YARD\02_DATA\GINT\HWY_35_PATROL_YARD.GPJ GAL-GTA.GDT 6/16/21

+³, X³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

PROJECT 1786659 (13000)	RECORD OF BOREHOLE No 21-4	SHEET 1 OF 1	METRIC
G.W.P. 4071-19-00	LOCATION N 4931361.4; E 361089.6 MTM NAD_ZONE (LAT. 44.520075; LONG. -78.791908)	ORIGINATED BY SC	
DIST Eastern HWY 35	BOREHOLE TYPE Power Auger; 200 mm O.D. Hollow Stem Augers	COMPILED BY MB	
DATUM HT_2 (Goedetic)	DATE April 28, 2021	CHECKED BY AMP	

ELEV DEPTH	SOIL PROFILE DESCRIPTION	STRAT PLOT	SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ kN/m ³	REMARKS & GRAIN SIZE DISTRIBUTION (%) GR SA SI CL
			NUMBER	TYPE	"N" VALUES			SHEAR STRENGTH kPa									
							20 40 60 80 100	○ UNCONFINED	+ FIELD VANE								
							20 40 60 80 100	● QUICK TRIAXIAL	× REMOULDED								
271.0	GROUND SURFACE																
0.0	SILT (ML) and sand (FILL) Loose Brown Moist		1	SS	5												
			2	SS	6												
269.6																	
1.5	SILT (ML) and sand Loose Brown Moist		3	SS	4												0 47 50 3
268.8																	
2.2	SAND (SW-SM), trace silt, trace gravel Compact Brown Dry		4	SS	19												2 88 8 2
			5	SS	30												
			6	SS	15												
			7	SS	24												
			8	SS	29												
			9	SS	30												
262.5																	
8.5	Gravelly SILTY SAND (SM) Very dense Brown Moist		10	SS	50/0.15												
261.7																	
9.3	END OF BOREHOLE																
	NOTE: 1. Water not encountered during drilling. 2. Monitoring well dry upon completion of drilling.																

GTA-MTO 001 S:\CLIENTS\MT\TOHWY_35_PATROL_YARD\02_DATA\GINT\HWY_35_PATROL_YARD.GPJ GAL-GTA.GDT 6/16/21

+³, ×³: Numbers refer to Sensitivity ○ 3% STRAIN AT FAILURE

PROJECT <u>1786659 (13000)</u>	RECORD OF BOREHOLE No 21-5A	SHEET 1 OF 1	METRIC
G.W.P. <u>4071-19-00</u>	LOCATION <u>N 4931383.2; E 361154.4 MTM NAD ZONE (LAT. 44.520265; LONG. -78.791091)</u>	ORIGINATED BY <u>SC</u>	
DIST <u>Eastern</u> HWY <u>35</u>	BOREHOLE TYPE <u>Power Auger; 100 mm O.D. Solid Stem Augers</u>	COMPILED BY <u>MB</u>	
DATUM <u>HT 2 (Goedetic)</u>	DATE <u>April 29, 2021</u>	CHECKED BY <u>AMP</u>	

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)								
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20	40	60	80	100	10	20
272.5	GROUND SURFACE																							
0.0	Gravelly SILTY SAND (SM) (FILL) Loose Dark brown Moist		1	SS	4																			
271.8																								
0.7	Gravelly SILTY SAND (SM) Dense to very dense Brown Moist -Auger grinding below a depth of 0.8 m		2	SS	33																			31 52 14 3
268.7	END OF BOREHOLE																							
3.8	NOTE: 1. Borehole terminated due to caving. A separate borehole (Borehole 21-5B) was advanced using hollow-stem augers, adjacent to Borehole 21-5A. See Record of Borehole 21-5B.																							

GTA-MTO 001 S:\CLIENTS\MTOWHWY_35_PATROL_YARD\02_DATA\GINT\HWY_35_PATROL_YARD.GPJ GAL-GTA.GDT 6/16/21

PROJECT <u>1786659 (13000)</u>	RECORD OF BOREHOLE No 21-5B	SHEET 1 OF 1	METRIC
G.W.P. <u>4071-19-00</u>	LOCATION <u>N 4931382.3; E 361152.1 MTM NAD_ZONE (LAT. 44.520258; LONG. -78.791119)</u>	ORIGINATED BY <u>SC</u>	
DIST <u>Eastern</u> HWY <u>35</u>	BOREHOLE TYPE <u>Power Auger; 200 mm O.D. Hollow Stem Augers</u>	COMPILED BY <u>MB</u>	
DATUM <u>HT 2 (Goedetic)</u>	DATE <u>April 29, 2021</u>	CHECKED BY <u>AMP</u>	

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)								
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	20	40	60	80						100	20	40	60	80	100	10	20
272.4 0.0	GROUND SURFACE Stratigraphy inferred from Borehole 21-5A																							
271.7 0.7	- Auger grinding, difficult drilling below a depth of 1.2 m																							
270.3 2.1	AUGER REFUSAL END OF BOREHOLE NOTE: 1. Borehole terminated due to auger refusal. A third borehole attempt was made adjacent to Borehole 21-5B, see Record of Borehole 21-5C.																							

GTA-MTO 001 S:\CLIENTS\MTOWHWY_35_PATROL_YARD\02_DATA\GINT\HWY_35_PATROL_YARD.GPJ GAL-GTA.GDT 6/16/21



Your Project #: 1786659
 Site Location: HWY35
 Your C.O.C. #: 136465

Attention: Michael Bentley

Golder Associates Ltd
 100 Scotia Crt
 Whitby, ON
 CANADA L1N 8Y6

Report Date: 2021/05/12
 Report #: R6630743
 Version: 1 - Final

CERTIFICATE OF ANALYSIS

BV LABS JOB #: C1C2198

Received: 2021/05/06, 14:30

Sample Matrix: Soil
 # Samples Received: 3

Analyses	Quantity	Date	Date	Laboratory Method	Analytical Method
		Extracted	Analyzed		
Chloride (20:1 extract)	3	2021/05/10	2021/05/11	CAM SOP-00463	SM 23 4500-Cl E m
Conductivity	3	2021/05/11	2021/05/11	CAM SOP-00414	OMOE E3530 v1 m
pH CaCl2 EXTRACT	3	2021/05/10	2021/05/10	CAM SOP-00413	EPA 9045 D m
Resistivity of Soil	3	2021/05/07	2021/05/11	CAM SOP-00414	SM 23 2510 m
Sulphate (20:1 Extract)	3	2021/05/10	2021/05/11	CAM SOP-00464	EPA 375.4 m

Remarks:

Bureau Veritas is accredited to ISO/IEC 17025 for specific parameters on scopes of accreditation. Unless otherwise noted, procedures used by Bureau Veritas are based upon recognized Provincial, Federal or US method compendia such as CCME, MELCC, EPA, APHA.

All work recorded herein has been done in accordance with procedures and practices ordinarily exercised by professionals in Bureau Veritas' profession using accepted testing methodologies, quality assurance and quality control procedures (except where otherwise agreed by the client and Bureau Veritas in writing). All data is in statistical control and has met quality control and method performance criteria unless otherwise noted. All method blanks are reported; unless indicated otherwise, associated sample data are not blank corrected. Where applicable, unless otherwise noted, Measurement Uncertainty has not been accounted for when stating conformity to the referenced standard.

Bureau Veritas liability is limited to the actual cost of the requested analyses, unless otherwise agreed in writing. There is no other warranty expressed or implied. Bureau Veritas has been retained to provide analysis of samples provided by the Client using the testing methodology referenced in this report. Interpretation and use of test results are the sole responsibility of the Client and are not within the scope of services provided by Bureau Veritas, unless otherwise agreed in writing. Bureau Veritas is not responsible for the accuracy or any data impacts, that result from the information provided by the customer or their agent.

Solid sample results, except biota, are based on dry weight unless otherwise indicated. Organic analyses are not recovery corrected except for isotope dilution methods.

Results relate to samples tested. When sampling is not conducted by Bureau Veritas, results relate to the supplied samples tested.

This Certificate shall not be reproduced except in full, without the written approval of the laboratory.

Reference Method suffix "m" indicates test methods incorporate validated modifications from specific reference methods to improve performance.

* RPDs calculated using raw data. The rounding of final results may result in the apparent difference.



Your Project #: 1786659
Site Location: HWY35
Your C.O.C. #: 136465

Attention: Michael Bentley

Golder Associates Ltd
100 Scotia Crt
Whitby, ON
CANADA L1N 8Y6

Report Date: 2021/05/12
Report #: R6630743
Version: 1 - Final

CERTIFICATE OF ANALYSIS

BV LABS JOB #: C1C2198
Received: 2021/05/06, 14:30

Encryption Key

Please direct all questions regarding this Certificate of Analysis to your Project Manager.
Ema Gitej, Senior Project Manager
Email: emese.gitej@bureauveritas.com
Phone# (905)817-5829

=====
BV Labs has procedures in place to guard against improper use of the electronic signature and have the required "signatories", as per ISO/IEC 17025, signing the reports. For Service Group specific validation please refer to the Validation Signature Page.



SOIL CORROSIVITY PACKAGE (SOIL)

BV Labs ID		PMT538	PMT539	PMT540		
Sampling Date		2021/04/30 17:00	2021/04/28 17:00	2021/04/28 17:00		
COC Number		136465	136465	136465		
	UNITS	21-5C SA2	21-2 SA4	21-3 SA4	RDL	QC Batch
Calculated Parameters						
Resistivity	ohm-cm	7200	11000	13000		7340563
Inorganics						
Soluble (20:1) Chloride (Cl-)	ug/g	<20	<20	<20	20	7342952
Conductivity	umho/cm	138	88	76	2	7345096
Available (CaCl2) pH	pH	7.54	7.87	7.76		7342579
Soluble (20:1) Sulphate (SO4)	ug/g	<20	<20	<20	20	7342958
RDL = Reportable Detection Limit						
QC Batch = Quality Control Batch						



BV Labs Job #: C1C2198
Report Date: 2021/05/12

Golder Associates Ltd
Client Project #: 1786659
Site Location: HWY35
Sampler Initials: SC

TEST SUMMARY

BV Labs ID: PMT538
Sample ID: 21-5C SA2
Matrix: Soil

Collected: 2021/04/30
Shipped:
Received: 2021/05/06

Test Description	Instrumentation	Batch	Extracted	Date Analyzed	Analyst
Chloride (20:1 extract)	KONE/EC	7342952	2021/05/10	2021/05/11	Deonarine Ramnarine
Conductivity	AT	7345096	2021/05/11	2021/05/11	Khushbu Vijay kumar Patel
pH CaCl2 EXTRACT	AT	7342579	2021/05/10	2021/05/10	Neil Dassanayake
Resistivity of Soil		7340563	2021/05/11	2021/05/11	Automated Statchk
Sulphate (20:1 Extract)	KONE/EC	7342958	2021/05/10	2021/05/11	Deonarine Ramnarine

BV Labs ID: PMT539
Sample ID: 21-2 SA4
Matrix: Soil

Collected: 2021/04/28
Shipped:
Received: 2021/05/06

Test Description	Instrumentation	Batch	Extracted	Date Analyzed	Analyst
Chloride (20:1 extract)	KONE/EC	7342952	2021/05/10	2021/05/11	Deonarine Ramnarine
Conductivity	AT	7345096	2021/05/11	2021/05/11	Khushbu Vijay kumar Patel
pH CaCl2 EXTRACT	AT	7342579	2021/05/10	2021/05/10	Neil Dassanayake
Resistivity of Soil		7340563	2021/05/11	2021/05/11	Automated Statchk
Sulphate (20:1 Extract)	KONE/EC	7342958	2021/05/10	2021/05/11	Deonarine Ramnarine

BV Labs ID: PMT540
Sample ID: 21-3 SA4
Matrix: Soil

Collected: 2021/04/28
Shipped:
Received: 2021/05/06

Test Description	Instrumentation	Batch	Extracted	Date Analyzed	Analyst
Chloride (20:1 extract)	KONE/EC	7342952	2021/05/10	2021/05/11	Deonarine Ramnarine
Conductivity	AT	7345096	2021/05/11	2021/05/11	Khushbu Vijay kumar Patel
pH CaCl2 EXTRACT	AT	7342579	2021/05/10	2021/05/10	Neil Dassanayake
Resistivity of Soil		7340563	2021/05/11	2021/05/11	Automated Statchk
Sulphate (20:1 Extract)	KONE/EC	7342958	2021/05/10	2021/05/11	Deonarine Ramnarine



BV Labs Job #: C1C2198
Report Date: 2021/05/12

Golder Associates Ltd
Client Project #: 1786659
Site Location: HWY35
Sampler Initials: SC

GENERAL COMMENTS

Each temperature is the average of up to three cooler temperatures taken at receipt

Package 1	2.3°C
-----------	-------

Results relate only to the items tested.



BUREAU
VERITAS

BV Labs Job #: C1C2198
Report Date: 2021/05/12

Golder Associates Ltd
Client Project #: 1786659
Site Location: HWY35
Sampler Initials: SC

QUALITY ASSURANCE REPORT

QA/QC Batch	Init	QC Type	Parameter	Date Analyzed	Value	Recovery	UNITS	QC Limits
7342579	NYS	Spiked Blank	Available (CaCl2) pH	2021/05/10		99	%	97 - 103
7342579	NYS	RPD	Available (CaCl2) pH	2021/05/10	0.099		%	N/A
7342952	DRM	Matrix Spike	Soluble (20:1) Chloride (Cl-)	2021/05/11		NC	%	70 - 130
7342952	DRM	Spiked Blank	Soluble (20:1) Chloride (Cl-)	2021/05/11		107	%	70 - 130
7342952	DRM	Method Blank	Soluble (20:1) Chloride (Cl-)	2021/05/11	<20		ug/g	
7342952	DRM	RPD	Soluble (20:1) Chloride (Cl-)	2021/05/11	6.9		%	35
7342958	DRM	Matrix Spike	Soluble (20:1) Sulphate (SO4)	2021/05/11		132 (1)	%	70 - 130
7342958	DRM	Spiked Blank	Soluble (20:1) Sulphate (SO4)	2021/05/11		107	%	70 - 130
7342958	DRM	Method Blank	Soluble (20:1) Sulphate (SO4)	2021/05/11	<20		ug/g	
7342958	DRM	RPD	Soluble (20:1) Sulphate (SO4)	2021/05/11	NC		%	35
7345096	KHP	Spiked Blank	Conductivity	2021/05/11		101	%	90 - 110
7345096	KHP	Method Blank	Conductivity	2021/05/11	<2		umho/cm	
7345096	KHP	RPD	Conductivity	2021/05/11	1.6		%	10

N/A = Not Applicable

Duplicate: Paired analysis of a separate portion of the same sample. Used to evaluate the variance in the measurement.

Matrix Spike: A sample to which a known amount of the analyte of interest has been added. Used to evaluate sample matrix interference.

Spiked Blank: A blank matrix sample to which a known amount of the analyte, usually from a second source, has been added. Used to evaluate method accuracy.

Method Blank: A blank matrix containing all reagents used in the analytical procedure. Used to identify laboratory contamination.

NC (Matrix Spike): The recovery in the matrix spike was not calculated. The relative difference between the concentration in the parent sample and the spike amount was too small to permit a reliable recovery calculation (matrix spike concentration was less than the native sample concentration)

NC (Duplicate RPD): The duplicate RPD was not calculated. The concentration in the sample and/or duplicate was too low to permit a reliable RPD calculation (absolute difference <= 2x RDL).

(1) Recovery or RPD for this parameter is outside control limits. The overall quality control for this analysis meets acceptability criteria.



BV Labs Job #: C1C2198
Report Date: 2021/05/12

Golder Associates Ltd
Client Project #: 1786659
Site Location: HWY35
Sampler Initials: SC

VALIDATION SIGNATURE PAGE

The analytical data and all QC contained in this report were reviewed and validated by the following individual(s).

A handwritten signature in black ink, appearing to read "Anastassia Hamanov", written over a horizontal line.


Anastassia Hamanov, Scientific Specialist

BV Labs has procedures in place to guard against improper use of the electronic signature and have the required "signatories", as per ISO/IEC 17025, signing the reports. For Service Group specific validation please refer to the Validation Signature Page.

GRAIN SIZE DISTRIBUTION

SAND (SP-SM/SW-SM)

FIGURE B-2

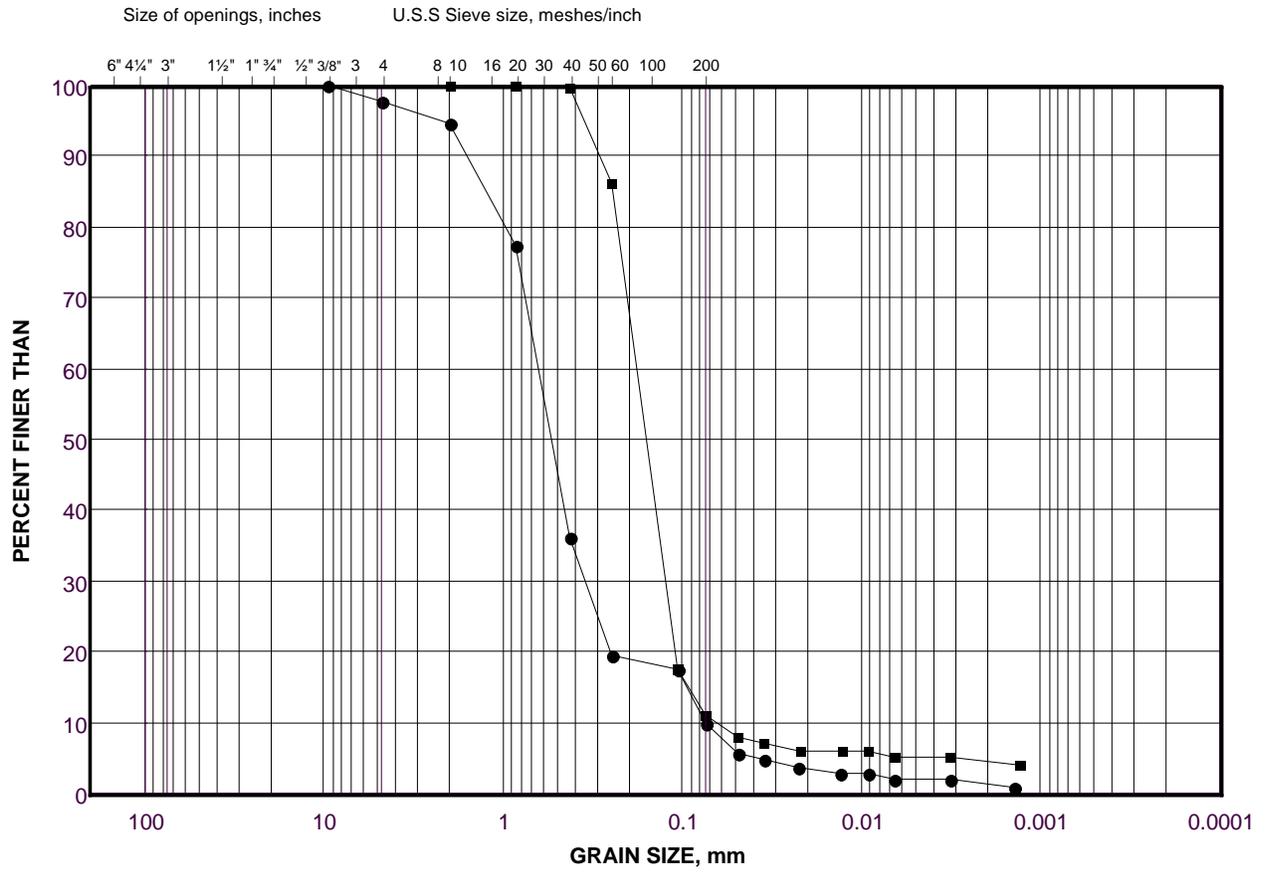

COBBLE	COARSE	FINE	COARSE	MEDIUM	FINE	SILT AND CLAY SIZES
	GRAVEL SIZE		SAND SIZE			FINE GRAINED
SIZE						


LEGEND

SYMBOL	BOREHOLE	SAMPLE	ELEVATION(m)
●	21-4	4	268.4
■	21-2	6	265.6

GRAIN SIZE DISTRIBUTION

SILTY SAND (SM) to SILT (ML) and sand

FIGURE B-3

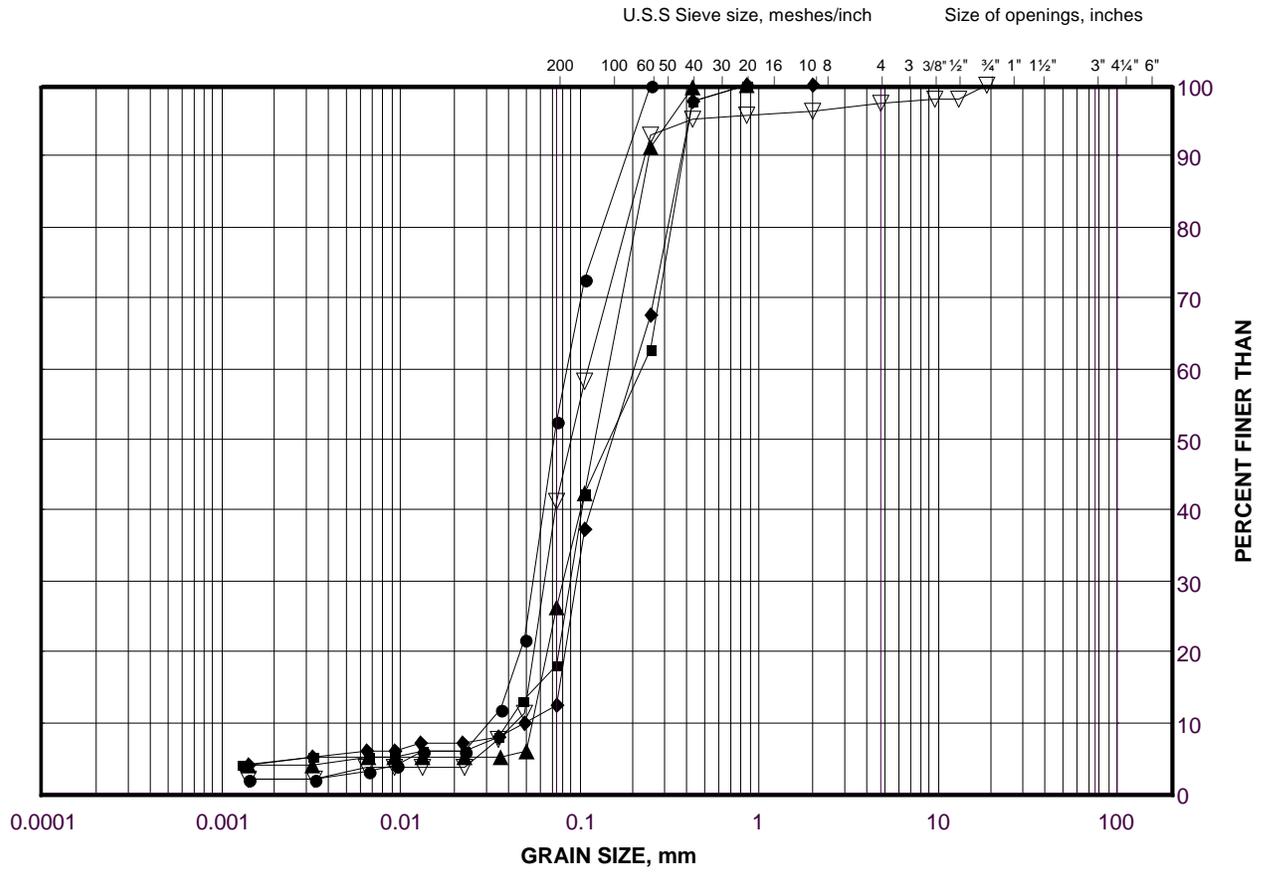

SILT AND CLAY SIZES	FINE	MEDIUM	COARSE	FINE	COARSE	COBBLE
FINE GRAINED	SAND SIZE			GRAVEL SIZE		SIZE

LEGEND

SYMBOL	BOREHOLE	SAMPLE	ELEVATION(m)
●	21-4	3	269.2
■	21-1	3	269.4
◆	21-3	5	267.6
▲	21-1	8	264.8
▽	21-5C	9	264.5

Project Number: 1786659 (13 000)

Checked By: AMP


Golder Associates

Date: 31-May-21

GRAIN SIZE DISTRIBUTION

SILTY SAND (SM) and gravel to SILTY SAND (SM)

FIGURE B-4

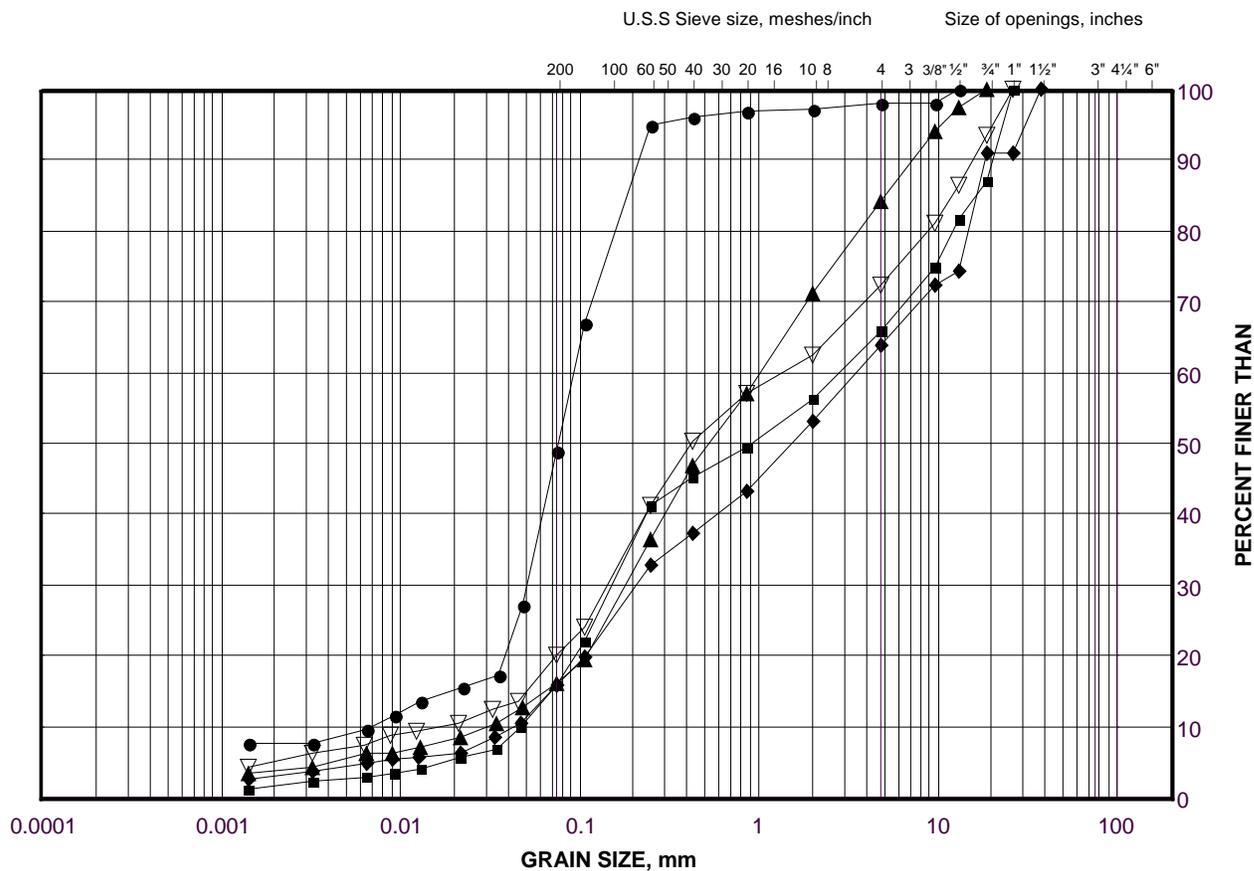

SILT AND CLAY SIZES	FINE	MEDIUM	COARSE	FINE	COARSE	COBBLE
FINE GRAINED	SAND SIZE			GRAVEL SIZE		SIZE

LEGEND

SYMBOL	BOREHOLE	SAMPLE	ELEVATION(m)
●	21-3	2	269.2
■	21-5C	3	270.6
◆	21-5C	6	268.3
▲	21-2	8	263.3
▽	21-3	9	263.1


Project Number: 1786659 (13 000)

Checked By: AMP

Golder Associates

Date: 31-May-21

LIQUID LIMIT, PLASTIC LIMIT, AND PLASTICITY INDEX OF SOILS (ASTM D4318)

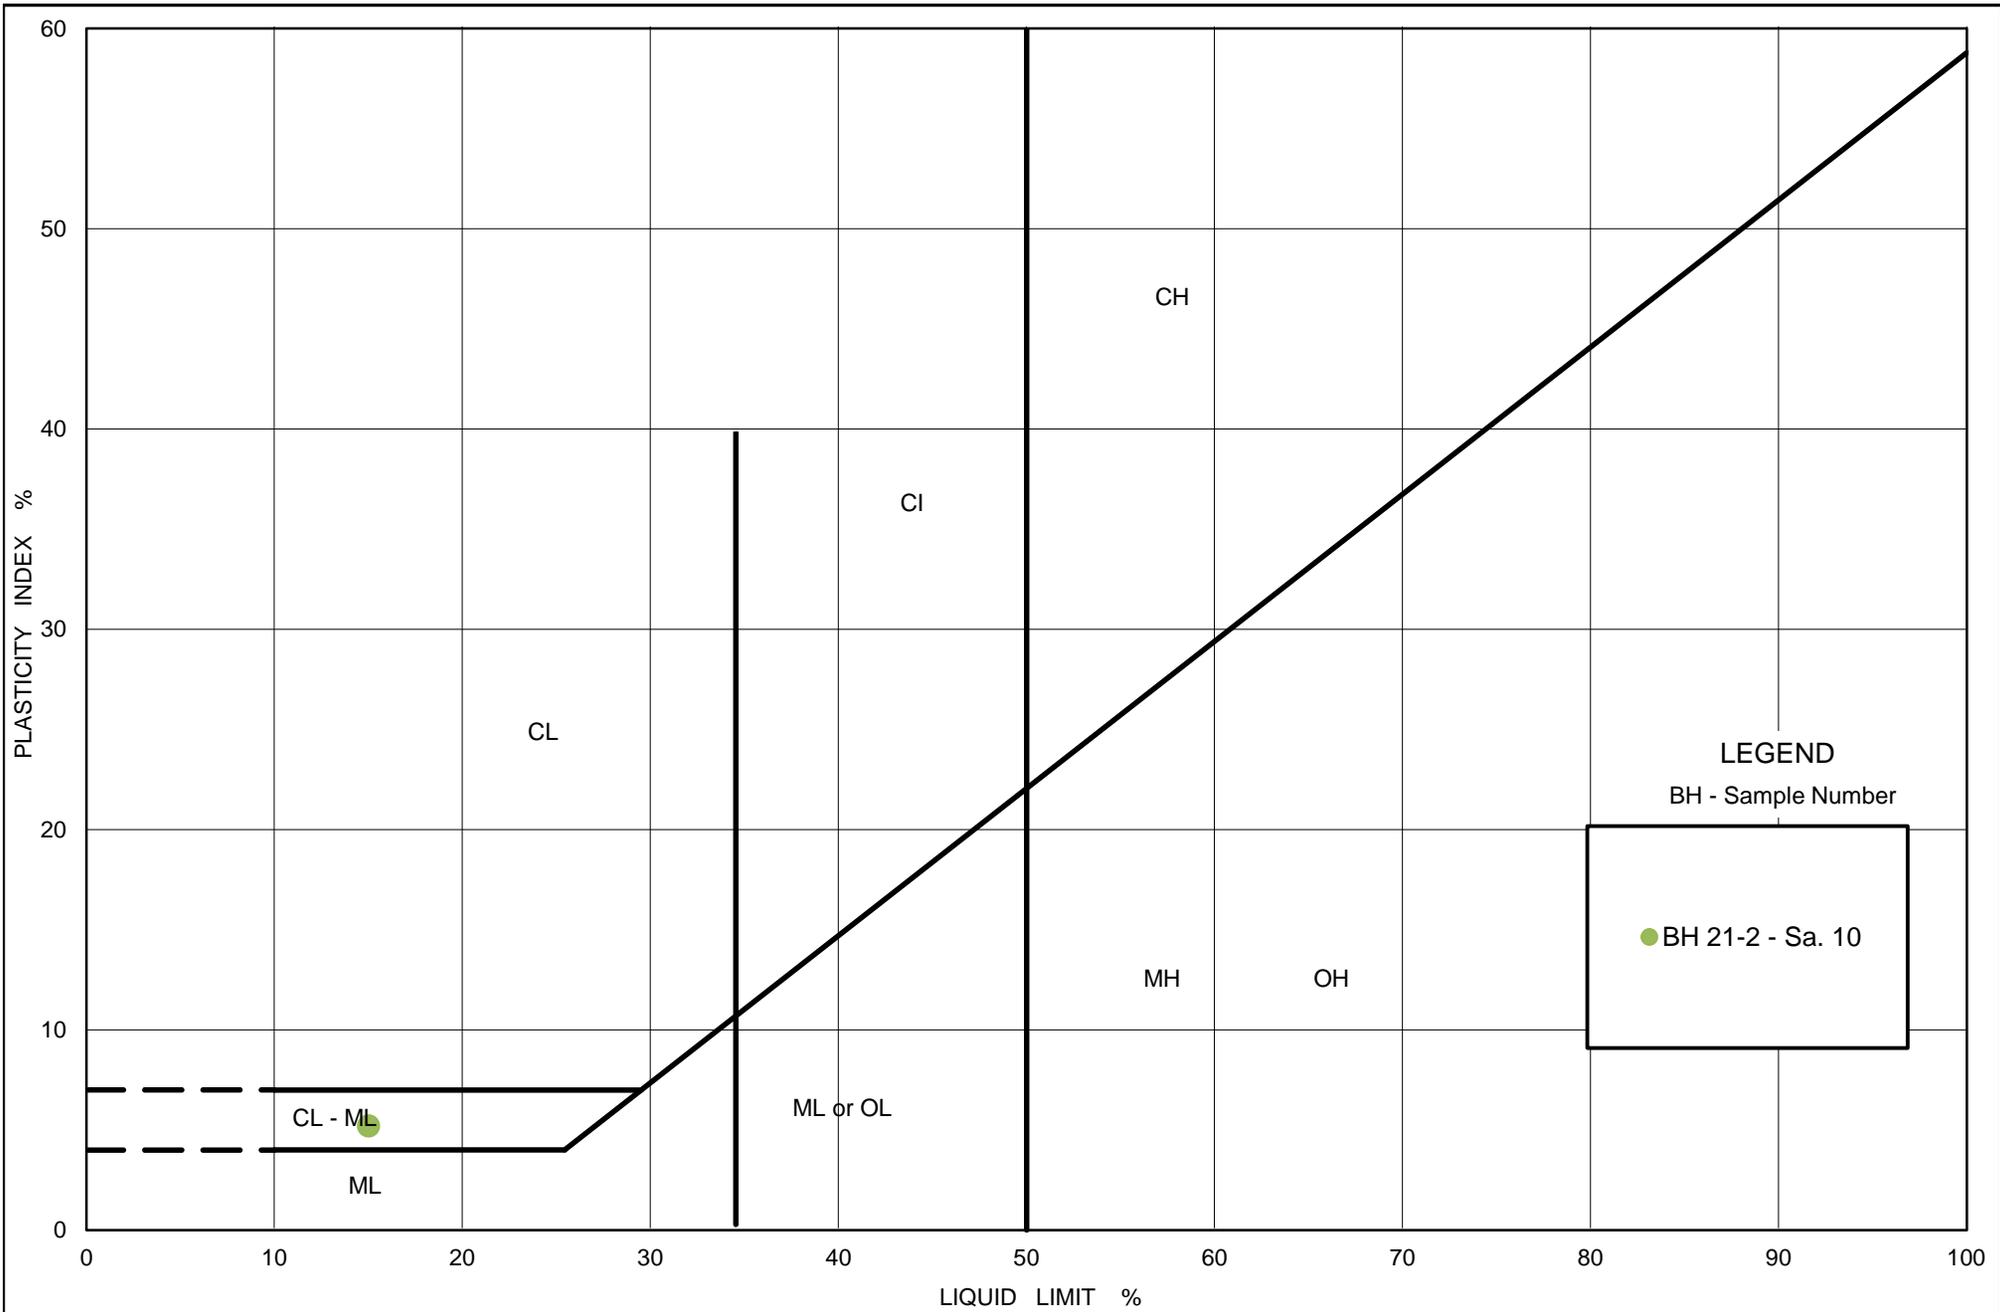

LEGEND
 BH - Sample Number

● BH 21-2 - Sa. 10



PLASTICITY CHART

Sandy gravelly CLAYEY SILT-SILT (CL-ML) (TILL)

Figure No.: B-5

Project No.: 1786659 (13 000)

Checked By: AMP

APPENDIX B

- Borehole Locations and Soil Strata (Thurber)
- Record of Borehole Sheets (Thurber)
- Test Pit Logs (Thurber)
- Geotechnical Laboratory Test Results (Thurber)
- Certificate of Analysis Report – Corrosivity Test Results (SGS for Thurber)
- Site Photographs (Thurber)

METRIC
DIMENSIONS ARE IN METRES
AND/OR MILLIMETRES
UNLESS OTHERWISE SHOWN


CONT No
GWP No 4044-22-00



HIGHWAY 35 MAINTENANCE
PATROL YARD

SHEET

BOREHOLE LOCATIONS AND SOIL STRATA


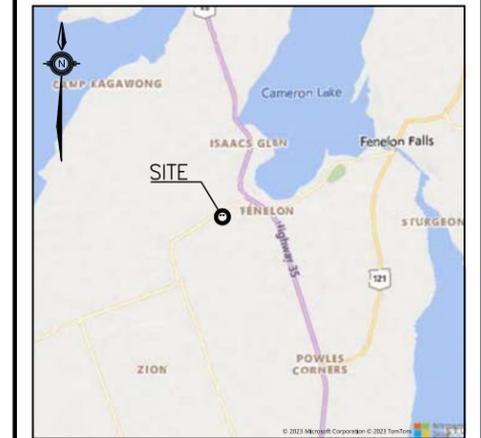


KEYPLAN
LEGEND

●	Borehole
⊕	Test Pit
N	Blows /0.3m (Std Pen Test, 475J/blow)
CONE	Blows /0.3m (60' Cone, 475J/blow)
PH	Pressure, Hydraulic
∇	Water Level Upon Completion of Drilling
∇	Water Level in Monitoring Well/Piezometer
⊥	Monitoring Well/Piezometer Screen
90%	Rock Quality Designation (RQD)
A/R	Auger Refusal

NO	ELEVATION	NORTHING	EASTING
21-1	271.2	4 931 350.2	360 989.0
21-2	269.7	4 931 324.6	361 026.0
21-3	271.0	4 931 362.3	361 060.8
21-4	271.0	4 931 361.4	361 089.6
21-5A	272.5	4 931 383.2	361 154.4
21-5B	272.4	4 931 382.3	361 152.1
21-5C	272.4	4 931 381.4	361 150.2
FST-01	272.0	4 931 408.7	361 060.5
MSB-01	270.2	4 931 324.3	361 007.0
MSB-02	271.0	4 931 368.0	361 029.4
SEP-01	271.2	4 931 332.1	361 133.4
SWMP-01	269.9	4 931 286.4	361 012.5
SWMP-02	269.6	4 931 303.1	361 068.2
SWMP-03	270.0	4 931 253.9	361 059.0
TP-01	268.5	4 931 294.0	361 037.4
VMG-01	271.2	4 931 374.7	361 101.4
VMG-02	272.4	4 931 406.6	361 119.0

GEOCRES No. 31D-828

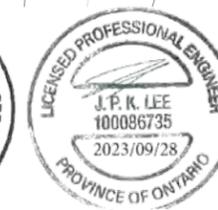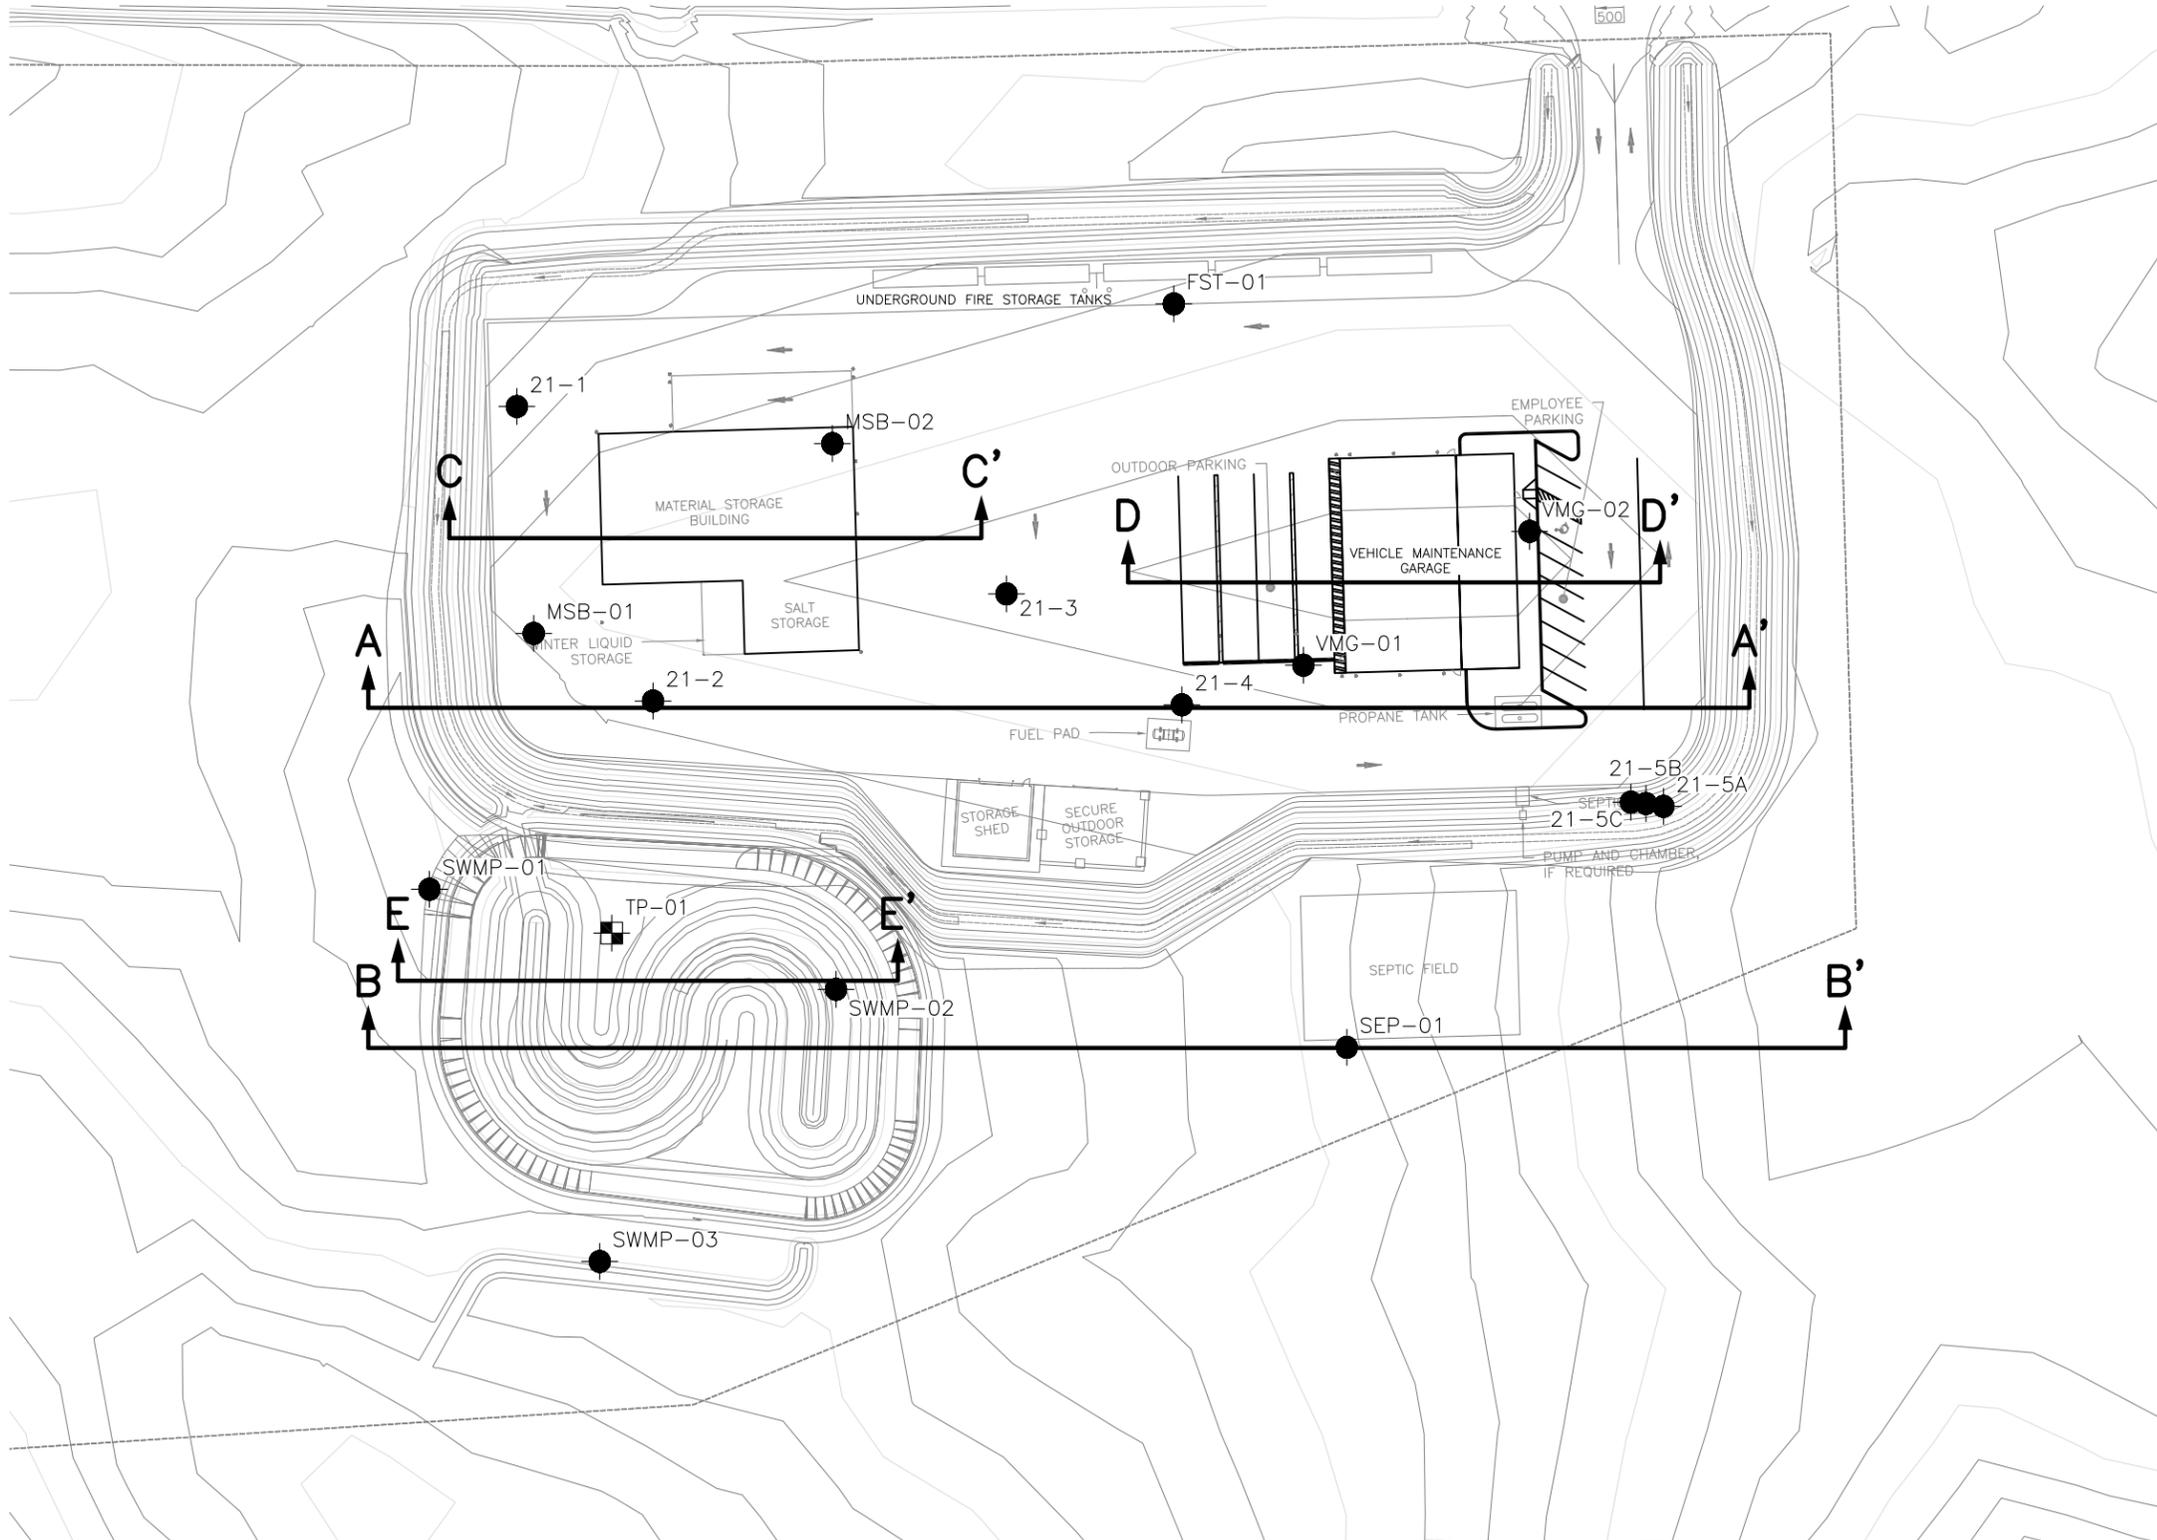

-NOTES-

- The boundaries between soil strata have been established only at Borehole locations. Between Boreholes the boundaries are assumed from geological evidence.
- This drawing is for subsurface information only. Surface details and features are for conceptual illustration.
- Coordinate system is MTM NAD 83 Zone 10.

REVISIONS	DATE	BY	DESCRIPTION

DESIGN	CN	CHK	CODE	LOAD	DATE	SEP 2023
DRAWN	MC	CHK	CN	SITE	STRUCT	DWG 1

METRIC
DIMENSIONS ARE IN METRES
AND/OR MILLIMETRES
UNLESS OTHERWISE SHOWN

CONT No
GWP No 4044-22-00

HIGHWAY 35 MAINTENANCE
PATROL YARD SHEET


BOREHOLE LOCATIONS AND SOIL STRATA





KEYPLAN
LEGEND

	Borehole
	Test Pit
N	Blows /0.3m (Std Pen Test, 475J/blow)
CONE	Blows /0.3m (60' Cone, 475J/blow)
PH	Pressure, Hydraulic
	Water Level Upon Completion of Drilling
	Water Level in Monitoring Well/Piezometer
	Monitoring Well/Piezometer Screen
90%	Rock Quality Designation (RQD)
A/R	Auger Refusal

NO	ELEVATION	NORTHING	EASTING
21-1	271.2	4 931 350.2	360 989.0
21-2	269.7	4 931 324.6	361 026.0
21-3	271.0	4 931 362.3	361 060.8
21-4	271.0	4 931 361.4	361 089.6
21-5A	272.5	4 931 383.2	361 154.4
21-5B	272.4	4 931 382.3	361 152.1
21-5C	272.4	4 931 381.4	361 150.2
FST-01	272.0	4 931 408.7	361 060.5
MSB-01	270.2	4 931 324.3	361 007.0
MSB-02	271.0	4 931 368.0	361 029.4
SEP-01	271.2	4 931 332.1	361 133.4
SWMP-01	269.9	4 931 286.4	361 012.5
SWMP-02	269.6	4 931 303.1	361 068.2
SWMP-03	270.0	4 931 253.9	361 059.0
TP-01	268.5	4 931 294.0	361 037.4
VMG-01	271.2	4 931 374.7	361 101.4
VMG-02	272.4	4 931 406.6	361 119.0

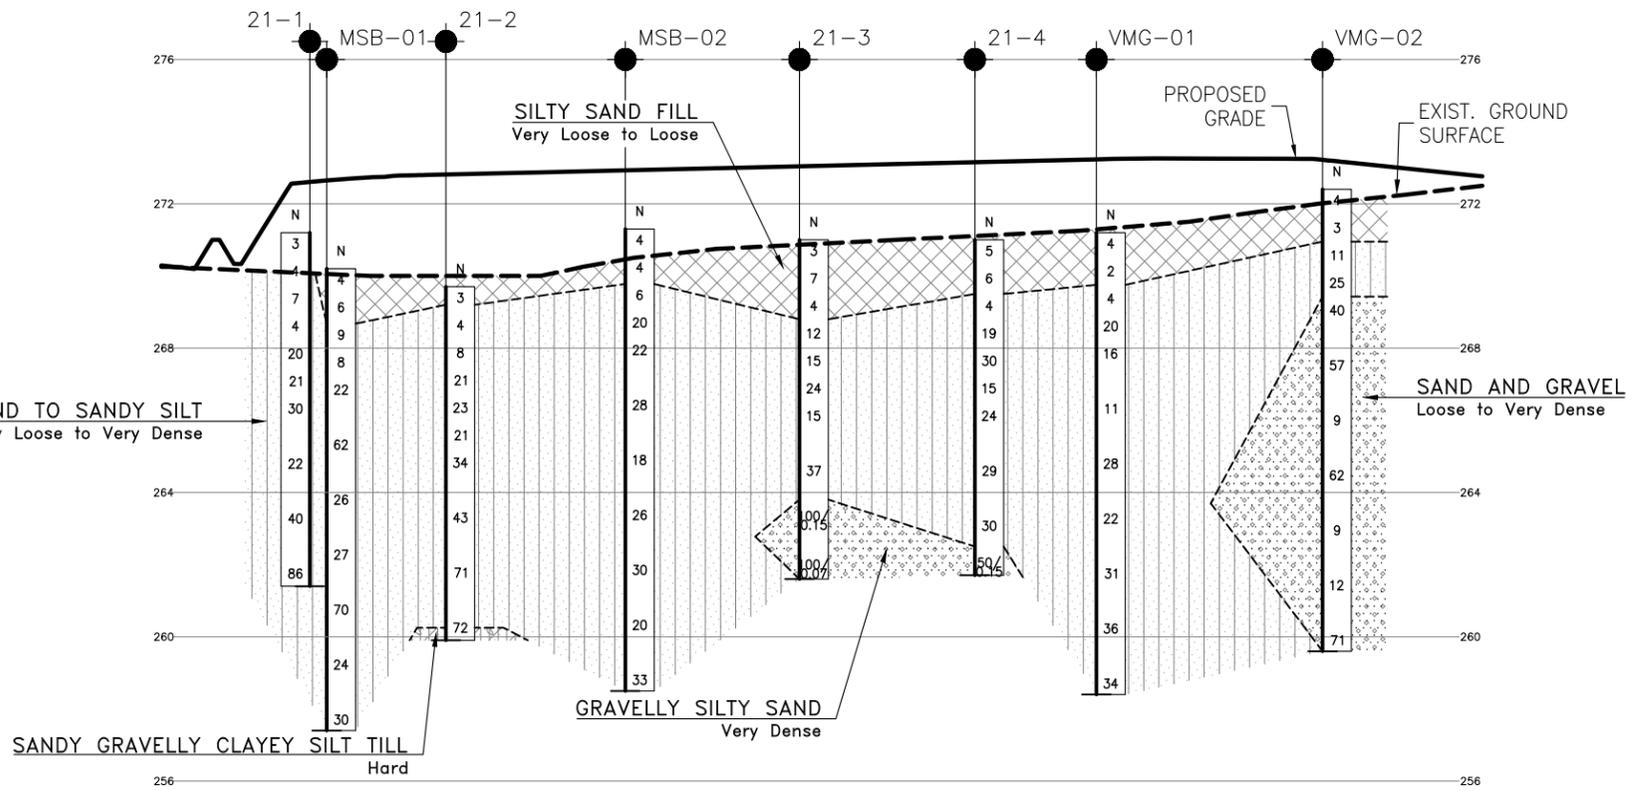

SECTION OF HIGHWAY 35 PATROL YARD (A-A')

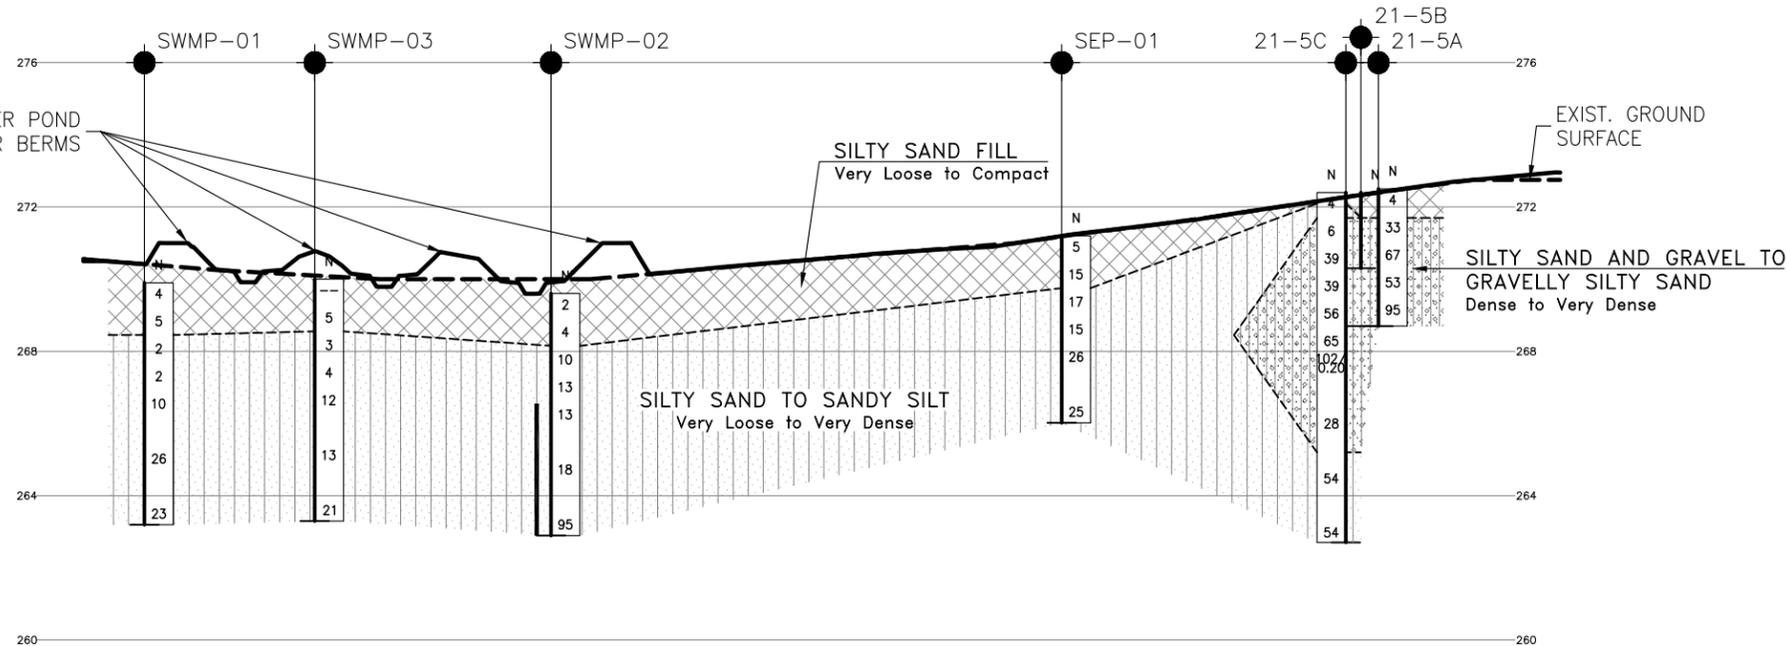

SECTION OF HIGHWAY 35 PATROL YARD (B-B')



-NOTES-

- The boundaries between soil strata have been established only at Borehole locations. Between Boreholes the boundaries are assumed from geological evidence.
- This drawing is for subsurface information only. Surface details and features are for conceptual illustration.
- Coordinate system is MTM NAD 83 Zone 10.

REVISIONS	DATE	BY	DESCRIPTION

DESIGN	CHK	CODE	LOAD	DATE
CN				SEP 2023

DRAWN	CHK	SITE	STRUCT	DWG
MC				2


METRIC

DIMENSIONS ARE IN METRES
AND/OR MILLIMETRES
UNLESS OTHERWISE SHOWN

CONT No
GWP No 4044-22-00

HIGHWAY 35 MAINTENANCE
PATROL YARD SHEET

BOREHOLE LOCATIONS AND SOIL STRATA





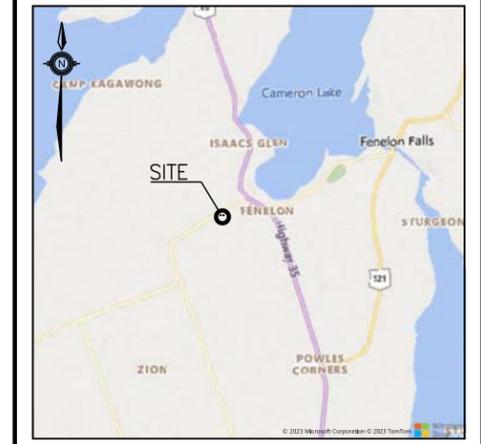


KEYPLAN
LEGEND

●	Borehole
⊕	Test Pit
N	Blows /0.3m (Std Pen Test, 475J/blow)
CONE	Blows /0.3m (60' Cone, 475J/blow)
PH	Pressure, Hydraulic
⊕	Water Level Upon Completion of Drilling
⊕	Water Level in Monitoring Well/Piezometer
⊕	Monitoring Well/Piezometer Screen
90%	Rock Quality Designation (RQD)
A/R	Auger Refusal

NO	ELEVATION	NORTHING	EASTING
21-1	271.2	4 931 350.2	360 989.0
21-2	269.7	4 931 324.6	361 026.0
21-3	271.0	4 931 362.3	361 060.8
21-4	271.0	4 931 361.4	361 089.6
21-5A	272.5	4 931 383.2	361 154.4
21-5B	272.4	4 931 382.3	361 152.1
21-5C	272.4	4 931 381.4	361 150.2
FST-01	272.0	4 931 408.7	361 060.5
MSB-01	270.2	4 931 324.3	361 007.0
MSB-02	271.0	4 931 368.0	361 029.4
SEP-01	271.2	4 931 332.1	361 133.4
SWMP-01	269.9	4 931 286.4	361 012.5
SWMP-02	269.6	4 931 303.1	361 068.2
SWMP-03	270.0	4 931 253.9	361 059.0
TP-01	268.5	4 931 294.0	361 037.4
VMG-01	271.2	4 931 374.7	361 101.4
VMG-02	272.4	4 931 406.6	361 119.0

GEOCREs No. 31D-828

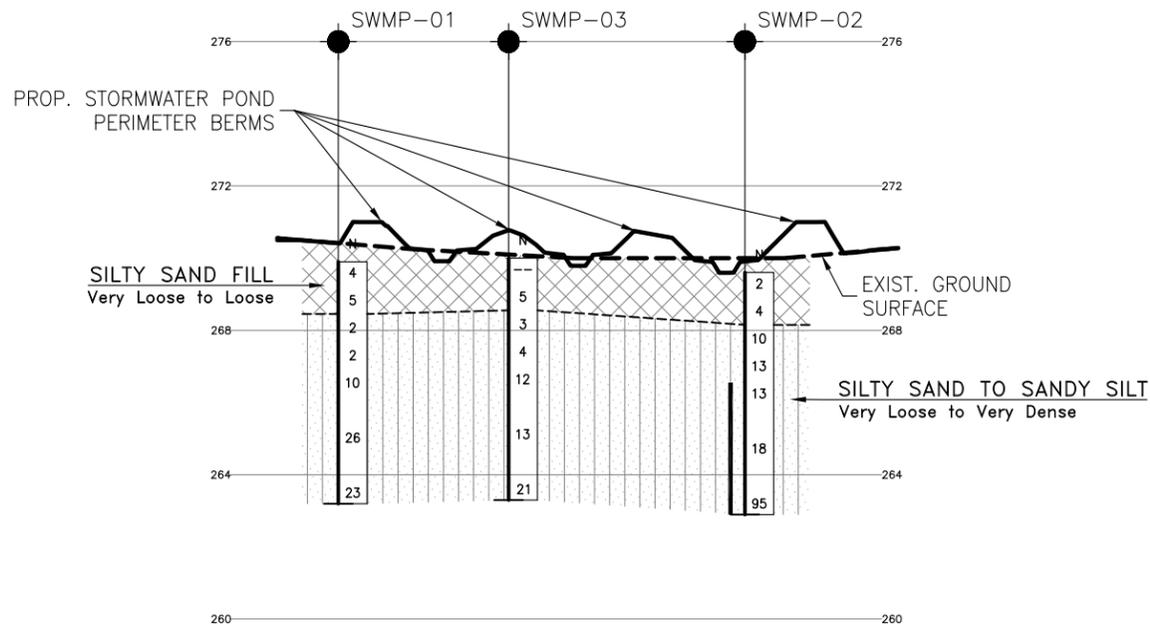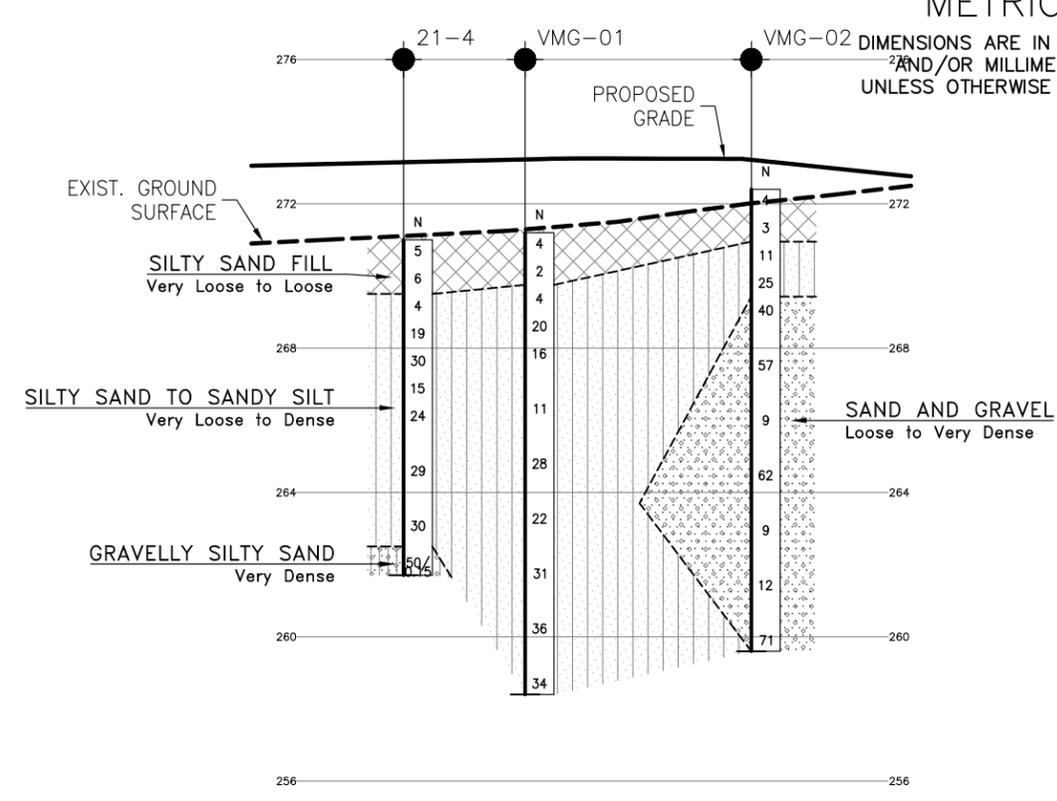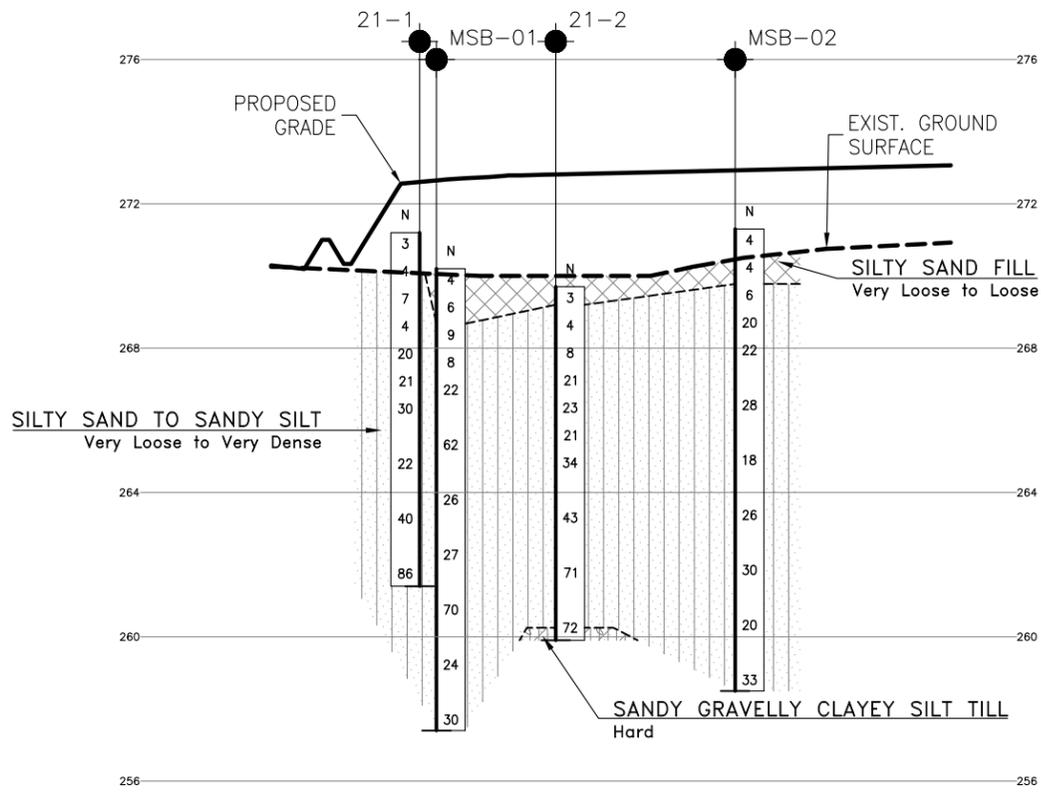

-NOTES-

- The boundaries between soil strata have been established only at Borehole locations. Between Boreholes the boundaries are assumed from geological evidence.
- This drawing is for subsurface information only. Surface details and features are for conceptual illustration.
- Coordinate system is MTM NAD 83 Zone 10.

REVISIONS	DATE	BY	DESCRIPTION

DESIGN	CN	CHK	CODE	LOAD	DATE	SEP 2023
DRAWN	MC	CHK CN	SITE	STRUCT	DWG	3

SYMBOLS, ABBREVIATIONS AND TERMS USED ON RECORDS OF BOREHOLES

1. TEXTURAL CLASSIFICATION OF SOILS

CLASSIFICATION	PARTICLE SIZE	VISUAL IDENTIFICATION
Boulders	Greater than 200mm	same
Cobbles	75 to 200mm	same
Gravel	4.75 to 75mm	5 to 75mm
Sand	0.075 to 4.75mm	Not visible particles to 5mm
Silt	0.002 to 0.075mm	Non-plastic particles, not visible to the naked eye
Clay	Less than 0.002mm	Plastic particles, not visible to the naked eye

2. COARSE GRAIN SOIL DESCRIPTION (50% greater than 0.075mm)

TERMINOLOGY	PROPORTION
Trace or Occasional	Less than 10%
Some	10 to 20%
Adjective (e.g. silty or sandy)	20 to 35%
And (e.g. sand and gravel)	35 to 50%

3. TERMS DESCRIBING CONSISTENCY (COHESIVE SOILS ONLY)

DESCRIPTIVE TERM	UNDRAINED SHEAR STRENGTH (kPa)	APPROXIMATE SPT ⁽¹⁾ 'N' VALUE
Very Soft	12 or less	Less than 2
Soft	12 to 25	2 to 4
Firm	25 to 50	4 to 8
Stiff	50 to 100	8 to 15
Very Stiff	100 to 200	15 to 30
Hard	Greater than 200	Greater than 30

NOTE: Hierarchy of Soil Strength Prediction

- 1) Laboratory Triaxial Testing
- 2) Field Insitu Vane Testing
- 3) Laboratory Vane Testing
- 4) SPT value
- 5) Pocket Penetrometer

4. TERMS DESCRIBING DENSITY (COHESIONLESS SOILS ONLY)

DESCRIPTIVE TERM	SPT "N" VALUE
Very Loose	Less than 4
Loose	4 to 10
Compact	10 to 30
Dense	30 to 50
Very Dense	Greater than 50

5. LEGEND FOR RECORDS OF BOREHOLES

SYMBOLS AND ABBREVIATIONS FOR SAMPLE TYPE	SS Split Spoon Sample	WS Wash Sample	AS Auger (Grab) Sample
	TW Thin Wall Shelby Tube Sample	TP Thin Wall Piston Sample	
	PH Sampler Advanced by Hydraulic Pressure	PM Sampler Advanced by Manual Pressure	
	WH Sampler Advanced by Self Static Weight	RC Rock Core	SC Soil Core

$$\text{Sensitivity} = \frac{\text{Undisturbed Shear Strength}}{\text{Remoulded Shear Strength}}$$

 Water Level
 C_{pen} Shear Strength Determination by Pocket Penetrometer

- (1) SPT 'N' Value Standard Penetration Test 'N' Value – refers to the number of blows from a 63.5kg hammer free falling a height of 0.76m to advance a standard 50 mm outside diameter split spoon sampler for 0.3 m depth into undisturbed ground.
- (2) DCPT Dynamic Cone Penetration Test – Continuous penetration of a 50 mm outside diameter, 60° conical steel point attached to "A" size rods driven by a 63.5 kg hammer free falling a height of 0.76 m. The resistance to cone penetration is the number of hammer blows required for each 0.3 m advance of the conical point into undisturbed ground.

UNIFIED SOILS CLASSIFICATION

MAJOR DIVISIONS		GROUP SYMBOL	TYPICAL DESCRIPTION
COARSE GRAINED SOILS	GRAVEL AND GRAVELLY SOILS	GW	Well-graded gravels or gravel-sand mixtures, little or no fines.
		GP	Poorly-graded gravels or gravel-sand mixtures, little or no fines.
		GM	Silty gravels, gravel-sand-silt mixtures.
		GC	Clayey gravels, gravel-sand-clay mixtures.
	SAND AND SANDY SOILS	SW	Well-graded sands or gravelly sands, little or no fines.
		SP	Poorly-graded sands or gravelly sands, little or no fines.
		SM	Silty sands, sand-silt mixtures.
		SC	Clayey sands, sand-clay mixtures.
FINE GRAINED SOILS	SILTS AND CLAYS $W_L < 50\%$	ML	Inorganic silts and very fine sands, rock flour, silty or clayey fine sands or clayey silts with slight plasticity.
		CL	Inorganic clays of low to medium plasticity, gravelly clays, sandy clays, silty clays, lean clays. ($W_L < 30\%$).
		CI	Inorganic clays of medium plasticity, silty clays. ($30\% < W_L < 50\%$).
		OL	Organic silts and organic silty-clays of low plasticity.
	SILTS AND CLAYS $W_L > 50\%$	MH	Inorganic silts, micaceous or diatomaceous fine sandy or silty soils, elastic silts.
		CH	Inorganic clays of high plasticity, fat clays.
		OH	Organic clays of medium to high plasticity, organic silts.
HIGHLY ORGANIC SOILS	Pt	Peat and other highly organic soils.	
CLAY SHALE			
SANDSTONE			
SILTSTONE			
CLAYSTONE			
COAL			

RECORD OF BOREHOLE No FST-01

1 OF 1

METRIC

W.P. 4044-22-00 LOCATION MTM Zone 10: N 4 931 408.7 E 361 060.5 ORIGINATED BY VP
 DIST HWY 35 BOREHOLE TYPE C.M.E. 75, Track Mounted (Morooka 1100), Solid Stem Auger COMPILED BY AR
 DATUM Geodetic DATE 2023.05.31 - 2023.05.31 LATITUDE 44.520494 LONGITUDE -78.792266 CHECKED BY CN

SOIL PROFILE			SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					UNIT WEIGHT γ kN/m ³	REMARKS & GRAIN SIZE DISTRIBUTION (%)	
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE	"N" VALUES			SHEAR STRENGTH kPa							
							20	40	60	80	100	PLASTIC LIMIT	NATURAL MOISTURE CONTENT	LIQUID LIMIT	
							○ UNCONFINED + FIELD VANE ● QUICK TRIAXIAL × LAB VANE					W P	W	W L	
							WATER CONTENT (%)					20	40	60	
272.0	GROUND SURFACE														
0.0	Silty SAND, trace rootlets Loose Dark Brown Moist (FILL)	[Cross-hatch pattern]	1	SS	4										
			2	SS	5										0 78 22 0
270.5	Silty SAND Loose to Compact Brown Moist	[Dotted pattern]	3	SS	4										
1.5			4	SS	6										0 68 32 0
			5	SS	24										
267.9	Silty SAND, some gravel Compact Brown Moist	[Dotted pattern]	6	SS	23										
4.1			7	SS	25										
			8	SS	9										14 69 9 8
263.8	END OF BOREHOLE AT 8.2 m. BOREHOLE CAVED TO 7.9 m AND REMAINED DRY UPON COMPLETION. BOREHOLE BACKFILLED WITH BENTONITE.														
8.2	WATER LEVEL READINGS DATE DEPTH(m) ELEV.(m) 2023.06.08 Dry -														

ONTMT452_2020LIBRARY(MTO) - COPY.GLB MTO-36708.GPJ 6-22-23

+³, ×³: Numbers refer to Sensitivity
 20
 15
 10
 (%) STRAIN AT FAILURE

RECORD OF BOREHOLE No MSB-01

1 OF 2

METRIC

W.P. 4044-22-00 LOCATION MTM Zone 10: N 4 931 324.3 E 361 007.0 ORIGINATED BY VP
 DIST HWY 35 BOREHOLE TYPE C.M.E. 75, Track Mounted (Morooka 1100), Solid Stem Auger COMPILED BY AR
 DATUM Geodetic DATE 2023.05.30 - 2023.05.30 LATITUDE 44.519738 LONGITUDE -78.792948 CHECKED BY CN

SOIL PROFILE			SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					UNIT WEIGHT γ kN/m ³	REMARKS & GRAIN SIZE DISTRIBUTION (%) GR SA SI CL	
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE	"N" VALUES			SHEAR STRENGTH kPa							
							20	40	60	80	100	PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	
							○ UNCONFINED + FIELD VANE ● QUICK TRIAXIAL × LAB VANE					WATER CONTENT (%) 20 40 60			
270.2	GROUND SURFACE														
0.0	Silty SAND, trace rootlets Loose Dark Brown Moist (FILL)		1	SS	4		270								
			2	SS	6		269								
268.7	SILT and SAND, trace silt Loose to Compact Brown Moist		3	SS	9		268								
1.5			4	SS	8		267								0 43 57 0
			5	SS	22		266								
266.1	SAND, some gravel to gravelly, trace to some silt Compact to Very Dense Brown Moist		6	SS	62		265								
4.1			7	SS	26		264								31 61 7 1
			8	SS	27		263								
			9	SS	70		262								
							261								

ONTMT452_2020LIBRARY(MTO) - COPY.GLB MTO-36708.GPJ 6-22-23

Continued Next Page

+³, ×³: Numbers refer to Sensitivity 20
15
10 (%) STRAIN AT FAILURE

RECORD OF BOREHOLE No MSB-01

2 OF 2

METRIC

W.P. 4044-22-00 LOCATION MTM Zone 10: N 4 931 324.3 E 361 007.0 ORIGINATED BY VP
 DIST HWY 35 BOREHOLE TYPE C.M.E. 75, Track Mounted (Morooka 1100), Solid Stem Auger COMPILED BY AR
 DATUM Geodetic DATE 2023.05.30 - 2023.05.30 LATITUDE 44.519738 LONGITUDE -78.792948 CHECKED BY CN

SOIL PROFILE			SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT	NATURAL MOISTURE CONTENT	LIQUID LIMIT	UNIT WEIGHT γ kN/m ³	REMARKS & GRAIN SIZE DISTRIBUTION (%) GR SA SI CL
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE	"N" VALUES			SHEAR STRENGTH kPa									
	Continued From Previous Page						20 40 60 80 100										
257.4	SAND, some gravel to gravelly, trace to some silt Compact to Very Dense Brown Moist	[Strat Plot: Dotted pattern]	10	SS	24												
258			11	SS	30											10 75 14 1	
12.8	END OF BOREHOLE AT 12.8 m. BOREHOLE WAS OPEN AND REMAINED DRY UPON COMPLETION. BOREHOLE BACKFILLED WITH BENTONITE.																

ONTMT4S2_2020LIBRARY(MTO) - COPY.GLB MTO-36708.GPJ 6-22-23

+³, x³: Numbers refer to Sensitivity
 20
 15
 10
 (%) STRAIN AT FAILURE

RECORD OF BOREHOLE No MSB-02

1 OF 2

METRIC

W.P. 4044-22-00 LOCATION MTM Zone 10: N 4 931 368.0 E 361 029.4 ORIGINATED BY VP
 DIST HWY 35 BOREHOLE TYPE C.M.E. 75, Track Mounted (Morooka 1100), Solid Stem Auger COMPILED BY AR
 DATUM Geodetic DATE 2023.05.31 - 2023.05.31 LATITUDE 44.520129 LONGITUDE -78.792661 CHECKED BY CN

SOIL PROFILE			SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT			PLASTIC LIMIT w _p	NATURAL MOISTURE CONTENT w	LIQUID LIMIT w _L	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE	"N" VALUES			SHEAR STRENGTH kPa							
							20	40	60	80	100				
271.3	GROUND SURFACE														
0.0	Silty SAND Very Loose Dark Brown Moist (FILL)		1	SS	4										
			2	SS	4										
269.8															
1.5	Silty SAND Loose to Compact Brown Moist		3	SS	6										
			4	SS	20										
			5	SS	22										0 82 17 1 Non-plastic
			6	SS	28										
			7	SS	18										
			8	SS	26										
			9	SS	30										0 85 15 0

ONTMT452_2020LIBRARY(MTO) - COPY.GLB MTO-36708.GPJ 6-22-23

Continued Next Page

+³, ×³: Numbers refer to Sensitivity
 20
 15
 10
 (%) STRAIN AT FAILURE

RECORD OF BOREHOLE No MSB-02

2 OF 2

METRIC

W.P. 4044-22-00 LOCATION MTM Zone 10: N 4 931 368.0 E 361 029.4 ORIGINATED BY VP
 DIST HWY 35 BOREHOLE TYPE C.M.E. 75, Track Mounted (Morooka 1100), Solid Stem Auger COMPILED BY AR
 DATUM Geodetic DATE 2023.05.31 - 2023.05.31 LATITUDE 44.520129 LONGITUDE -78.792661 CHECKED BY CN

SOIL PROFILE			SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ kN/m ³	REMARKS & GRAIN SIZE DISTRIBUTION (%) GR SA SI CL
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE	"N" VALUES			SHEAR STRENGTH kPa 20 40 60 80 100									
259.6	Continued From Previous Page																
11.7	Silty SAND Loose to Compact Brown Moist		10	SS	20												
258.5	SAND, some silt Dense Brown Moist		11	SS	33											0 91 9 0	
12.8	END OF BOREHOLE AT 12.8 m. BOREHOLE WAS OPEN AND REMAINED DRY UPON COMPLETION. BOREHOLE BACKFILLED WITH BENTONITE.																

ONTMT4S2_2020LIBRARY(MTO) - COPY.GLB MTO-36708.GPJ 6-22-23

+³, ×³: Numbers refer to Sensitivity
 20
 15
 10
 (%) STRAIN AT FAILURE

RECORD OF BOREHOLE No SEP-01

1 OF 1

METRIC

W.P. 4044-22-00 LOCATION MTM Zone 10: N 4 931 332.1 E 361 133.4 ORIGINATED BY VP
 DIST HWY 35 BOREHOLE TYPE C.M.E. 75, Track Mounted (Morooka 1100), Solid Stem Auger COMPILED BY AR
 DATUM Geodetic DATE 2023.05.31 - 2023.05.31 LATITUDE 44.519799 LONGITUDE -78.791357 CHECKED BY CN

SOIL PROFILE			SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					UNIT WEIGHT γ kN/m ³	REMARKS & GRAIN SIZE DISTRIBUTION (%) GR SA SI CL	
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE	"N" VALUES			SHEAR STRENGTH kPa							
							20	40	60	80	100	PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	
							○ UNCONFINED + FIELD VANE ● QUICK TRIAXIAL × LAB VANE					WATER CONTENT (%) 20 40 60			
271.2	GROUND SURFACE														
0.0	Silty SAND Loose to Compact Brown Moist (FILL)		1	SS	5		271								
			2	SS	15		270								0 79 20 1
269.8															
1.4	Silty SAND Compact Brown Moist		3	SS	17		269								
			4	SS	15		268								0 71 29 0
			5	SS	26		267								
			6	SS	25										
266.0															
5.2	END OF BOREHOLE AT 5.2 m. BOREHOLES WAS OPEN AND REMAINED DRY UPON COMPLETION OF DRILLING. BOREHOLE BACKFILLED WITH BENTONITE.														

ONTMT4S2_2020LIBRARY(MTO) - COPY.GLB MTO-36708.GPJ 6-22-23

+³, ×³: Numbers refer to Sensitivity 20
15 5
10 (%) STRAIN AT FAILURE

RECORD OF BOREHOLE No SWMP-01

1 OF 1

METRIC

W.P. 4044-22-00 LOCATION MTM Zone 10: N 4 931 286.4 E 361 012.5 ORIGINATED BY VP
 DIST HWY 35 BOREHOLE TYPE C.M.E. 75, Track Mounted (Morooka 1100), Solid Stem Auger COMPILED BY AR
 DATUM Geodetic DATE 2023.05.30 - 2023.05.30 LATITUDE 44.519396 LONGITUDE -78.792883 CHECKED BY CN

SOIL PROFILE			SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT	NATURAL MOISTURE CONTENT	LIQUID LIMIT	UNIT WEIGHT γ kN/m ³	REMARKS & GRAIN SIZE DISTRIBUTION (%)
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE	"N" VALUES			SHEAR STRENGTH kPa									
							20	40	60	80	100	W P	W	W L			
							○ UNCONFINED + FIELD VANE ● QUICK TRIAXIAL × LAB VANE										
269.9	GROUND SURFACE						20	40	60	80	100						
0.0	Silty SAND, trace rootlets Very Loose to Loose Dark Brown to Brown Moist (FILL)		1	SS	4											0 52 48 0	
268.5			2	SS	5												
1.4	SILT and SAND Very Loose Brown Wet		3	SS	2											0 40 60 0	
266.9			4	SS	2												
3.0	SAND, trace silt Compact Brown Moist		5	SS	10												
266.9			6	SS	26												
263.2			7	SS	23												
6.7	END OF BOREHOLE AT 6.7 m. BOREHOLE WAS OPEN AND REMAINED DRY UPON COMPLETION. BOREHOLE BACKFILLED WITH BENTONITE.																

ONTMT4S2_2020LIBRARY(MTO) - COPY.GLB MTO-36708.GPJ 6-22-23

RECORD OF BOREHOLE No SWMP-02

1 OF 1

METRIC

W.P. 4044-22-00 LOCATION MTM Zone 10: N 4 931 303.1 E 361 068.2 ORIGINATED BY VP
 DIST HWY 35 BOREHOLE TYPE C.M.E. 75, Track Mounted (Morooka 1100), Solid Stem Auger COMPILED BY AR
 DATUM Geodetic DATE 2023.05.30 - 2023.05.30 LATITUDE 44.519542 LONGITUDE -78.792180 CHECKED BY CN

SOIL PROFILE			SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					UNIT WEIGHT γ kN/m ³	REMARKS & GRAIN SIZE DISTRIBUTION (%)		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE	"N" VALUES			SHEAR STRENGTH kPa								
							20	40	60	80	100	PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L		
							○ UNCONFINED + FIELD VANE ● QUICK TRIAXIAL × LAB VANE					WATER CONTENT (%)		GR SA SI CL		
269.6	GROUND SURFACE															
0.0	Silty SAND, trace rootlets Very Loose Dark Brown Moist (FILL)		1	SS	2							○			0 67 30 3	
			2	SS	4							○				
268.2																
1.4	Silty SAND Compact to Very Dense Brown Moist		3	SS	10							○			3 67 25 5	
			4	SS	13							○				
			5	SS	13							○				
			6	SS	18							○			0 62 38 0	
			7	SS	95							○				
262.9																
6.7	END OF BOREHOLE AT 6.7 m. BOREHOLE WAS OPEN AND REMAINED DRY UPON COMPLETION. BOREHOLE BACKFILLED WITH BENTONITE. WATER LEVEL READINGS DATE DEPTH(m) ELEV.(m) 2023.06.08 Dry -															

ONTMT452, 2020LIBRARY(MTO) - COPY, GLB MTO-36708, GPJ 6-22-23

+³, ×³: Numbers refer to Sensitivity
 20
 15
 10
 (%) STRAIN AT FAILURE

RECORD OF BOREHOLE No SWMP-03

1 OF 1

METRIC

W.P. 4044-22-00 LOCATION MTM Zone 10: N 4 931 253.9 E 361 059.0 ORIGINATED BY VP
 DIST HWY 35 BOREHOLE TYPE C.M.E. 75, Track Mounted (Morooka 1100), Solid Stem Auger COMPILED BY AR
 DATUM Geodetic DATE 2023.05.30 - 2023.05.30 LATITUDE 44.519101 LONGITUDE -78.792301 CHECKED BY CN

SOIL PROFILE			SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					UNIT WEIGHT γ kN/m ³	REMARKS & GRAIN SIZE DISTRIBUTION (%)	
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE	"N" VALUES			SHEAR STRENGTH kPa							
							20	40	60	80	100	PLASTIC LIMIT W P	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W L	
							○ UNCONFINED + FIELD VANE ● QUICK TRIAXIAL × LAB VANE					WATER CONTENT (%)			
							20	40	60	80	100	20	40	60	
270.0	GROUND SURFACE														
0.0	SILT and SAND Loose Dark Brown Moist (FILL)		1	AS	-							○			
			2	SS	5		269					○			0 40 57 3
268.6															
1.4	Sandy SILT Loose to Compact Greish Brown Moist		3	SS	3		268					○			
			4	SS	4		267					○			
			5	SS	12		266					○			0 35 62 3 Non-plastic
			6	SS	13		265					○			
							264					○			
263.3			7	SS	21							○			
6.7	END OF BOREHOLE AT 6.7 m. BOREHOLE WAS OPEN AND REMAINED DRY UPON COMPLETION. BOREHOLE BACKFILLED WITH BENTONITE.														

ONTMT4S2_2020LIBRARY(MTO) - COPY.GLB MTO-36708.GPJ 6-22-23

+³, ×³: Numbers refer to Sensitivity
 20
 15
 10
 (%) STRAIN AT FAILURE

RECORD OF BOREHOLE No VMG-01

1 OF 2

METRIC

W.P. 4044-22-00 LOCATION MTM Zone 10: N 4 931 374.7 E 361 101.4 ORIGINATED BY VP
 DIST HWY 35 BOREHOLE TYPE C.M.E. 75, Track Mounted (Morooka 1100), Solid Stem Auger COMPILED BY AR
 DATUM Geodetic DATE 2023.05.31 - 2023.05.30 LATITUDE 44.520184 LONGITUDE -78.791755 CHECKED BY CN

SOIL PROFILE			SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					PLASTIC LIMIT	NATURAL MOISTURE CONTENT	LIQUID LIMIT	UNIT WEIGHT γ	REMARKS & GRAIN SIZE DISTRIBUTION (%)
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE	"N" VALUES			SHEAR STRENGTH kPa									
							20	40	60	80	100						
271.2	GROUND SURFACE																
0.0	Silty SAND, trace gravel Very Loose Dark Brown Moist (FILL)		1	SS	4												
			2	SS	2												
269.8																	
1.4	SILT and SAND Loose to Compact Brown to Grey Moist		3	SS	4												
			4	SS	20												
			5	SS	16												
			6	SS	11											0 44 52 4	
265.6																	
5.6	SAND, some silt Compact Brown Moist		7	SS	28												
			8	SS	22												
262.5																	
8.7	Sandy SILT Dense Brown Moist		9	SS	31											0 23 76 1 Non-plastic	

ONTMT452, 2020LIBRARY(MTO) - COPY.GLB MTO-36708.GPJ 6-22-23

Continued Next Page

+³, ×³: Numbers refer to Sensitivity 20
15 5
10 (%) STRAIN AT FAILURE

RECORD OF BOREHOLE No VMG-01

2 OF 2

METRIC

W.P. 4044-22-00 LOCATION MTM Zone 10: N 4 931 374.7 E 361 101.4 ORIGINATED BY VP
 DIST HWY 35 BOREHOLE TYPE C.M.E. 75, Track Mounted (Morooka 1100), Solid Stem Auger COMPILED BY AR
 DATUM Geodetic DATE 2023.05.31 - 2023.05.30 LATITUDE 44.520184 LONGITUDE -78.791755 CHECKED BY CN

SOIL PROFILE			SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					UNIT WEIGHT γ kN/m ³	REMARKS & GRAIN SIZE DISTRIBUTION (%) GR SA SI CL		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE	"N" VALUES			SHEAR STRENGTH kPa								
							20	40	60	80	100	PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L		
							○ UNCONFINED + FIELD VANE ● QUICK TRIAXIAL × LAB VANE					WATER CONTENT (%) 20 40 60				
261.0	Continued From Previous Page															
10.2	SAND, some silt, trace to some gravel Dense Brown Moist		10	SS	36											
260																
			11	SS	34											
258.4																
12.8	END OF BOREHOLE AT 12.8 m. BOREHOLE WAS OPEN AND REMAINED DRY UPON COMPLETION. BOREHOLE BACKFILLED WITH BENTONITE.															

ONTMT452_2020LIBRARY(MTO) - COPY.GLB MTO-36708.GPJ 6-22-23

+³, ×³: Numbers refer to Sensitivity
 20
 15
 10
 (%) STRAIN AT FAILURE

RECORD OF BOREHOLE No VMG-02

1 OF 2

METRIC

W.P. 4044-22-00 LOCATION MTM Zone 10: N 4 931 406.6 E 361 119.0 ORIGINATED BY VP
 DIST HWY 35 BOREHOLE TYPE C.M.E. 75, Track Mounted (Morooka 1100), Solid Stem Auger COMPILED BY AR
 DATUM Geodetic DATE 2023.05.31 - 2023.05.31 LATITUDE 44.520470 LONGITUDE -78.791529 CHECKED BY CN

SOIL PROFILE			SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT			PLASTIC LIMIT W _p	NATURAL MOISTURE CONTENT W	LIQUID LIMIT W _L	UNIT WEIGHT γ kN/m ³	REMARKS & GRAIN SIZE DISTRIBUTION (%) GR SA SI CL
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE	"N" VALUES			SHEAR STRENGTH kPa 20 40 60 80 100							
272.4	GROUND SURFACE														
0.0	Silty SAND, trace rootlets, trace gravel Very Loose to Loose Dark Brown Moist (FILL)		1	SS	4										
			2	SS	3										
271.0															
1.4	Silty SAND Compact Brown Moist		3	SS	11										
			4	SS	25									1 86 13 0	
269.4															
3.0	SAND and GRAVEL, trace silt Loose to Very Dense Brown Moist		5	SS	40										
			6	SS	57									39 52 9 0	
			7	SS	9										
			8	SS	62										
			9	SS	9										

ONTMT452_2020LIBRARY(MTO) - COPY.GLB MTO-36708.GPJ 6-22-23

Continued Next Page

+³, ×³: Numbers refer to Sensitivity
 20
 15
 10
 (%) STRAIN AT FAILURE

RECORD OF BOREHOLE No VMG-02

2 OF 2

METRIC

W.P. 4044-22-00 LOCATION MTM Zone 10: N 4 931 406.6 E 361 119.0 ORIGINATED BY VP
 DIST HWY 35 BOREHOLE TYPE C.M.E. 75, Track Mounted (Morooka 1100), Solid Stem Auger COMPILED BY AR
 DATUM Geodetic DATE 2023.05.31 - 2023.05.31 LATITUDE 44.520470 LONGITUDE -78.791529 CHECKED BY CN

SOIL PROFILE		SAMPLES			GROUND WATER CONDITIONS	ELEVATION SCALE	DYNAMIC CONE PENETRATION RESISTANCE PLOT					UNIT WEIGHT γ kn/m ³	REMARKS & GRAIN SIZE DISTRIBUTION (%) GR SA SI CL		
ELEV DEPTH	DESCRIPTION	STRAT PLOT	NUMBER	TYPE			"N" VALUES	SHEAR STRENGTH kPa							
	Continued From Previous Page					20 40 60 80 100	PLASTIC LIMIT	NATURAL MOISTURE CONTENT	LIQUID LIMIT	W P	W	W L			
							O UNCONFINED + FIELD VANE ● QUICK TRIAXIAL X LAB VANE								
							WATER CONTENT (%)								
							20	40	60						
259.6	SAND and GRAVEL, trace silt Loose to Very Dense Brown Moist		10	SS	12									33 51 10 6	
260			11	SS	71										
12.8	END OF BOREHOLE AT 12.8 m. BOREHOLE WAS CAVED TO 7.3 m AND REMAINED DRY UPON COMPLETION. BOREHOLE BACKFILLED WITH BENTONITE.														


ONTMT4S2_2020LIBRARY(MTO) - COPY.GLB MTO-36708.GPJ 6-22-23

+³, X³: Numbers refer to Sensitivity
 20
 15
 10
 (%) STRAIN AT FAILURE

LOG OF TEST PIT: TP-01

PROJECT NO.:		36708		CLIENT:		Dillon		DATE:		June 7, 2023		
PROJECT:		Highway 35 Patrol Yard		METHOD:		B95 Backhoe Loader		LOGGED:		KI		
LOCATION:		Kawartha Lake, ON		CONTRACTOR:		Young's Construction		CHECKED:		AR		
		N 4,931,294 E 361,035		SURFACE ELEV.		270.4				Page 1 of 1		
Depth (ft)	Depth (m)	STRATIGRAPHY				Sample Depth (m)	Soils Class.	Water Content (%)	Grain Size Distribution (%)			
		Silty SAND , trace clay, trace organics, brown, moist (FILL)							GR	SA	SI	CL
0 -	0 -					0 -						
	0.2					0.2						
1.0												
	0.4					0.4						
2.0												
	0.6					0.6						
	0.8					0.8						
3.0												
	1.0					1.0						
4.0												
	1.2					1.2						
	1.4					1.4						
5.0												
	1.6					1.6						
6.0												
	1.8					1.8						
7.0						2.0						
	2.0					2.0						
	2.2	Test pit was terminated at a depth of 2.0 m. Open test pit was dry upon completion of excavation. Test pit was backfilled using excavated material.				2.2						



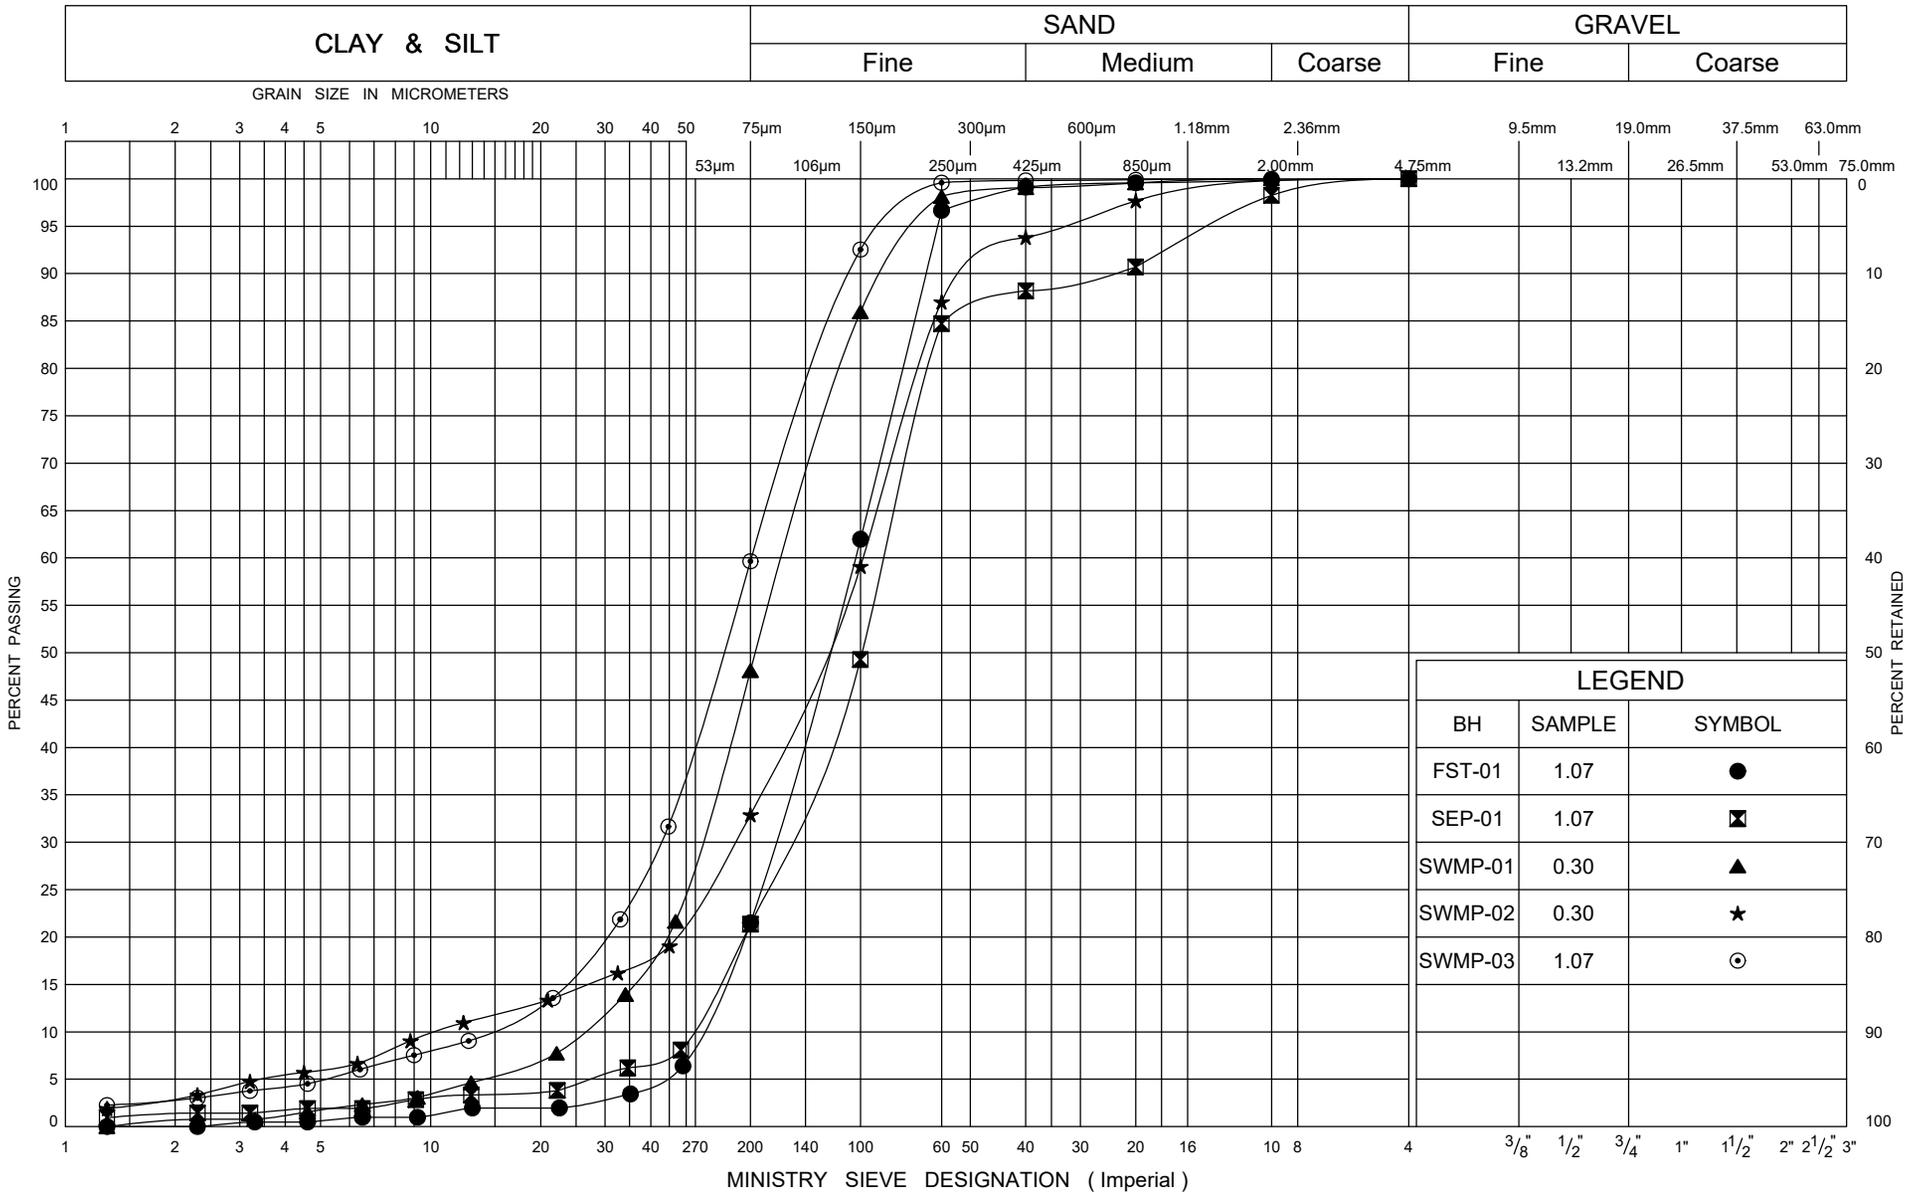

ONTARIO MOT GRAIN SIZE 2 MTO-36708.GPJ ONTARIO MOT.GDT 6/19/23




GRAIN SIZE DISTRIBUTION

Silty SAND FILL

FIG No B-1

G.W.P. 4044-22-00

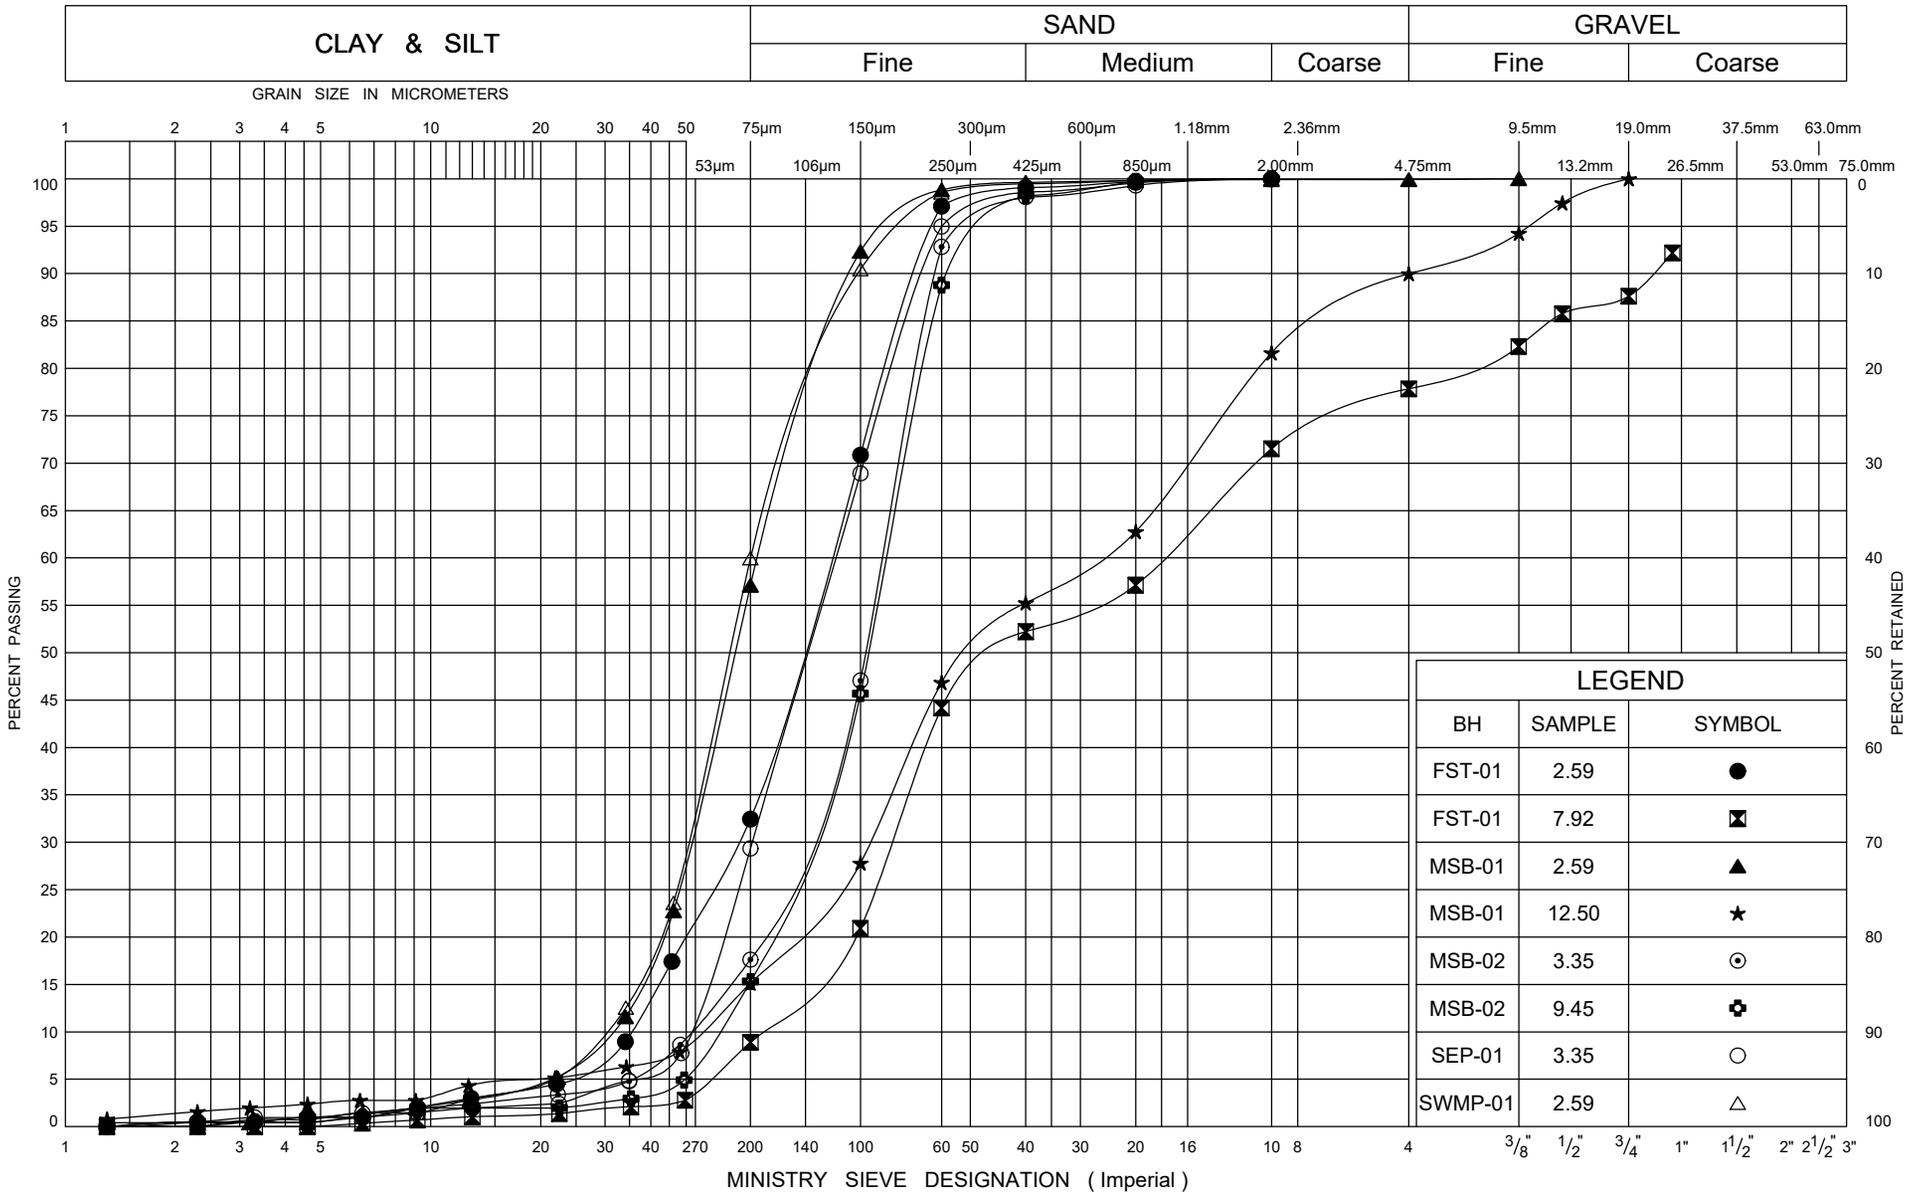


ONTARIO MOT GRAIN SIZE 2 MTO-36708.GPJ ONTARIO MOT.GDT 6/19/23



GRAIN SIZE DISTRIBUTION
 Silty SAND to Sandy SILT

FIG No B-2

G.W.P. 4044-22-00

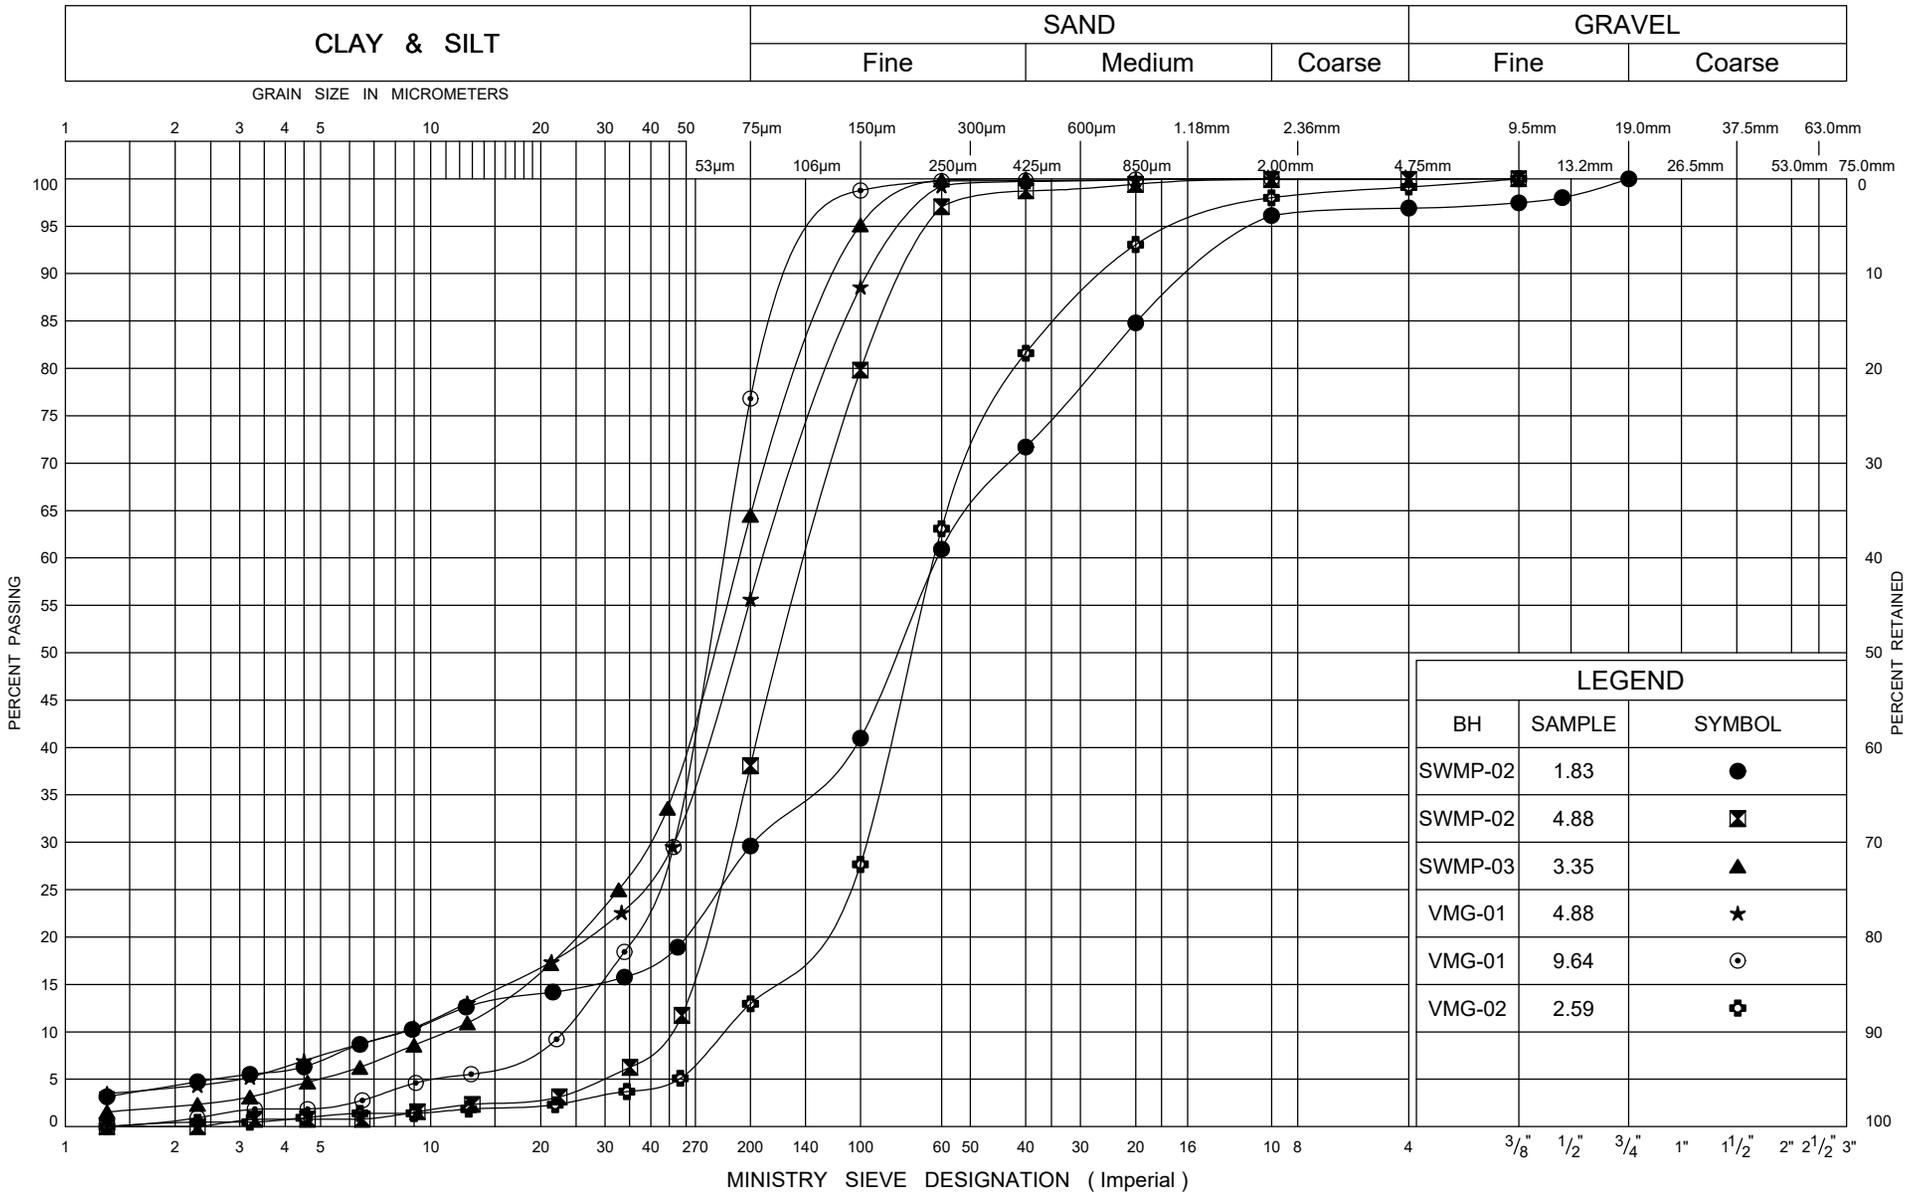


ONTARIO MOT GRAIN SIZE 2 MTO-36708.GPJ ONTARIO MOT.GDT 6/19/23



GRAIN SIZE DISTRIBUTION
 Silty SAND to Sandy SILT

FIG No B-3

G.W.P. 4044-22-00

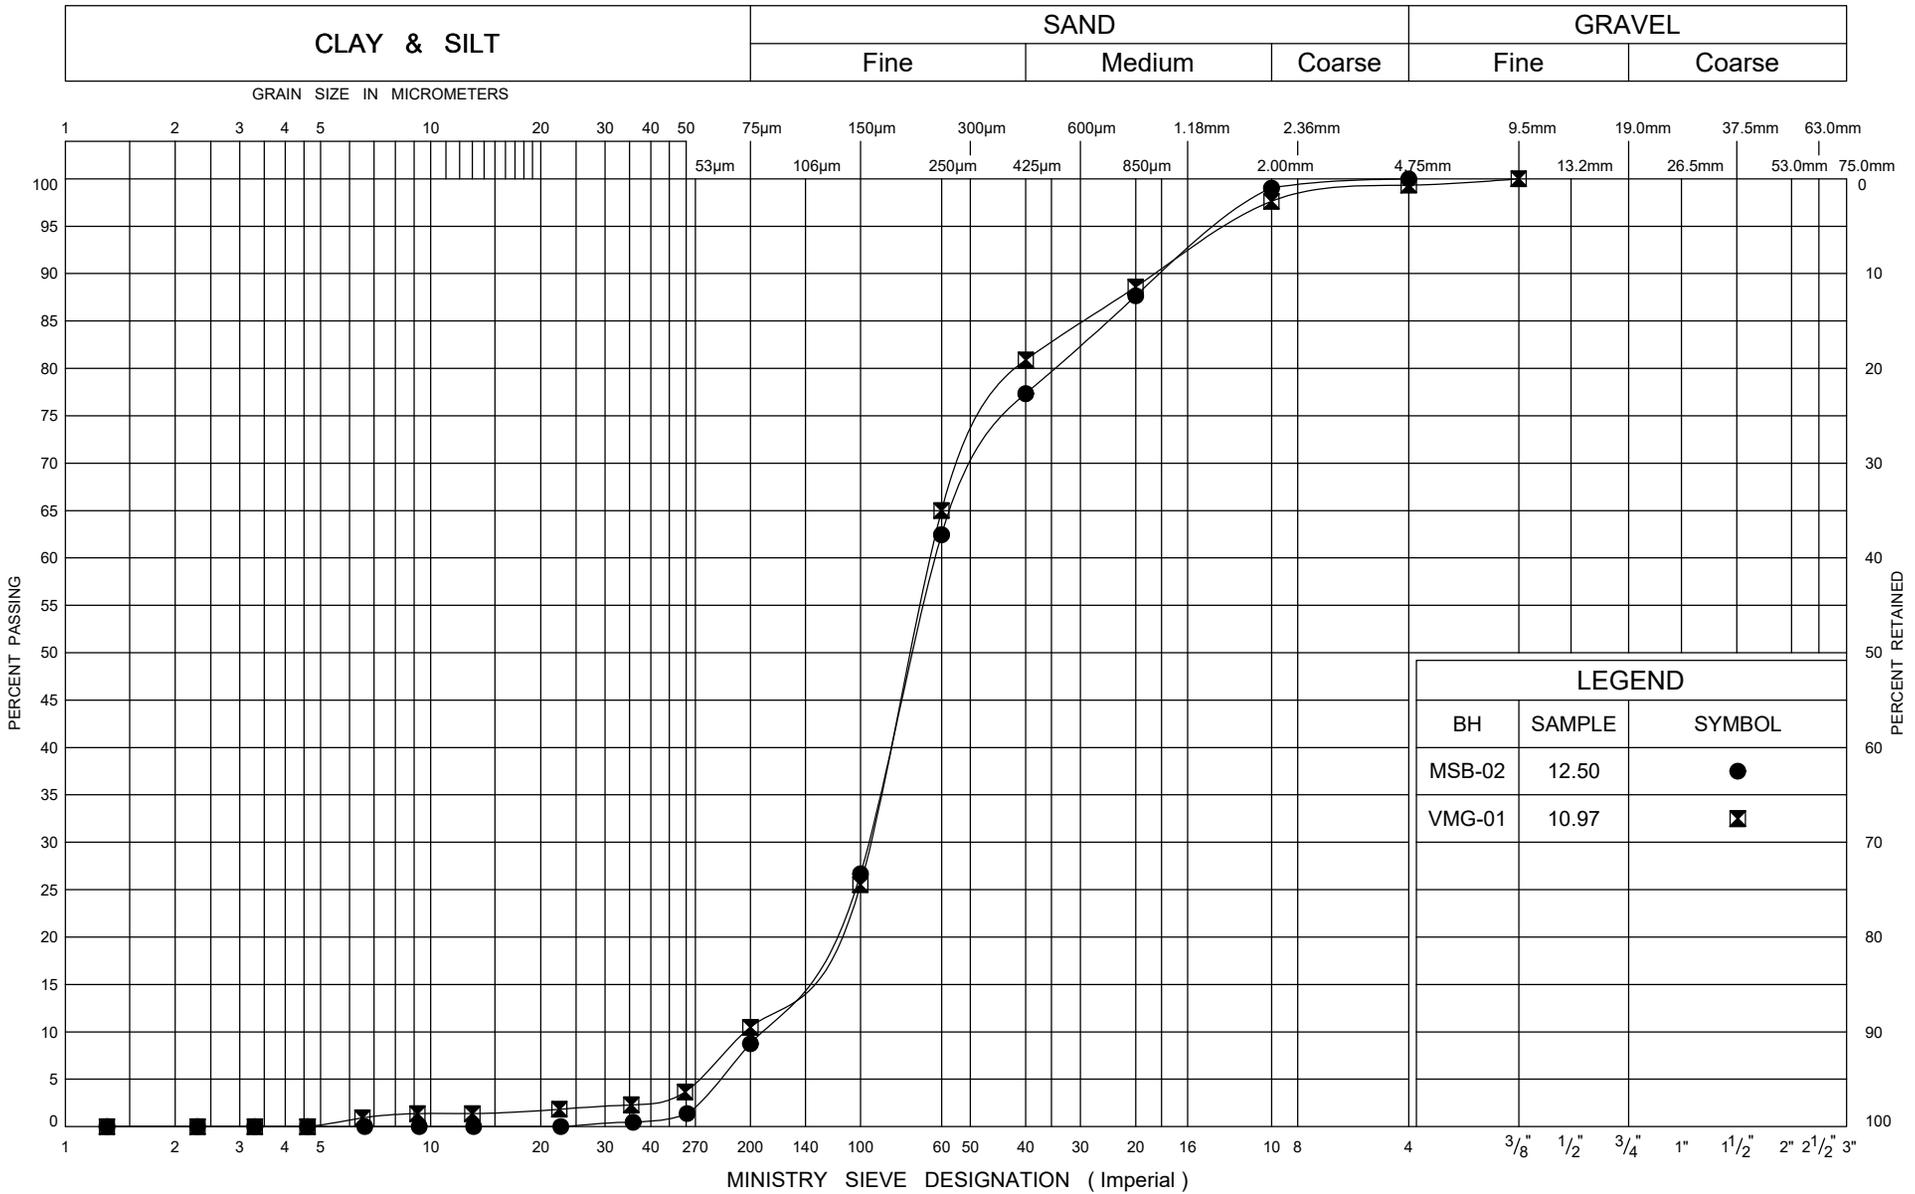


LEGEND		
BH	SAMPLE	SYMBOL
MSB-02	12.50	●
VMG-01	10.97	⊠

ONTARIO MOT GRAIN SIZE 2 MTO-36708.GPJ ONTARIO MOT.GDT 6/19/23



GRAIN SIZE DISTRIBUTION SAND

FIG No B-4
G.W.P. 4044-22-00

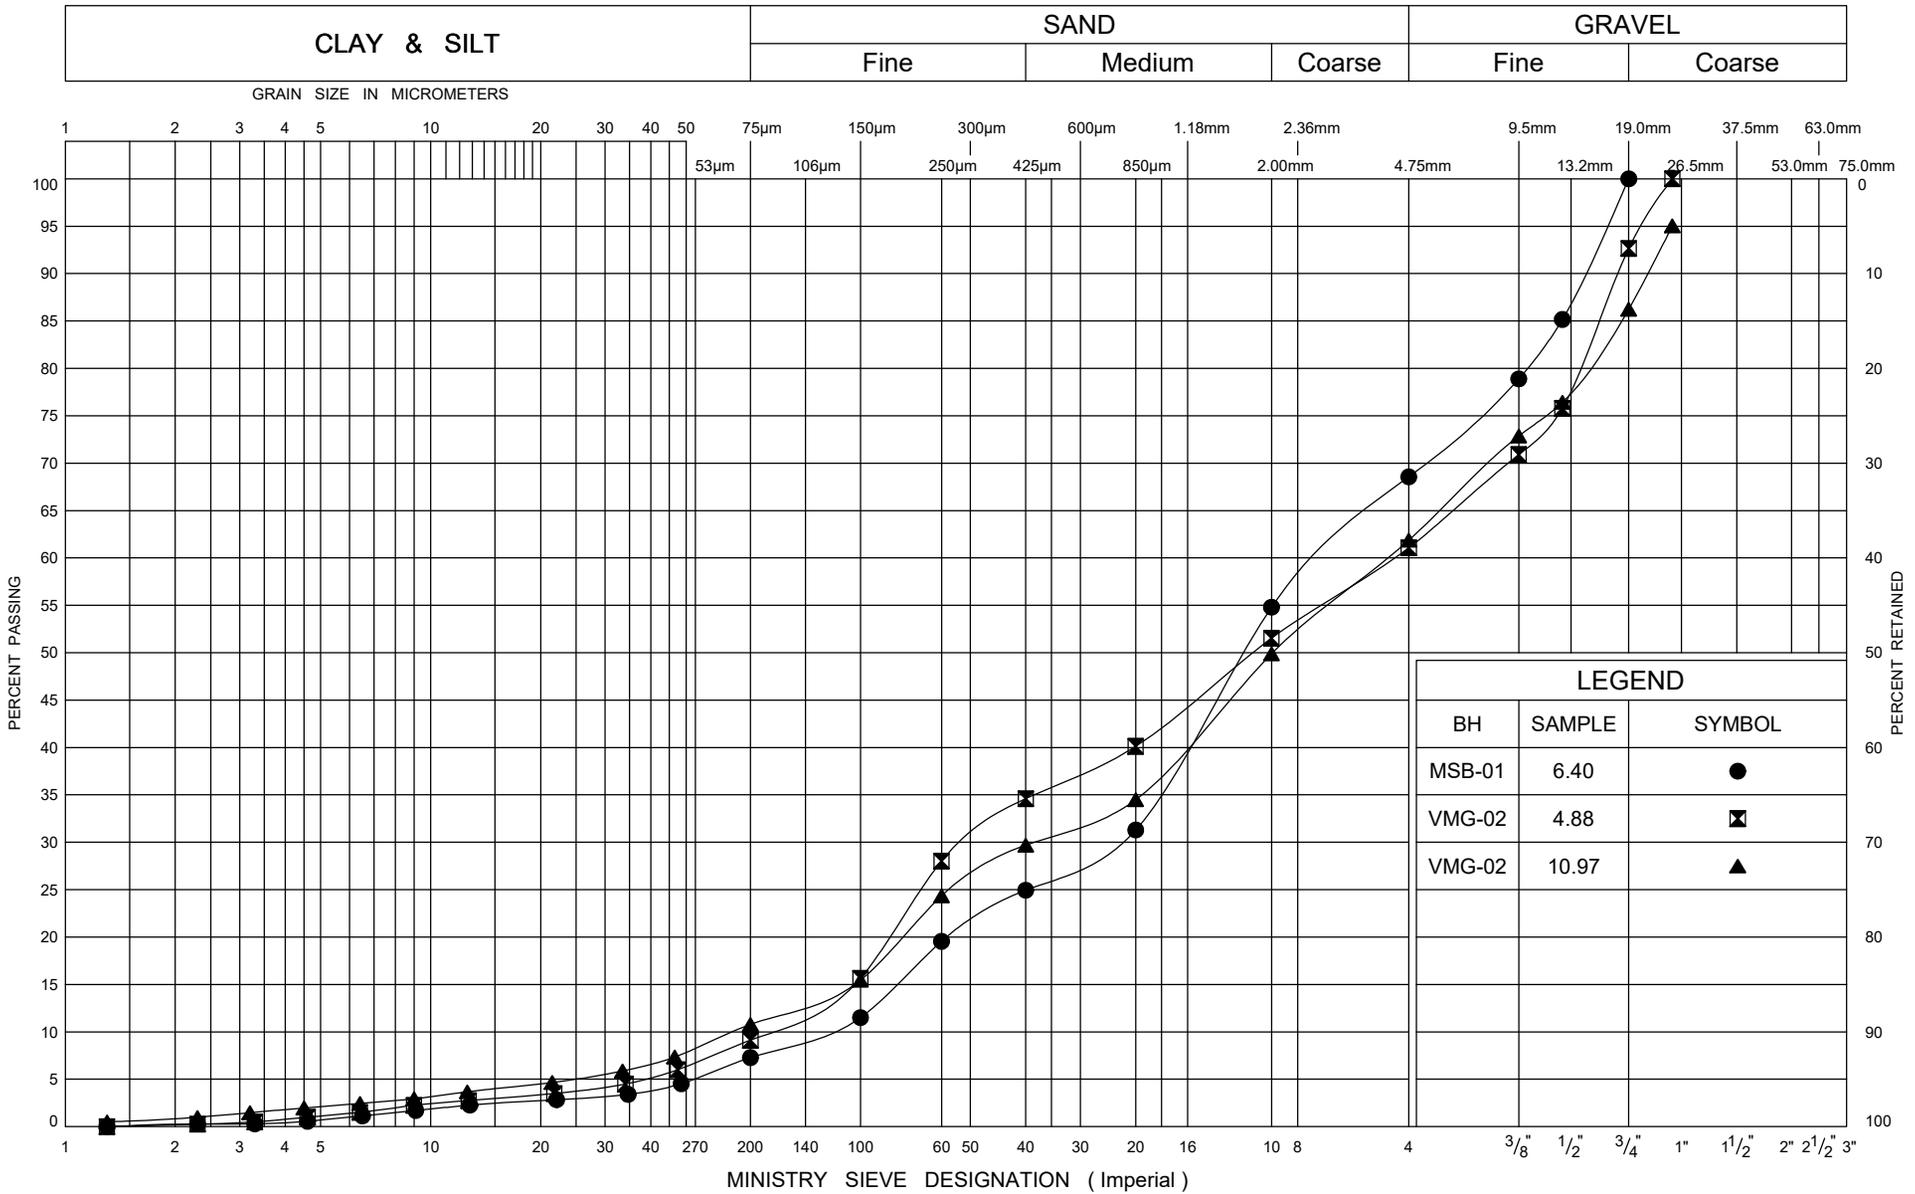

ONTARIO MOT GRAIN SIZE 2 MTO-36708.GPJ ONTARIO MOT.GDT 6/19/23



GRAIN SIZE DISTRIBUTION
SAND and GRAVEL

FIG No B-5

G.W.P. 4044-22-00



FINAL REPORT

CA40119-JUN23 R1

36708, Hwy 35 Patrol Yard

Prepared for

Thurber Engineering Ltd.

First Page

CLIENT DETAILS

Client: Thurber Engineering Ltd.
 Address: 103, 2010 Winston Park Drive
 Oakville, ON
 L6H 5R7, Canada
 Contact: Ali Rajaei
 Telephone:
 Facsimile:
 Email: arajaei@thurber.ca; jzoldy@thurber.ca
 Project: 36708, Hwy 35 Patrol Yard
 Order Number:
 Samples: Soil (2)

LABORATORY DETAILS

Project Specialist: Jill Campbell, B.Sc.,GISAS
 Laboratory: SGS Canada Inc.
 Address: 185 Concession St., Lakefield ON, K0L 2H0
 Telephone: 2165
 Facsimile: 705-652-6365
 Email: jill.campbell@sgs.com
 SGS Reference: CA40119-JUN23
 Received: 06/14/2023
 Approved: 06/22/2023
 Report Number: CA40119-JUN23 R1
 Date Reported: 06/22/2023

COMMENTS

Temperature of Sample upon Receipt: 9 degrees C
 Cooling Agent Present: Yes
 Custody Seal Present: Yes

Chain of Custody Number: n/a

Corrosivity Index is based on the American Water Works Corrosivity Scale according to AWWA C-105. An index greater than 10 indicates the soil matrix may be corrosive to cast iron alloys.

SIGNATORIES

Jill Campbell, B.Sc.,GISAS



TABLE OF CONTENTS

First Page.....	1-2
Index.....	3
Results.....	4
QC Summary.....	5-6
Legend.....	7
Annexes.....	8



FINAL REPORT

CA40119-JUN23 R1

Client: Thurber Engineering Ltd.

Project: 36708, Hwy 35 Patrol Yard

Project Manager: Ali Rajaei

Samplers: Ali Rajaei

MATRIX: SOIL

Sample Number	5	6
Sample Name	VMB-02/SS3	MSB-02/SS2
Sample Matrix	Soil	Soil
Sample Date	31/05/2023	31/05/2023

Parameter	Units	RL	Result	Result
-----------	-------	----	--------	--------

Corrosivity Index

Corrosivity Index	none	1	4	1
Soil Redox Potential	mV	no	214	207
Sulphide (Na ₂ CO ₃)	%	0.04	< 0.04	< 0.04
pH	pH Units	0.05	8.82	7.87
Resistivity (calculated)	ohms.cm	-9999	20800	83300

General Chemistry

Conductivity	uS/cm	2	48	12
--------------	-------	---	----	----

Metals and Inorganics

Moisture Content	%	0.1	5.8	8.8
Sulphate	µg/g	0.4	< 0.4	< 0.4

Other (ORP)

Chloride	µg/g	0.4	1.1	0.6
----------	------	-----	-----	-----

QC SUMMARY

Anions by IC

Method: EPA300/MA300-Ions1.3 | Internal ref.: ME-CA-IENVIIC-LAK-AN-001

Parameter	QC batch Reference	Units	RL	Method Blank	Duplicate		LCS/Spike Blank			Matrix Spike / Ref.		
					RPD	AC (%)	Spike Recovery (%)	Recovery Limits (%)		Spike Recovery (%)	Recovery Limits (%)	
								Low	High		Low	High
Chloride	DIO0434-JUN23	µg/g	0.4	<0.4	1	35	98	80	120	97	75	125
Sulphate	DIO0434-JUN23	µg/g	0.4	<0.4	1	35	98	80	120	96	75	125

Carbon/Sulphur

Method: ASTM E1915-07A | Internal ref.: ME-CA-IENVIARD-LAK-AN-020

Parameter	QC batch Reference	Units	RL	Method Blank	Duplicate		LCS/Spike Blank			Matrix Spike / Ref.		
					RPD	AC (%)	Spike Recovery (%)	Recovery Limits (%)		Spike Recovery (%)	Recovery Limits (%)	
								Low	High		Low	High
Sulphide (Na ₂ CO ₃)	ECS0039-JUN23	%	0.04	< 0.04	ND	20	92	80	120			

Conductivity

Method: SM 2510 | Internal ref.: ME-CA-IENVIEWL-LAK-AN-006

Parameter	QC batch Reference	Units	RL	Method Blank	Duplicate		LCS/Spike Blank			Matrix Spike / Ref.		
					RPD	AC (%)	Spike Recovery (%)	Recovery Limits (%)		Spike Recovery (%)	Recovery Limits (%)	
								Low	High		Low	High
Conductivity	EWL0364-JUN23	uS/cm	2	< 2	0	20	100	90	110	NA		



FINAL REPORT

CA40119-JUN23 R1

QC SUMMARY

pH

Method: SM 4500 | Internal ref.: ME-CA-ENVIEWL-LAK-AN-001

Parameter	QC batch Reference	Units	RL	Method Blank	Duplicate		LCS/Spike Blank			Matrix Spike / Ref.		
					RPD	AC (%)	Spike Recovery (%)	Recovery Limits (%)		Spike Recovery (%)	Recovery Limits (%)	
								Low	High		Low	High
pH	EWL0364-JUN23	pH Units	0.05	NA	0		100			NA		

Method Blank: a blank matrix that is carried through the entire analytical procedure. Used to assess laboratory contamination.

Duplicate: Paired analysis of a separate portion of the same sample that is carried through the entire analytical procedure. Used to evaluate measurement precision.

LCS/Spike Blank: Laboratory control sample or spike blank refer to a blank matrix to which a known amount of analyte has been added. Used to evaluate analyte recovery and laboratory accuracy without sample matrix effects.

Matrix Spike: A sample to which a known amount of the analyte of interest has been added. Used to evaluate laboratory accuracy with sample matrix effects.

Reference Material: a material or substance matrix matched to the samples that contains a known amount of the analyte of interest. A reference material may be used in place of a matrix spike.

RL: Reporting limit

RPD: Relative percent difference

AC: Acceptance criteria

Multielement Scan Qualifier: as the number of analytes in a scan increases, so does the chance of a limit exceedance by random chance as opposed to a real method problem. Thus, in multielement scans, for the LCS and matrix spike, up to 10% of the analytes may exceed the quoted limits by up to 10% absolute and the spike is considered acceptable.

Duplicate Qualifier: for duplicates as the measured result approaches the RL, the uncertainty associated with the value increases dramatically, thus duplicate acceptance limits apply only where the average of the two duplicates is greater than five times the RL.

Matrix Spike Qualifier: for matrix spikes, as the concentration of the native analyte increases, the uncertainty of the matrix spike recovery increases. Thus, the matrix spike acceptance limits apply only when the concentration of the matrix spike is greater than or equal to the concentration of the native analyte.

LEGEND

FOOTNOTES

NSS Insufficient sample for analysis.
RL Reporting Limit.
 ↑ Reporting limit raised.
 ↓ Reporting limit lowered.
NA The sample was not analysed for this analyte
ND Non Detect

Results relate only to the sample tested.

Data reported represent the sample as submitted to SGS. Solid samples expressed on a dry weight basis.

"Temperature Upon Receipt" is representative of the whole shipment and may not reflect the temperature of individual samples.

Analysis conducted on samples submitted pursuant to or as part of Reg. 153/04, are in accordance to the "Protocol for Analytical Methods Used in the Assessment of Properties under Part XV.1 of the Environmental Protection Act and Excess Soil Quality" published by the Ministry and dated March 9, 2004 as amended.

SGS provides criteria information (such as regulatory or guideline limits and summary of limit exceedances) as a service. Every attempt is made to ensure the criteria information in this report is accurate and current, however, it is not guaranteed. Comparison to the most current criteria is the responsibility of the client and SGS assumes no responsibility for the accuracy of the criteria levels indicated.

SGS Canada Inc. statement of conformity decision rule does not consider uncertainty when analytical results are compared to a specified standard or regulation.

This document is issued, on the Client's behalf, by the Company under its General Conditions of Service available on request and accessible at http://www.sgs.com/terms_and_conditions.htm.

The Client's attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any other holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. Reproduction of this analytical report in full or in part is prohibited.

This report supersedes all previous versions.

-- End of Analytical Report --



Photograph #1 – General view of the site. The site is a vacant land with concrete fencing posts and barbed wire around the site. Track-mounted drill rig in the background.



Photograph #2 – Another view of the site and barbed fence. Looking southeast.



Photograph #3 – Looking east. Monitoring well is installed in the area of the proposed stormwater management pond (Borehole SWMP-02).



Photograph #4 – Looking east. Monitoring well is installed in the area of the proposed underground water storage tanks (Borehole FST-01).

Site Photographs



Photograph #5 – Test pit excavation to perform in-situ infiltration (Guelph permeameter) test at the proposed stormwater management pond location (Test Pit TP-01).



Photograph #6 – Looking southeast. Backfilled test pit (Test Pit TP-01).



APPENDIX C

- Hydrogeological Test Results




Slug Test Analysis Report

Project: Hwy 35 MTO Patrol Yard

Number: 36708

Client: Dillon Consulting Limited

Location: Kawartha Lakes	Slug Test: FS-01	Test Well: FS-01
Test Conducted by: KI		Test Date: 2023-06-08
Analysis Performed by: YC	Time-Drawdown Plot	Analysis Date: 2023-07-12
Aquifer Thickness:		

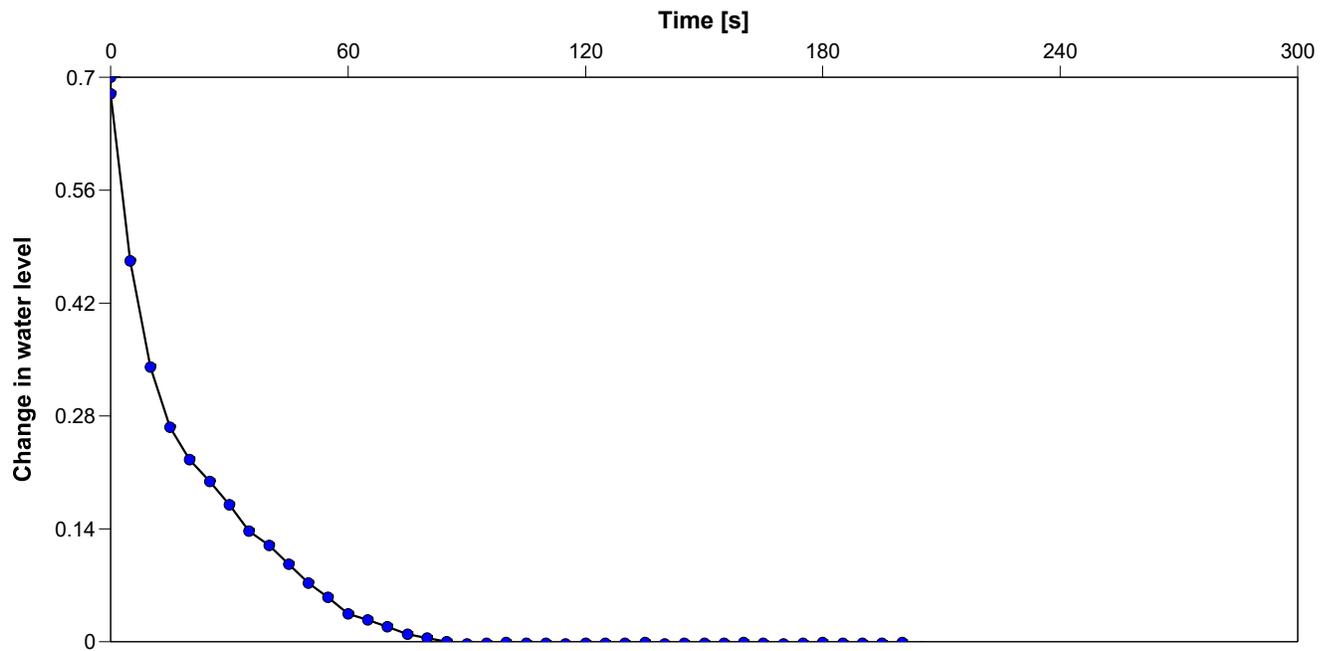




Slug Test Analysis Report

Project: Hwy 35 MTO Patrol Yard

Number: 36708

Client: Dillon Consulting Limited

Location: Kawartha Lakes	Slug Test: SWMP-02	Test Well: SWMP-02
Test Conducted by: KI		Test Date: 2023-06-08
Analysis Performed by:	Time-Drawdown Plot	Analysis Date: 2023-07-12
Aquifer Thickness:		

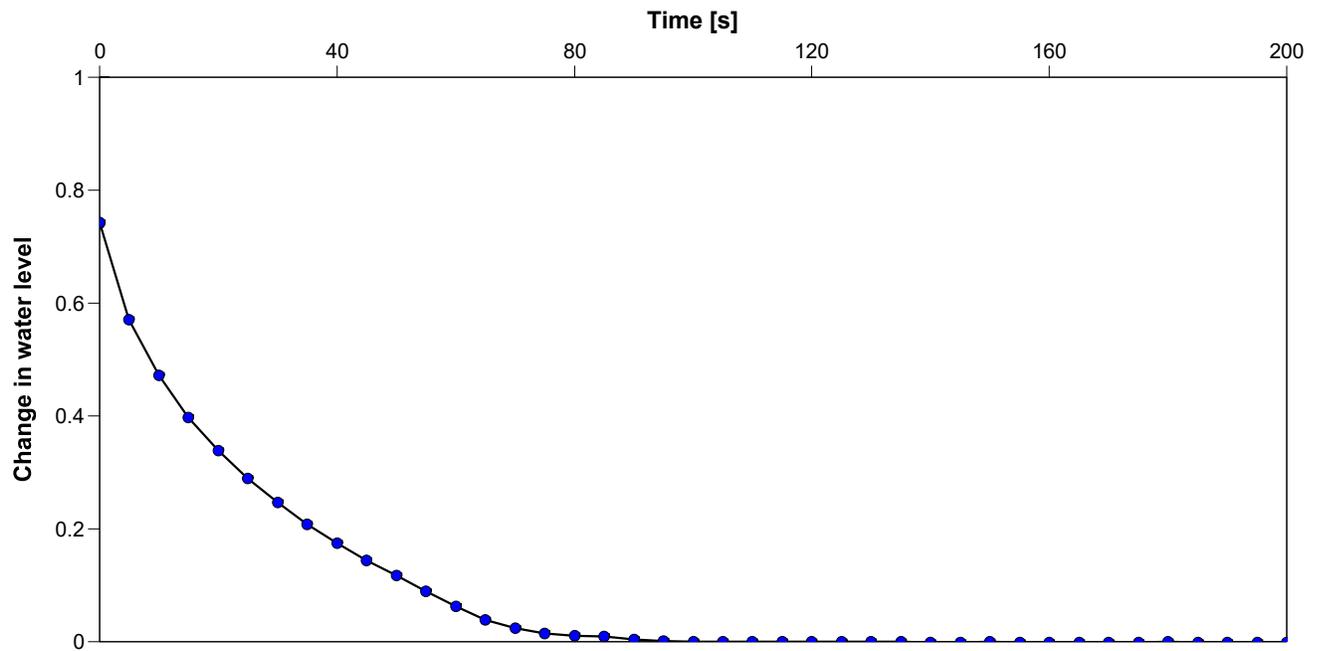

Saturated Hydraulic Copnductivity Calculations

Project:	Highway 35 MTO Patrol Yard
Number:	36708
Performed by:	KI/ YC
Test ID:	0.5 m Deep Test Pit, 1st test, H1=5 cm.
Test Pit Easting (m):	-
Test Depth (mbgs):	0.70
Soil Description:	-

Test Date:	2020-06-07
Client:	Dillon Consulting Ltd.
Checked by:	DH
Soil Sample ID:	-
Test Pit Northing (m):	-
Test Elevation (masl):	-

Reservoir Type (enter "1" for Combined and "2" for Inner reservoir): **1**
 Enter water Head Height ("H" in cm): **5**
 Enter the Borehole Radius ("a" in cm): **3**

Enter the soil texture-structure category (enter one of the below numbers): **3**

1. Compacted, Structure-less, clayey or silty materials such as landfill caps and liners, lacustrine or marine sediments, etc.
2. Soils which are both fine textured (clayey or silty) and unstructured; may also include some fine sands.
3. Most structured soils from clays through loams; also includes unstructured medium and fine sands. The category most frequently applicable for agricultural soils.
4. Coarse and gravely sands; may also include some highly structured soils with large and/or numerous cracks, macropors, etc

Steady State Rate of Water Level Change ("R" in cm/min): **1.3000**

Res Type 35.22
 H 5
 a 3
 H/a 1.667
 a* 0.12
 C0.01 0.809
 C0.04 0.842
 C0.12 0.803
 C0.36 0.803
 C 0.803
 R 1.300
 Q 0.763
 pi 3.142

$\alpha^* = 0.12 \text{ (cm}^{-1}\text{)}$

$C = 0.8031543$


$Q = 0.7631$

$K_{fs} =$
1.4E-03 cm/sec
8.3E-02 cm/min
1.4E-05 m/sec
3.3E-02 inch/min
5.5E-04 inch/sec

$\Phi_m = 1.2E-02 \text{ (cm}^2\text{/min)}$

Input

Result

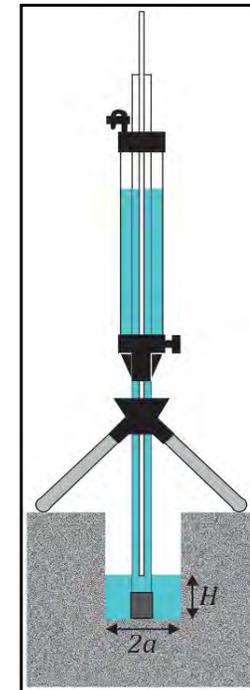

Saturated Hydraulic Copnductivity Calculations

Project:	Highway 35 MTO Patrol Yard
Number:	36708
Performed by:	KI/ YC
Test ID:	0.5 m Deep Test Pit, 1st test, H2=10 cm.
Test Pit Easting (m):	-
Test Depth (mbgs):	0.70
Soil Description:	-

Test Date:	2020-06-07
Client:	Dillon Consulting Ltd.
Checked by:	DH
Soil Sample ID:	-
Test Pit Northing (m):	-
Test Elevation (masl):	-

Reservoir Type (enter "1" for Combined and "2" for Inner reservoir): **1**
 Enter water Head Height ("H" in cm): **10**
 Enter the Borehole Radius ("a" in cm): **3**

Enter the soil texture-structure category (enter one of the below numbers): **3**

1. Compacted, Structure-less, clayey or silty materials such as landfill caps and liners, lacustrine or marine sediments, etc.
2. Soils which are both fine textured (clayey or silty) and unstructured; may also include some fine sands.
3. Most structured soils from clays through loams; also includes unstructured medium and fine sands. The category most frequently applicable for agricultural soils.
4. Coarse and gravely sands; may also include some highly structured soils with large and/or numerous cracks, macropors, etc

Steady State Rate of Water Level Change ("R" in cm/min): **1.7000**

Res Type 35.22
 H 10
 a 3
 H/a 3.333
 a* 0.12
 C0.01 1.218
 C0.04 1.29
 C0.12 1.288
 C0.36 1.288
 C 1.288
 R 1.700
 Q 0.998
 pi 3.142

$\alpha^* = 0.12 \text{ (cm}^{-1}\text{)}$

$C = 1.2875428$


$Q = 0.9979$

$K_{fs} = 1.1E-03 \text{ cm/sec}$
 $6.5E-02 \text{ cm/min}$
 $1.1E-05 \text{ m/sec}$
 $2.6E-02 \text{ inch/min}$
 $4.3E-04 \text{ inch/sec}$

$\Phi_m = 9.0E-03 \text{ (cm}^2\text{/min)}$

Input

Result

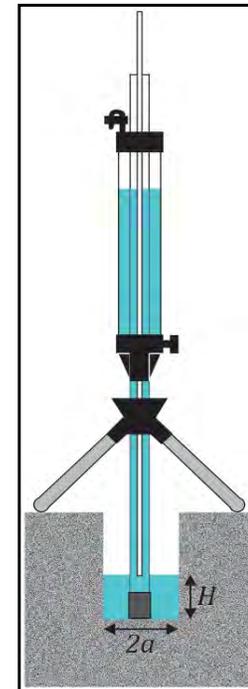

Saturated Hydraulic Copnductivity Calculations

Project:	Highway 35 MTO Patrol Yard
Number:	36708
Performed by:	KI/ YC
Test ID:	0.5 m Deep Test Pit, 2nd test, H1=10 cm.
Test Pit Easting (m):	-
Test Depth (mbgs):	0.70
Soil Description:	-

Test Date:	2020-06-07
Client:	Dillon Consulting Ltd.
Checked by:	DH
Soil Sample ID:	-
Test Pit Northing (m):	-
Test Elevation (masl):	-

Reservoir Type (enter "1" for Combined and "2" for Inner reservoir): **1**
 Enter water Head Height ("H" in cm): **10**
 Enter the Borehole Radius ("a" in cm): **3**

Enter the soil texture-structure category (enter one of the below numbers): **3**

1. Compacted, Structure-less, clayey or silty materials such as landfill caps and liners, lacustrine or marine sediments, etc.
2. Soils which are both fine textured (clayey or silty) and unstructured; may also include some fine sands.
3. Most structured soils from clays through loams; also includes unstructured medium and fine sands. The category most frequently applicable for agricultural soils.
4. Coarse and gravely sands; may also include some highly structured soils with large and/or numerous cracks, macropors, etc

Steady State Rate of Water Level Change ("R" in cm/min): **0.4000**

Res Type 35.22
 H 10
 a 3
 H/a 3.333
 a* 0.12
 C0.01 1.218
 C0.04 1.29
 C0.12 1.288
 C0.36 1.288
 C 1.288
 R 0.400
 Q 0.235
 pi 3.142

$$\alpha^* = 0.12 \text{ (cm}^{-1}\text{)}$$

$$C = 1.2875428$$


$$Q = 0.2348$$

$$K_{fs} = \begin{matrix} 2.5E-04 & \text{cm/sec} \\ 1.5E-02 & \text{cm/min} \\ 2.5E-06 & \text{m/sec} \\ 6.0E-03 & \text{inch/min} \\ 1.0E-04 & \text{inch/sec} \end{matrix}$$

$$\Phi_m = 2.1E-03 \text{ (cm}^2\text{/min)}$$

Input

Result

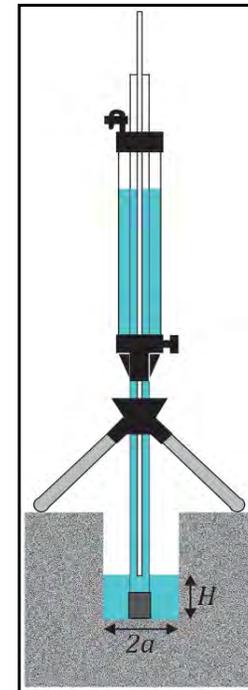

Saturated Hydraulic Copnductivity Calculations

Project:	Highway 35 MTO Patrol Yard
Number:	36708
Performed by:	KI/ YC
Test ID:	0.5 m Deep Test Pit, 2nd test, H2=20 cm.
Test Pit Easting (m):	-
Test Depth (mbgs):	0.70
Soil Description:	-

Test Date:	2020-06-07
Client:	Dillon Consulting Ltd.
Checked by:	DH
Soil Sample ID:	-
Test Pit Northing (m):	-
Test Elevation (masl):	-

Reservoir Type (enter "1" for Combined and "2" for Inner reservoir): **1**
 Enter water Head Height ("H" in cm): **20**
 Enter the Borehole Radius ("a" in cm): **3**

Enter the soil texture-structure category (enter one of the below numbers): **3**

1. Compacted, Structure-less, clayey or silty materials such as landfill caps and liners, lacustrine or marine sediments, etc.
2. Soils which are both fine textured (clayey or silty) and unstructured; may also include some fine sands.
3. Most structured soils from clays through loams; also includes unstructured medium and fine sands. The category most frequently applicable for agricultural soils.
4. Coarse and gravely sands; may also include some highly structured soils with large and/or numerous cracks, macropors, etc

Steady State Rate of Water Level Change ("R" in cm/min): **1.1000**

Res Type 35.22
 H 20
 a 3
 H/a 6.667
 a* 0.12
 C0.01 1.755
 C0.04 1.903
 C0.12 1.98
 C0.36 1.98
 C 1.98
 R 1.100
 Q 0.646
 pi 3.142

$$\alpha^* = 0.12 \text{ (cm}^{-1}\text{)}$$

$$C = 1.9801925$$


$$Q = 0.6457$$

$$K_{fs} = \begin{matrix} 3.5E-04 & \text{cm/sec} \\ 2.1E-02 & \text{cm/min} \\ 3.5E-06 & \text{m/sec} \\ 8.4E-03 & \text{inch/min} \\ 1.4E-04 & \text{inch/sec} \end{matrix}$$

$$\Phi_m = 2.9E-03 \text{ (cm}^2\text{/min)}$$

Input

Result

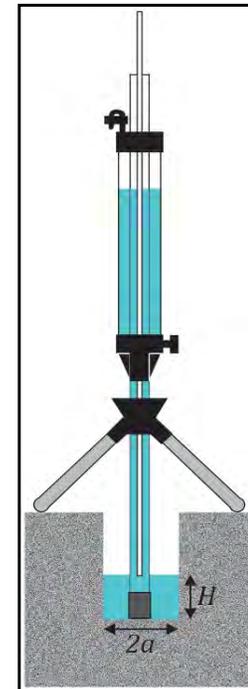

Saturated Hydraulic Copnductivity Calculations

Project:	Highway 35 MTO Patrol Yard
Number:	36708
Performed by:	KI/ YC
Test ID:	2 m Deep Test Pit, 1st test, H1=5 cm.
Test Pit Easting (m):	-
Test Depth (mbgs):	2.40
Soil Description:	-

Test Date:	2020-06-07
Client:	Dillon Consulting Ltd.
Checked by:	DH
Soil Sample ID:	-
Test Pit Northing (m):	-
Test Elevation (masl):	-

Reservoir Type (enter "1" for Combined and "2" for Inner reservoir): **1**
 Enter water Head Height ("H" in cm): **5**
 Enter the Borehole Radius ("a" in cm): **3**

Enter the soil texture-structure category (enter one of the below numbers): **3**

1. Compacted, Structure-less, clayey or silty materials such as landfill caps and liners, lacustrine or marine sediments, etc.
2. Soils which are both fine textured (clayey or silty) and unstructured; may also include some fine sands.
3. Most structured soils from clays through loams; also includes unstructured medium and fine sands. The category most frequently applicable for agricultural soils.
4. Coarse and gravely sands; may also include some highly structured soils with large and/or numerous cracks, macropors, etc

Steady State Rate of Water Level Change ("R" in cm/min): **8.0000**

Res Type 35.22
 H 5
 a 3
 H/a 1.667
 a* 0.12
 C0.01 0.809
 C0.04 0.842
 C0.12 0.803
 C0.36 0.803
 C 0.803
 R 8.000
 Q 4.696
 pi 3.142

$$\alpha^* = 0.12 \text{ (cm}^{-1}\text{)}$$

$$C = 0.8031543$$


$$Q = 4.696$$

$$K_{fs} = \begin{matrix} 8.5E-03 & \text{cm/sec} \\ 5.1E-01 & \text{cm/min} \\ 8.5E-05 & \text{m/sec} \\ 2.0E-01 & \text{inch/min} \\ 3.4E-03 & \text{inch/sec} \end{matrix}$$

$$\Phi_m = 7.1E-02 \text{ (cm}^2\text{/min)}$$

Input

Result

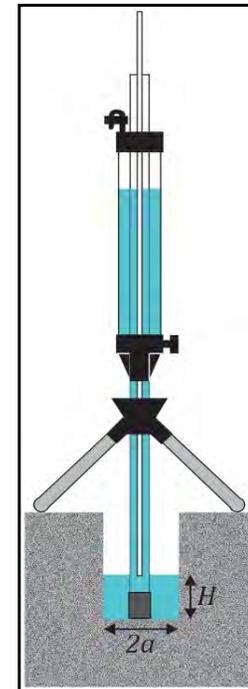

Saturated Hydraulic Copnductivity Calculations

Project:	Highway 35 MTO Patrol Yard
Number:	36708
Performed by:	KI/ YC
Test ID:	2 m Deep Test Pit, 1st test, H2=10 cm.
Test Pit Easting (m):	-
Test Depth (mbgs):	2.40
Soil Description:	-

Test Date:	2020-06-07
Client:	Dillon Consulting Ltd.
Checked by:	DH
Soil Sample ID:	-
Test Pit Northing (m):	-
Test Elevation (masl):	-

Reservoir Type (enter "1" for Combined and "2" for Inner reservoir): **1**
 Enter water Head Height ("H" in cm): **10**
 Enter the Borehole Radius ("a" in cm): **3**

Enter the soil texture-structure category (enter one of the below numbers): **3**

1. Compacted, Structure-less, clayey or silty materials such as landfill caps and liners, lacustrine or marine sediments, etc.
2. Soils which are both fine textured (clayey or silty) and unstructured; may also include some fine sands.
3. Most structured soils from clays through loams; also includes unstructured medium and fine sands. The category most frequently applicable for agricultural soils.
4. Coarse and gravely sands; may also include some highly structured soils with large and/or numerous cracks, macropors, etc

Steady State Rate of Water Level Change ("R" in cm/min): **18.0000**

Res Type 35.22
 H 10
 a 3
 H/a 3.333
 a* 0.12
 C0.01 1.218
 C0.04 1.29
 C0.12 1.288
 C0.36 1.288
 C 1.288
 R 18.000
 Q 10.57
 pi 3.142

$\alpha^* = 0.12 \text{ (cm}^{-1}\text{)}$

$C = 1.2875428$


$Q = 10.566$

$K_{fs} =$
1.1E-02 cm/sec
6.9E-01 cm/min
1.1E-04 m/sec
2.7E-01 inch/min
4.5E-03 inch/sec

$\Phi_m = 9.5E-02 \text{ (cm}^2\text{/min)}$

Input

Result

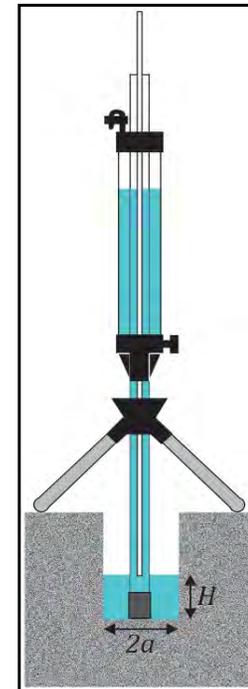

Saturated Hydraulic Copnductivity Calculations

Project:	Highway 35 MTO Patrol Yard
Number:	36708
Performed by:	KI/ YC
Test ID:	2 m Deep Test Pit, 2nd test, H1=5 cm.
Test Pit Easting (m):	-
Test Depth (mbgs):	2.40
Soil Description:	-

Test Date:	2020-06-07
Client:	Dillon Consulting Ltd.
Checked by:	DH
Soil Sample ID:	-
Test Pit Northing (m):	-
Test Elevation (masl):	-

Reservoir Type (enter "1" for Combined and "2" for Inner reservoir): **1**
 Enter water Head Height ("H" in cm): **5**
 Enter the Borehole Radius ("a" in cm): **3**

Enter the soil texture-structure category (enter one of the below numbers): **3**

1. Compacted, Structure-less, clayey or silty materials such as landfill caps and liners, lacustrine or marine sediments, etc.
2. Soils which are both fine textured (clayey or silty) and unstructured; may also include some fine sands.
3. Most structured soils from clays through loams; also includes unstructured medium and fine sands. The category most frequently applicable for agricultural soils.
4. Coarse and gravely sands; may also include some highly structured soils with large and/or numerous cracks, macropors, etc

Steady State Rate of Water Level Change ("R" in cm/min): **1.5000**

Res Type 35.22
 H 5
 a 3
 H/a 1.667
 a* 0.12
 C0.01 0.809
 C0.04 0.842
 C0.12 0.803
 C0.36 0.803
 C 0.803
 R 1.500
 Q 0.881
 pi 3.142

$$\alpha^* = 0.12 \text{ (cm}^{-1}\text{)}$$

$$C = 0.8031543$$


$$Q = 0.8805$$

$$K_{fs} = \begin{matrix} 1.6E-03 & \text{cm/sec} \\ 9.6E-02 & \text{cm/min} \\ 1.6E-05 & \text{m/sec} \\ 3.8E-02 & \text{inch/min} \\ 6.3E-04 & \text{inch/sec} \end{matrix}$$

$$\Phi_m = 1.3E-02 \text{ (cm}^2\text{/min)}$$

Input

Result

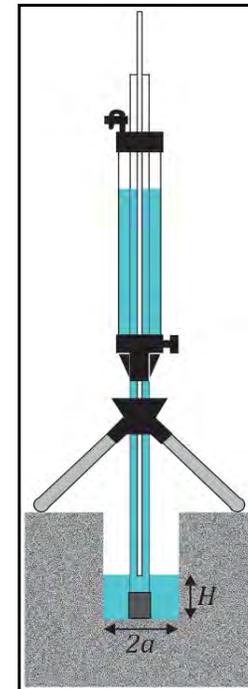

Saturated Hydraulic Copnductivity Calculations

Project:	Highway 35 MTO Patrol Yard
Number:	36708
Performed by:	KI/ YC
Test ID:	2 m Deep Test Pit, 2nd test, H2=10 cm.
Test Pit Easting (m):	-
Test Depth (mbgs):	2.40
Soil Description:	-

Test Date:	2020-06-07
Client:	Dillon Consulting Ltd.
Checked by:	DH
Soil Sample ID:	-
Test Pit Northing (m):	-
Test Elevation (masl):	-

Reservoir Type (enter "1" for Combined and "2" for Inner reservoir): **1**
 Enter water Head Height ("H" in cm): **10**
 Enter the Borehole Radius ("a" in cm): **3**

Enter the soil texture-structure category (enter one of the below numbers): **3**

1. Compacted, Structure-less, clayey or silty materials such as landfill caps and liners, lacustrine or marine sediments, etc.
2. Soils which are both fine textured (clayey or silty) and unstructured; may also include some fine sands.
3. Most structured soils from clays through loams; also includes unstructured medium and fine sands. The category most frequently applicable for agricultural soils.
4. Coarse and gravely sands; may also include some highly structured soils with large and/or numerous cracks, macropors, etc

Steady State Rate of Water Level Change ("R" in cm/min): **6.0000**

Res Type 35.22
 H 10
 a 3
 H/a 3.333
 a* 0.12
 C0.01 1.218
 C0.04 1.29
 C0.12 1.288
 C0.36 1.288
 C 1.288
 R 6.000
 Q 3.522
 pi 3.142

$$\alpha^* = 0.12 \text{ (cm}^{-1}\text{)}$$

$$C = 1.2875428$$

$$Q = 3.522$$

$$K_{fs} = \begin{matrix} 3.8E-03 & \text{cm/sec} \\ 2.3E-01 & \text{cm/min} \\ 3.8E-05 & \text{m/sec} \\ 9.0E-02 & \text{inch/min} \\ 1.5E-03 & \text{inch/sec} \end{matrix}$$

$$\Phi_m = 3.2E-02 \text{ (cm}^2\text{/min)}$$

Input

Result

