



THURBER ENGINEERING LTD.

**FOUNDATION INVESTIGATION REPORT
CULVERT 12+739 FENWICK
HIGHWAY 17 NEAR GOULAIS RIVER
SAULT STE MARIE AREA
G.W.P. 545-00-00**

GEOCRES Number: 41K-101

Report

to

WSP Canada Inc.

Thurber Engineering Ltd.
104, 2460 Lancaster Road
Ottawa, Ontario
K1B 4S5
Phone: (613) 247-2121
Fax: (613) 247-2185

September 22, 2016
19-5308-95



TABLE OF CONTENTS

PART 1 FACTUAL INFORMATION

| | | |
|-----|--|---|
| 1 | INTRODUCTION..... | 1 |
| 2 | SITE DESCRIPTION..... | 1 |
| 3 | SITE INVESTIGATION AND FIELD TESTING | 2 |
| 4 | LABORATORY TESTING | 3 |
| 5 | DESCRIPTION OF SUBSURFACE CONDITIONS..... | 3 |
| 5.1 | General..... | 3 |
| 5.2 | Sand Fill | 3 |
| 5.3 | Embankment Clay Fill..... | 4 |
| 5.4 | Topsoil..... | 5 |
| 5.5 | Silty Sand | 5 |
| 5.6 | Silty Sandy Clay | 5 |
| 5.7 | Silty Sand with Gravel..... | 6 |
| 5.8 | Silt some Sand to Sand with Silt | 6 |
| 5.9 | Groundwater Conditions | 6 |
| 6 | MISCELLANEOUS..... | 8 |

APPENDICES

| | |
|------------|---|
| APPENDIX A | Borehole Locations and Soil Strata Drawings |
| APPENDIX B | Record of Borehole Sheets |
| APPENDIX C | Laboratory Test Results |
| APPENDIX D | Selected Photographs of Culvert Location |

**FOUNDATION INVESTIGATION REPORT
CULVERT 12+739 FENWICK
HIGHWAY 17 NEAR GOULAIS RIVER
SAULT STE MARIE AREA
G.W.P. 545-00-00**

GEOCREs Number: 41K-101

PART 1: FACTUAL INFORMATION

1 INTRODUCTION

This report presents the factual data obtained from a foundation investigation conducted by Thurber Engineering Ltd. (Thurber) of a culvert carrying drainage under Highway 17 near Goulais River, Ontario.

No previous foundation investigation information was available for the subject culvert.

The purpose of this investigation was to obtain subsurface information at the site and, based on the data obtained, to provide a model of the subsurface conditions including a borehole location plan, stratigraphic profile, records of boreholes, laboratory test results and a written description of the subsurface conditions.

Thurber was retained by WSP Canada Inc. (WSP) to carry out this foundation investigation under MTO Agreement Number 5014-E-0008.

2 SITE DESCRIPTION

The culvert site is located on Highway 17, approximately 2.8 kilometres north of the intersection of Highway 552 and Highway 17 in the Township of Fenwick. A 1.22 m diameter by 105.8 m long corrugated steel pipe culvert (CSP) is present at the site and covered with approximately 9 m of fill. The culvert provides drainage under Highway 17 and is oriented on a skew of about 45 degrees to the highway centreline. The flow in the culvert is from west to east. The invert elevation is 238.4 m at the east end and 241.5 m at the west end.

The grade of the existing Highway 17 in the vicinity of the culvert is at 250.4 m geodetic. The culvert is located within a fill section. The embankment is constructed with side slopes approximately 2.5 horizontal to 1 vertical (2.5H:1V) and approximately 3 horizontal to 1 vertical (3H:1V), corresponding to the east and west slopes respectively. The embankment slopes are

benched mid height. The lower side slopes are estimated at 2 horizontal to 1 vertical (2H:1V). The embankment fill height is approximately 12 m at the east side and approximately 8.9 m at the west side. The existing roadway includes two 3.5 m wide lanes, 2.0 m wide partially paved shoulders and 0.5 m rounding. Three cable guiderail is present on both sides of the highway. The AADT is reported to be 2650. The highway profile slopes down to the south at approximately 2.9%.

The site is located in a rural area with forests, swamps, creeks. Local topography is generally rolling. Selected photographs of the culvert site are attached in Appendix D.

The surficial geology of the area is typical of the Wisconsin glaciation. Soil cover consists primarily glaciolacustrine (clay, silt, and sand) deposits underlain by glacial till.

3 SITE INVESTIGATION AND FIELD TESTING

This borehole investigation and field testing program was carried out between January 20 and 23, 2016. The program consisted of drilling and sampling four boreholes (numbered 15-33, 15-34, 15-35, and 15-36) to depths ranging from 10.3 m to 21.9 m. Of these boreholes, one was located near the culvert inlet (15-36), one located near the culvert outlet (15-33), and two (15-34 and 15-35) were located through the embankment on opposite sides of the road near the culvert.

Prior to the start of drilling, the borehole locations were established in the field and utility clearances were obtained. The co-ordinates and elevations of the as-drilled boreholes were subsequently determined by Thurber based on elevation data provided by WSP.

A truck-mounted drill rig equipped with hollow stem augers was used to drill and sample the boreholes on the roadway, and a portable tripod drill rig was used to drill and sample the culvert inlet and outlet boreholes. Soil samples were obtained at selected intervals using a 50 mm diameter split spoon sampler in conjunction with Standard Penetration Testing (SPT). In-situ shear vane testing was performed in cohesive soils with an MTO N-sized vane.

Results of the field drilling and sampling are presented on the Record of Borehole sheets in Appendix B.

A member of Thurber's technical staff supervised the drilling and sampling operations on a full time basis. The supervisor logged the boreholes, secured the recovered soil samples in labelled containers, and transported the samples to Thurber's laboratory for further examination and testing.

The boreholes were backfilled with soil cuttings mixed with bentonite and topped to surface with the existing granular material and asphalt patch where required.

4 LABORATORY TESTING

All recovered soil samples were subjected to Visual Identification and to Natural Moisture Content determination. Selected soil samples were subjected to Grain Size Distribution analyses (sieve and hydrometer) and Atterberg Limit testing. The results of this laboratory testing program are shown on the Record of Borehole sheets in Appendix B and on the Figures in Appendix C.

5 DESCRIPTION OF SUBSURFACE CONDITIONS

5.1 General

Reference is made to the Record of Borehole sheets in Appendix B for details of the soil stratigraphy encountered in the boreholes. A stratigraphic profile for the culvert alignment is presented on the Borehole Locations and Soil Strata Drawing in Appendix A for illustrative purposes. An overall description of the stratigraphy is given in the following paragraphs; however, the factual data presented in the record of boreholes governs any interpretation of the site conditions.

In general, the subsurface conditions encountered in the boreholes consist of granular fill over clay embankment fill overlying a native silty sand deposit. Bedrock was not encountered in any of the four boreholes. More detailed descriptions of the individual strata are presented below.

5.2 Sand Fill

A layer of asphalt 120 mm in thickness was encountered at ground surface in Borehole 15-35 which was drilled through the roadway. Borehole 15-34 was drilled through the westbound gravel shoulder.

Sand with gravel to sand with silt and gravel fill extended to a depth of 2.4 m to 3.2 m below the road surface. The base of the pavement structure and the underlying granular fill was encountered at elevations ranging from 246.7 to 248.3 m. Occasional cobbles were found within this layer in Borehole 15-35.

The moisture content of the fill ranged from 4% to 7%. The ground was frozen at the time of the field investigation thus the relative density of the granular could not be determined reliably.

The results of grain size analyses conducted on two samples of the granular fill are presented on Fig. No 1 in Appendix C. The results are summarized in the following table.

| Soil Particles | % |
|-----------------------|-----------|
| Gravel | 12 and 31 |
| Sand | 79 and 57 |
| Silt and Clay | 9 and 12 |

5.3 Embankment Clay Fill

Embankment fill was encountered below the pavement base and granular fill in Boreholes 15-34 and 15-35. The thickness of the embankment fill ranged from 6.1 to 6.7 m. The base of the embankment fill was encountered at elevations ranging from 240.5 to 241.6 m.

The embankment fill was typically observed to be layers of clay and silty clay. A 0.4 m thick layer of sand with silt fill was noted below the clay fill in Borehole 15-35.

The SPT N-value for the embankment fill ranged from 4 to 21 blows per 0.3 m penetration. In-situ shear vane test results indicated undrained shear strengths ranging from 82 kPa to greater than 106 kPa; indicating a firm to very stiff consistency. The water contents of the recovered clay to silty clay embankment fill samples ranged between 21% and 32%, while the sand with silt fill in Borehole 15-35 had a moisture content of 6%. The colour of the embankment fill is brown to reddish brown.

The results of grain size analyses conducted on four samples of the fill are presented on Fig. No 2 in Appendix C. The results are summarized in the following table.

| Soil Particles | % |
|-----------------------|----------|
| Gravel | 0 |
| Sand | 2 to 5 |
| Silt | 58 to 85 |
| Clay | 11 to 37 |

Atterberg limit testing was carried out four samples of the clay to silty clay embankment fill. The samples varied and included classifications including silty clay, clay of low plasticity (CL), and clay of intermediate plasticity (CI). The results are presented on Fig. No 6 in Appendix C and summarized in the table below.

| Test | % |
|-------------------------|----------|
| Plastic Limit | 18 to 19 |
| Liquid Limit | 26 to 39 |
| Plasticity Index | 7 to 21 |

5.4 Topsoil

Topsoil, 25 mm in thickness was encountered at the inlet and outlet boreholes (15-33 and 15-36). The topsoil thickness may vary between and beyond the borehole locations, and the limited data is not suitable for estimating quantities or quality. The water content of one recovered sample of topsoil was 49%.

5.5 Silty Sand

A thin silty sand deposit was encountered in both inlet and outlet boreholes. This soil was found just below the topsoil in Boreholes 15-33 and 15-36. The thickness was found to be 0.5 m and 0.9 m and the base of the layer was at elevations 240.8 m and 241.5 m.

The SPT N-value for this deposit was 6 to 7 blows per 0.3 m penetration, indicating a loose state. The water contents of the recovered samples ranged between 8% and 15%. The colour of this deposit is brown.

5.6 Silty Sandy Clay

Silty sandy clay was encountered underlying the silty sand deposit in Borehole 15-33 and Borehole 15-36 with a thickness of 1.0 m to 1.2 m and base elevation of 239.7 m and 240.3 m, respectively. The SPT N-value in the clay deposit was 3 to 6 blows per 0.3 m penetration. In-situ shear vane test results indicated undrained shear strengths of 67 kPa; indicating a stiff consistency. A sandy silt layer with trace clay was found within this deposit in Borehole 15-36. The colour of the clay is greyish brown. The water content of the recovered clay sample was 25%.

The results of grain size analyses conducted on two samples of the clay with sandy silt are presented on Fig. No 3 in Appendix C. The results are summarized in the following table.

| Soil Particles | % |
|----------------|-----------|
| Gravel | 1 and 0 |
| Sand | 27 and 40 |
| Silt | 53 and 51 |
| Clay | 19 and 9 |

Atterberg limit testing was carried out on two samples of this deposit. In one sample the liquid limit was 40% and the plasticity index was 24% and can be classified as clay of intermediate plasticity (CI). A sample containing a sandy silt layer was determined to be non-plastic. The results are presented on Fig. No 6 in Appendix C and summarized in the table below.

| Test | % |
|------------------|-----------|
| Plastic Limit | 16 and NP |
| Liquid Limit | 40 and NA |
| Plasticity Index | 24 and NA |

5.7 Silty Sand with Gravel

A thin silty sand with gravel deposit was encountered in both inlet and outlet boreholes. This soil was found just below the silty sandy clay with sand deposit in Boreholes 15-33 and 15-36. The thickness was found to be 0.9 m and 0.6 m and the base elevation 238.8 m and 239.7 m.

The SPT N-value for this deposit was 16 to 18 blows per 0.3 m penetration, indicating a compact state. The water contents of the recovered samples ranged between 9% and 16%. The colour of this deposit is brown to grey.

5.8 Silt some Sand to Sand with Silt

A native soil deposit ranging from silt some sand to sand with silt was encountered in all boreholes. This soil was found below a silty sand with gravel layer in both inlet and outlet boreholes and below the embankment fill in 15-34 and 15-35. All boreholes were terminated within this deposit at elevations ranging from 232.1 m to 227.8 m. The deposit was more than 12.6 m thick in Borehole 15-34.

The SPT N-values for this deposit was 4 to greater than 100 blows per 0.3 m penetration, indicating a loose to very dense state. Typically the deposit was compact to dense. The water contents of the recovered samples ranged between 5% and 23%. The colour of this deposit is brown to greyish brown.

The results of a grain size analyse conducted on nine samples of the sandy silt are presented on Fig. No 4 and Fig. No 5 in Appendix C. The results are summarized in the following table.

| Soil Particles | % |
|----------------|----------|
| Gravel | 0 to 3 |
| Sand | 12 to 93 |
| Silt and Clay | 7 to 88 |

5.9 Groundwater Conditions

Groundwater was not observed in the boreholes during drilling. All four boreholes were dry upon completion of drilling. In Borehole 15-36 water was observed at a depth of 2.2 m or elevation

229.9 m on January 21, one day after completion of drilling prior to backfilling. On January 20, 2016 the top of ice was observed at elevations 241.7 m and 238.0 m just outside of the culvert at the west and east ends respectively.

Where surface water is present, the groundwater level should be assumed to coincide with the local surface or creek water level. Local high water levels and the effects of heavy rainfalls must also be taken into consideration.


6 MISCELLANEOUS

Thurber staked and/or marked the borehole locations in the field and obtained utility clearances prior to drilling.


Marathon Drilling Ltd. of Greely, Ontario, supplied and operated a truck-mounted CME 55 drill rig to carry out the drilling, sampling and in-situ testing operations on the existing highway platform. Ohlmann Geotechnical Services (OGS) Inc. of Almonte, Ontario, supplied and operated the portable drill rig.

The drilling and sampling operations in the field were supervised on a full time basis by Mr. Justin Gray E.I.T. and Mr. Chris Murray E.I.T. of Thurber. Laboratory testing was carried out by Stantec (Ottawa) in its MTO-approved laboratory.

Overall project management and direction of the field program was provided by Dr. Fred Griffiths, P.Eng. Interpretation of the field data and preparation of this report was completed by Mr. Justin Gray E.I.T. and Dr. Fred Griffiths P.Eng. The report was reviewed by Dr. P.K. Chatterji, P.Eng., a Designated Principal Contact for MTO Foundations Projects.

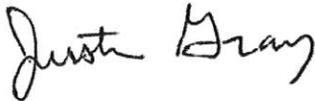

Justin A. Gray
Geotechnical E.I.T.

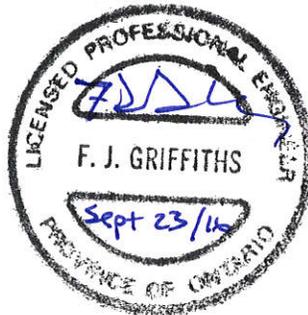

Fred J. Griffiths, P.Eng.
Senior Associate, Senior Foundations Engineer



P. K. Chatterji, P.Eng.,
Review Principal, Designated MTO Contact

Appendix A

Borehole Locations and Soil Strata Drawings

19-5308-95

Culvert 12+739
Fenwick Township, Highway 17

Appendix B

Record of Borehole Sheets

19-5308-95



SYMBOLS, ABBREVIATIONS AND TERMS USED ON TEST HOLE RECORDS

TERMINOLOGY DESCRIBING COMMON SOIL GENESIS

| | |
|---------|--|
| Topsoil | mixture of soil and humus capable of supporting vegetative growth |
| Peat | mixture of fragments of decayed organic matter |
| Till | unstratified glacial deposit which may include particles ranging in sizes from clay to boulder |
| Fill | material below the surface identified as placed by humans (excluding buried services) |

TERMINOLOGY DESCRIBING SOIL STRUCTURE:

| | |
|------------|---|
| Desiccated | having visible signs of weathering by oxidization of clay materials, shrinkage cracks, etc. |
| Fissured | having cracks, and hence a blocky structure |
| Varved | composed of alternating layers of silt and clay |
| Stratified | composed of alternating successions of different soil types, e.g. silt and sand |
| Layer | > 75 mm in thickness |
| Seam | 2 mm to 75 mm in thickness |
| Parting | < 2 mm in thickness |

RECOVERY:

For soil samples, the recovery is recorded as the length of the soil sample recovered.

N-VALUE:

Numbers in this column are the field results of the Standard Penetration Test: the number of blows of a 63.5 kg hammer falling 0.76 m, required to drive a 50 mm O.D. split spoon sampler 0.3 m into undisturbed soil. For samples where insufficient penetration was achieved and N-value cannot be presented, the number of blows are reported over the sampler penetration in millimetres (e.g. 50/75).


DYNAMIC CONE PENETRATION TEST (DCPT):

Dynamic cone penetration tests are performed using a standard 60 degree apex cone connected to an "A" size drill rods with the same standard fall height and weight as the Standard Penetration Test. The DCPT value is the number of blows of the hammer required to drive the cone 0.3 m into the soil. The DCPT is used as a probe to assess soil variability.



STRATA PLOT:

Strata plots symbolize the soil and bedrock description. They are combinations of the following basic symbols. The dimensions within the strata symbols are not indicative of the particle size, layer thickness, etc.

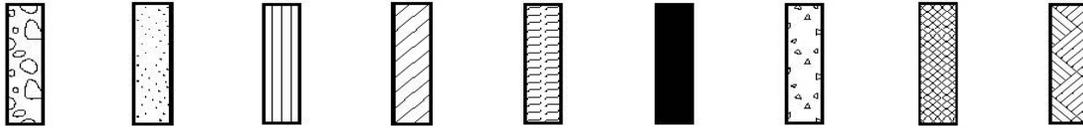

Boulders
Cobbles
Gravel Sand Silt Clay Organics Asphalt Concrete Fill Bedrock

TEXTURING CLASSIFICATION OF SOILS

| Classification | Particle Size |
|----------------|---------------------|
| Boulders | Greater than 200 mm |
| Cobbles | 75 – 200 mm |
| Gravel | 4.75 – 75 mm |
| Sand | 0.075 – 4.75 mm |
| Silt | 0.002 – 0.075 mm |
| Clay | Less than 0.002 mm |

SAMPLE TYPES

| | |
|-----------------|--|
| SS | Split spoon samples |
| ST | Shelby tube or thin wall tube |
| DP | Direct push sample |
| PS | Piston sample |
| BS | Bulk sample |
| WS | Wash sample |
| HQ, NQ, BQ etc. | Rock core sample obtained with the use of standard size diamond coring equipment |

TERMS DESCRIBING CONSISTENCY (COHESIVE SOILS ONLY)

| Descriptive Term | Undrained Shear Strength (kPa) |
|------------------|--------------------------------|
| Very Soft | 12 or less |
| Soft | 12 – 25 |
| Firm | 25 – 50 |
| Stiff | 50 – 100 |
| Very Stiff | 100 – 200 |
| Hard | Greater than 200 |

NOTE: Clay sensitivity is defined as the ratio of the undisturbed strength over the remolded strength.

TERMS DESCRIBING CONSISTENCY (COHESIONLESS SOILS ONLY)

| Descriptive Term | SPT "N" Value |
|------------------|-----------------|
| Very Loose | Less than 4 |
| Loose | 4 – 10 |
| Compact | 10 – 30 |
| Dense | 30 – 50 |
| Very Dense | Greater than 50 |



MODIFIED UNIFIED SOIL CLASSIFICATION

| Major Divisions | | Group Symbol | Typical Description |
|-----------------------------|--|--------------|--|
| COARSE GRAINED SOIL | GRAVEL AND GRAVELLY SOILS | GW | Well-graded gravels or gravel-sand mixtures, little or no fines. |
| | | GP | Poorly-graded gravels or gravel-sand mixtures, little or no fines. |
| | | GM | Silty gravels, gravel-sand-silt mixtures. |
| | | GC | Clayey gravels, gravel-sand-clay mixtures. |
| | SAND AND SANDY SOILS | SW | Well-graded sands or gravelly sands, little or no fines. |
| | | SP | Poorly-graded sands or gravelly sands, little or no fines. |
| | | SM | Silty sands, sand-silt mixtures. |
| | | SC | Clayey sands, sand-clay mixtures. |
| FINE GRAINED SOILS | SILT AND CLAY SOILS $W_L < 35\%$ | ML | Inorganic silts, very fine sands, rock flour, silty or clayey fine sands or clayey silts with slight plasticity. |
| | | CL | Inorganic clays of low to medium plasticity, gravelly clays, sandy clays, silty clays, lean clays. |
| | | OL | Organic silts and organic silty-clays of low plasticity. |
| | SILT AND CLAY SOILS $35\% < W_L < 50\%$ | MI | Inorganic compressible fine sandy silt with clay of medium plasticity, clayey silts. |
| | | CI | Inorganic clays of medium plasticity, silty clays. |
| | | OI | Organic silty clays of medium plasticity. |
| | SILT AND CLAY SOILS $W_L > 50\%$ | MH | Inorganic silts, micaceous or diatomaceous fine sandy of silty soils, elastic silts. |
| | | CH | Inorganic clays of high plasticity, fat clays. |
| | | OH | Organic clays of high plasticity, organic silts. |
| HIGHLY ORGANIC SOILS | | Pt | Peat and other organic soils. |

Note - W_L = Liquid Limit



EXPLANATION OF ROCK LOGGING TERMS

ROCK WEATHERING CLASSIFICATION

| | |
|---------------------------|--|
| Fresh (FR) | No visible signs of weathering. |
| Fresh Jointed (FJ) | Weathering limited to surface of major discontinuities. |
| Slightly Weathered (SW) | Penetrative weathering developed on open discontinuity surfaces, but only slight weathering of rock materials. |
| Moderately Weathered (MW) | Weathering extends throughout the rock mass, but the rock material is not friable. |
| Highly Weathered (HW) | Weathering extends throughout the rock mass and the rock is partly friable. |
| Completely Weathered (CW) | Rock is wholly decomposed and in a friable condition, but the rock texture and structures are preserved. |

TERMS

| | |
|--|--|
| Total Core Recovery: (TCR) | Core recovered as a percentage of total core run length. |
| Solid Core Recovery: (SCR) | Percent ratio of solid core of full cylindrical shape recovered. Expressed with respect to the total length of core run. |
| Rock Quality Designation: (RQD) | Total length of sound core recovered in pieces 0.1 m in length or larger, as a percentage of total core length |
| Unconfined Compressive Strength: (UCS) | Axial stress required to break the specimen. |
| Fracture Index: (FI) | Frequency of natural fractures per 0.3 m of core run. |

DISCONTINUITY SPACING

| Bedding | Bedding Plane Spacing |
|---------------------|-----------------------|
| Very thickly bedded | Greater than 2 m |
| Thickly bedded | 0.6 to 2 m |
| Medium bedded | 0.2 to 0.6 m |
| Thinly bedded | 60 mm to 0.2 m |
| Very thinly bedded | 20 to 60 mm |
| Laminated | 6 to 20 mm |
| Thinly laminated | Less than 6 mm |

STRENGTH CLASSIFICATION

| Rock Strength | Approximate Uniaxial Compressive Strength (MPa) |
|------------------|---|
| Extremely Strong | Greater than 250 |
| Very Strong | 100 – 250 |
| Strong | 50 – 100 |
| Medium Strong | 25 – 50 |
| Weak | 5 – 25 |
| Very Weak | 1 – 5 |
| Extremely Weak | 0.25 – 1 |

RECORD OF BOREHOLE No 15-33

1 OF 2

METRIC

GWP# 545-00-00 LOCATION Culvert 12+739, Highway 17 Goulais River N 5 180 893.5 E 277 324.9 ORIGINATED BY CAM
 HWY 17 BOREHOLE TYPE Portable / Casing COMPILED BY SML
 DATUM Geodetic DATE 2016.01.21 - 2016.01.22 CHECKED BY FJG

| SOIL PROFILE | | | SAMPLES | | | GROUND WATER CONDITIONS | ELEVATION SCALE | DYNAMIC CONE PENETRATION RESISTANCE PLOT | | | PLASTIC LIMIT W _p | NATURAL MOISTURE CONTENT W | LIQUID LIMIT W _L | UNIT WEIGHT γ kN/m ³ | REMARKS & GRAIN SIZE DISTRIBUTION (%) GR SA SI CL |
|--------------|--|------------|---------|------|------------|-------------------------|-----------------|--|--|--|---------------------------------|-------------------------------|--------------------------------|---------------------------------------|--|
| ELEV DEPTH | DESCRIPTION | STRAT PLOT | NUMBER | TYPE | "N" VALUES | | | SHEAR STRENGTH kPa ○ UNCONFINED + FIELD VANE ● QUICK TRIAXIAL × LAB VANE | | | | | | | |
| 241.2 | ROOTMAT (25 mm) | | | | | | | | | | | | | | |
| 240.8 | SILTY SAND Loose Brown Moist | | 1 | SS | 7 | | 241 | | | | | | | | |
| 239.7 | SILTY SANDY CLAY Stiff Greyish brown | | 2 | SS | 6 | | 240 | | | | | | | | |
| 238.8 | SILTY SAND with gravel Compact Brown Moist | | 3 | GS | 18 | | 239 | | | | | | | | |
| 238.8 | SANDY SILT to SAND with silt Compact to very dense Brown to brownish grey Moist | | 4 | SS | 11 | | 238 | | | | | | | 0 44 55 1 | |
| | | | 5 | SS | 30 | | 238 | | | | | | | | |
| | | | 6 | SS | 34 | | 237 | | | | | | | | |
| | | | 7 | SS | 44 | | 237 | | | | | | | | |
| | | | 8 | SS | 45 | | 236 | | | | | | | | |
| | | | 9 | SS | 25 | | 235 | | | | | | | | |
| | | | 10 | SS | 26 | | 235 | | | | | | | | |
| | | | 11 | SS | 34 | | 234 | | | | | | | | |
| | | | 12 | SS | 38 | | 234 | | | | | | | | |
| | | | 13 | SS | 44 | | 233 | | | | | | | | |
| | | | 14 | SS | 54 | | 232 | | | | | | | | |
| | | | 15 | SS | 58 | | 232 | | | | | | | | |

ONTMT4S_19-5308-95.GPJ 2012TEMPLATE(MTO).GDT 9/15/16

Continued Next Page

+³, ×³: Numbers refer to Sensitivity
 20
 15
 10
 (%) STRAIN AT FAILURE

RECORD OF BOREHOLE No 15-33

2 OF 2

METRIC

GWP# 545-00-00 LOCATION Culvert 12+739, Highway 17 Goulais River N 5 180 893.5 E 277 324.9 ORIGINATED BY CAM
 HWY 17 BOREHOLE TYPE Portable / Casing COMPILED BY SML
 DATUM Geodetic DATE 2016.01.21 - 2016.01.22 CHECKED BY FJG

| SOIL PROFILE | | | SAMPLES | | | GROUND WATER CONDITIONS | ELEVATION SCALE | DYNAMIC CONE PENETRATION RESISTANCE PLOT | | | | | UNIT WEIGHT γ kN/m ³ | REMARKS & GRAIN SIZE DISTRIBUTION (%) GR SA SI CL |
|--------------|---|------------|---------|------|------------|--|-----------------|--|--|--|--|--|--|--|
| ELEV DEPTH | DESCRIPTION | STRAT PLOT | NUMBER | TYPE | "N" VALUES | | | SHEAR STRENGTH kPa | | | | | | |
| | Continued From Previous Page | | | | | 20 40 60 80 100 ○ UNCONFINED + FIELD VANE ● QUICK TRIAXIAL × LAB VANE WATER CONTENT (%) 20 40 60 | | | | | | | | |
| | SANDY SILT to SAND with silt Compact to very dense Brown to brownish grey Moist | | 16 | SS | 56 | | | | | | | | | |
| | | | 17 | SS | 84 | | | | | | | | | |
| | | | 18 | SS | 56 | | | | | | | | | |
| | | | 19 | SS | 69 | | | | | | | | | |
| | | | 20 | SS | 60 | | | | | | | | | |
| | | | 21 | SS | 93 | | | | | | | | | |
| 227.8 | | | | | | | 231 | | | | | | | |
| 13.4 | End of Borehole at 13.41 m Borehole Open Upon Completion Borehole Dry Upon Completion | | | | | | 230 | | | | | | | |
| | | | | | | | 229 | | | | | | | |
| | | | | | | | 228 | | | | | | | |

ONTMT4S_19-5308-95.GPJ 2012TEMPLATE(MTO).GDT 9/15/16

+³, ×³: Numbers refer to Sensitivity
 20
 15
 10
 (%) STRAIN AT FAILURE

RECORD OF BOREHOLE No 15-34

1 OF 3

METRIC

GWP# 545-00-00 LOCATION Culvert 12+739, Highway 17 Goulais River N 5 180 904.8 E 277 288.2 ORIGINATED BY JAG
 HWY 17 BOREHOLE TYPE Hollow Stem Auger COMPILED BY SML
 DATUM Geodetic DATE 2016.01.22 - 2016.01.22 CHECKED BY FJG

| SOIL PROFILE | | | SAMPLES | | | GROUND WATER CONDITIONS | ELEVATION SCALE | DYNAMIC CONE PENETRATION RESISTANCE PLOT | | | PLASTIC LIMIT W _p | NATURAL MOISTURE CONTENT W | LIQUID LIMIT W _L | UNIT WEIGHT γ kN/m ³ | REMARKS & GRAIN SIZE DISTRIBUTION (%) GR SA SI CL | |
|--------------|--|-------------------------|---|-------------------------|------------|-------------------------|-----------------|--|----|----|---------------------------------|-------------------------------|--------------------------------|---------------------------------------|--|-----------------|
| ELEV DEPTH | DESCRIPTION | STRAT PLOT | NUMBER | TYPE | "N" VALUES | | | 20 | 40 | 60 | | | | | | 80 |
| 249.9 0.0 | Sand with silt some gravel Dense Brown Moist FILL | [Cross-hatched pattern] | 1 | AS | | | | | | | | | | | | |
| | | | 2 | SS | 49 | | | | | | | | | | | 12 79 9 (SI+CL) |
| 248.4 1.5 | Sand with silt and gravel Compact Brown Moist FILL | [Cross-hatched pattern] | 3 | SS | 10 | | | | | | | | | | | |
| | | | 4 | SS | 14 | | | | | | | | | | | |
| 246.7 3.2 | Clay to Silty Clay, layered, trace organics Very Stiff Reddish Brown Moist FILL | [Cross-hatched pattern] | 5 | SS | 4 | | | | | | | | | | | |
| | | | 6 | SS | 11 | | | | | | | | | | | 0 4 75 21 |
| | | | 7 | SS | 11 | | | | | | | | | | | |
| | | | 8 | SS | 12 | | | | | | | | | | | |
| | | | 9 | SS | 18 | | | | | | | | | | | 0 4 85 11 |
| | | | 10 | SS | 10 | | | | | | | | | | | |
| | | | 11 | SS | 11 | | | | | | | | | | | |
| | | | 12 | SS | 11 | | | | | | | | | | | |
| | | | 13 | SS | 14 | | | | | | | | | | | |
| 240.5 9.3 | | | SAND with silt to SILTY SAND Loose to dense Brown to greyish brown Moist | [Cross-hatched pattern] | | | | | | | | | | | | |

ONTMT4S 19-5308-95.GPJ 2012TEMPLATE(MTO).GDT 9/15/16

Continued Next Page

+³, ×³: Numbers refer to Sensitivity
 20
 15
 10
 (%) STRAIN AT FAILURE

RECORD OF BOREHOLE No 15-34

2 OF 3

METRIC

GWP# 545-00-00 LOCATION Culvert 12+739, Highway 17 Goulais River N 5 180 904.8 E 277 288.2 ORIGINATED BY JAG
 HWY 17 BOREHOLE TYPE Hollow Stem Auger COMPILED BY SML
 DATUM Geodetic DATE 2016.01.22 - 2016.01.22 CHECKED BY FJG

| SOIL PROFILE | | | SAMPLES | | | GROUND WATER CONDITIONS | ELEVATION SCALE | DYNAMIC CONE PENETRATION RESISTANCE PLOT | | | PLASTIC LIMIT W _p | NATURAL MOISTURE CONTENT W | LIQUID LIMIT W _L | UNIT WEIGHT γ kN/m ³ | REMARKS & GRAIN SIZE DISTRIBUTION (%) GR SA SI CL |
|--------------|---|------------|---------|------|------------|-------------------------|-----------------|--|--|--|---------------------------------|-------------------------------|--------------------------------|---------------------------------------|--|
| ELEV DEPTH | DESCRIPTION | STRAT PLOT | NUMBER | TYPE | "N" VALUES | | | SHEAR STRENGTH kPa ○ UNCONFINED + FIELD VANE ● QUICK TRIAXIAL × LAB VANE | | | | | | | |
| | Continued From Previous Page | | | | | | | | | | | | | | |
| | SAND with silt to SILTY SAND Loose to dense Brown to greyish brown Moist | | 14 | SS | 9 | | | | | | | | | | |
| | | | 15 | SS | 4 | | 239 | | | | | | | 3 69 28 (SI+CL) | |
| | | | 16 | SS | 16 | | 238 | | | | | | | | |
| | | | 17 | SS | 21 | | 237 | | | | | | | | |
| | | | 18 | SS | 22 | | | | | | | | | | |
| | | | 19 | SS | 20 | | 236 | | | | | | | 0 90 10 (SI+CL) | |
| | | | 20 | SS | 30 | | 234 | | | | | | | | |
| | | | 21 | SS | 35 | | 233 | | | | | | | | |
| | | | 22 | SS | 26 | | 231 | | | | | | | | |
| | | | | | | | 230 | | | | | | | | |

Continued Next Page

+³, ×³: Numbers refer to Sensitivity
 20
 15
 10
 (%) STRAIN AT FAILURE

ONTMT4S_19-5308-95.GPJ 2012TEMPLATE(MTO).GDT 9/15/16

RECORD OF BOREHOLE No 15-34

3 OF 3

METRIC

GWP# 545-00-00 LOCATION Culvert 12+739, Highway 17 Goulais River N 5 180 904.8 E 277 288.2 ORIGINATED BY JAG
 HWY 17 BOREHOLE TYPE Hollow Stem Auger COMPILED BY SML
 DATUM Geodetic DATE 2016.01.22 - 2016.01.22 CHECKED BY FJG

| SOIL PROFILE | | | SAMPLES | | | GROUND WATER CONDITIONS | ELEVATION SCALE | DYNAMIC CONE PENETRATION RESISTANCE PLOT | | | | | PLASTIC LIMIT | NATURAL MOISTURE CONTENT | LIQUID LIMIT | UNIT WEIGHT γ kN/m ³ | REMARKS & GRAIN SIZE DISTRIBUTION (%) |
|---------------|--|------------|---------|------|------------|----------------------------|-----------------|---|----|----|----|-----|------------------|--------------------------------|-----------------|---|---|
| ELEV DEPTH | DESCRIPTION | STRAT PLOT | NUMBER | TYPE | "N" VALUES | | | 20 | 40 | 60 | 80 | 100 | | | | | |
| | Continued From Previous Page | | 23 | SS | 37 | | | | | | | | | | | | |
| | | | | | | | 229 | | | | | | | | | | |
| | | | 24 | SS | 17 | | | | | | | | | | | 0 86 14 (SI+CL) | |
| 227.9 21.9 | End of Borehole at 21.95 m Borehole Open to 20.4 m Upon Completion Borehole Dry Upon Completion | | | | | | 228 | | | | | | | | | | |

ONTMT4S_19-5308-95.GPJ 2012TEMPLATE(MTO).GDT 9/15/16

+³, ×³: Numbers refer to Sensitivity 20
15
10 (%) STRAIN AT FAILURE

RECORD OF BOREHOLE No 15-35

2 OF 3

METRIC

GWP# 545-00-00 LOCATION Culvert 12+739, Highway 17 Goulais River N 5 180 930.4 E 277 275.8 ORIGINATED BY JAG
 HWY 17 BOREHOLE TYPE Hollow Stem Auger COMPILED BY SML
 DATUM Geodetic DATE 2016.01.23 - 2016.01.23 CHECKED BY FJG

| SOIL PROFILE | | SAMPLES | | | GROUND WATER CONDITIONS | ELEVATION SCALE | DYNAMIC CONE PENETRATION RESISTANCE PLOT | | | PLASTIC LIMIT W _p | NATURAL MOISTURE CONTENT W | LIQUID LIMIT W _L | UNIT WEIGHT γ kN/m ³ | REMARKS & GRAIN SIZE DISTRIBUTION (%) GR SA SI CL |
|---------------|--|---------|------|------------|----------------------------|-----------------|---|--|--|------------------------------------|-------------------------------------|-----------------------------------|---|--|
| ELEV DEPTH | DESCRIPTION | NUMBER | TYPE | "N" VALUES | | | SHEAR STRENGTH kPa 20 40 60 80 100 | | | | | | | |
| | Continued From Previous Page | | | | | | | | | | | | | |
| | SILT some sand to SILTY SAND Compact to dense Brown Moist | 12 | SS | 12 | | | | | | | | | | |
| | | 13 | SS | 16 | | 240 | | | | | | | | |
| | | 14 | SS | 14 | | 239 | | | | | | | 0 | 43 54 3 |
| | | 15 | SS | 21 | | 238 | | | | | | | | |
| | | 16 | SS | 19 | | 237 | | | | | | | | |
| | | 17 | SS | 41 | | 235 | | | | | | | | |
| | | 18 | SS | 28 | | 234 | | | | | | | 0 | 86 14 (SI+CL) |
| | | 19 | SS | 31 | | 232 | | | | | | | | |
| | | | | | | 231 | | | | | | | | |

ONTMT4S_19-5308-95.GPJ 2012TEMPLATE(MTO).GDT 9/15/16

Continued Next Page

+³, ×³: Numbers refer to Sensitivity
 20
 15
 10
 (%) STRAIN AT FAILURE

RECORD OF BOREHOLE No 15-35

3 OF 3

METRIC

GWP# 545-00-00 LOCATION Culvert 12+739, Highway 17 Goulais River N 5 180 930.4 E 277 275.8 ORIGINATED BY JAG
 HWY 17 BOREHOLE TYPE Hollow Stem Auger COMPILED BY SML
 DATUM Geodetic DATE 2016.01.23 - 2016.01.23 CHECKED BY FJG

| SOIL PROFILE | | | SAMPLES | | | GROUND WATER CONDITIONS | ELEVATION SCALE | DYNAMIC CONE PENETRATION RESISTANCE PLOT | | | | | PLASTIC LIMIT | NATURAL MOISTURE CONTENT | LIQUID LIMIT | UNIT WEIGHT γ kN/m ³ | REMARKS & GRAIN SIZE DISTRIBUTION (%) GR SA SI CL |
|---------------|---|------------|---------|------|------------|----------------------------|-----------------|---|----|----|----|-----|------------------|--------------------------------|-----------------|--|--|
| ELEV DEPTH | DESCRIPTION | STRAT PLOT | NUMBER | TYPE | "N" VALUES | | | 20 | 40 | 60 | 80 | 100 | | | | | |
| 230.3 20.4 | <p>Continued From Previous Page</p> <p>SILT some sand to SILTY SAND Compact to dense Brown Moist</p> <p>End of Borehole at 20.42 m Borehole Open Upon Completion Borehole Dry Upon Completion</p> | | 20 | SS | 27 | | | | | | | | | | | | |

ONTMT4S_19-5308-95.GPJ 2012TEMPLATE(MTO).GDT 9/15/16

+³, ×³: Numbers refer to Sensitivity 20
15 5
10 (%) STRAIN AT FAILURE

RECORD OF BOREHOLE No 15-36

1 OF 2

METRIC

GWP# 545-00-00 LOCATION Culvert 12+739, Highway 17 Goulais River N 5 180 942.0 E 277 233.9 ORIGINATED BY CAM
 HWY 17 BOREHOLE TYPE Portable / Casing COMPILED BY SML
 DATUM Geodetic DATE 2016.01.20 - 2016.01.20 CHECKED BY FJG

| SOIL PROFILE | | | SAMPLES | | | GROUND WATER CONDITIONS | ELEVATION SCALE | DYNAMIC CONE PENETRATION RESISTANCE PLOT | | | PLASTIC LIMIT W _p | NATURAL MOISTURE CONTENT W | LIQUID LIMIT W _L | UNIT WEIGHT γ kN/m ³ | REMARKS & GRAIN SIZE DISTRIBUTION (%) |
|--------------|---|------------|---------|------|------------|-------------------------|-----------------|--|----|----|---------------------------------|-------------------------------|--------------------------------|---------------------------------------|---------------------------------------|
| ELEV DEPTH | DESCRIPTION | STRAT PLOT | NUMBER | TYPE | "N" VALUES | | | 20 | 40 | 60 | | | | | |
| 242.5 | TOPSOIL (25 mm) | | | | | | | | | | | | | | |
| 0.0 | SILTY SAND some organics, trace clay Loose Brown Moist to Wet | | 1 | SS | 6 | | | | | | | | | | |
| 241.5 | | | 2 | SS | 8 | | | | | | | | | | |
| 0.9 | SILTY SANDY CLAY , occasional sandy silt layers Stiff Greyish brown | | 3 | SS | 3 | | | | | | | | | 1 27 53 19 | |
| 240.3 | | | | | | | | | | | | | | 0 40 51 9 | |
| 2.1 | SILTY SAND with gravel Compact Grey Wet | | 4 | SS | 16 | | | | | | | | | | |
| 239.7 | | | 5 | SS | 23 | | | | | | | | | | |
| 2.7 | SILTY SAND to SAND with silt Compact to Very Dense Light Brown to Brown Moist to wet | | 6 | SS | 33 | | | | | | | | | | |
| | | | 7 | SS | 76 | | | | | | | | | | |
| | | | 8 | SS | 34 | | | | | | | | | | |
| | | | 9 | SS | 28 | | | | | | | | | | |
| | | | 10 | SS | 32 | | | | | | | | | | |
| | | | 11 | SS | 39 | | | | | | | | | | |
| | | | 12 | SS | 32 | | | | | | | | | | |
| | | | 13 | SS | 34 | | | | | | | | | | |
| | | | 14 | SS | 49 | | | | | | | | | 0 93 7 (SI+CL) | |
| | | | 15 | SS | 79 | | | | | | | | | | |
| | | | 16 | SS | 100/ | | | | | | | | | | |

ONTMT4S_19-5308-95.GPJ 2012TEMPLATE(MTO).GDT 9/15/16

Continued Next Page

+³, ×³: Numbers refer to Sensitivity
 20
 15
 10
 (%) STRAIN AT FAILURE

RECORD OF BOREHOLE No 15-36

2 OF 2

METRIC

GWP# 545-00-00 LOCATION Culvert 12+739, Highway 17 Goulais River N 5 180 942.0 E 277 233.9 ORIGINATED BY CAM
 HWY 17 BOREHOLE TYPE Portable / Casing COMPILED BY SML
 DATUM Geodetic DATE 2016.01.20 - 2016.01.20 CHECKED BY FJG

| SOIL PROFILE | | | SAMPLES | | | GROUND WATER CONDITIONS | ELEVATION SCALE | DYNAMIC CONE PENETRATION RESISTANCE PLOT | | | | | PLASTIC LIMIT | NATURAL MOISTURE CONTENT | LIQUID LIMIT | UNIT WEIGHT γ kN/m ³ | REMARKS & GRAIN SIZE DISTRIBUTION (%) GR SA SI CL |
|---------------|--|------------|---------|------|------------|----------------------------|-----------------|---|----|----|----|-----|------------------|--------------------------------|-----------------|---|--|
| ELEV DEPTH | DESCRIPTION | STRAT PLOT | NUMBER | TYPE | "N" VALUES | | | 20 | 40 | 60 | 80 | 100 | | | | | |
| 232.1 | Continued From Previous Page | | | | 25 mm | | | | | | | | | | | | |
| 10.3 | <p>SILTY SAND to SAND with silt Compact to Very Dense Light Brown to Brown Moist to wet End of Borehole at 10.31 m Borehole Dry Upon Completion Water level at 2.2 m on 2016.01.21 Borehole Open to 2.7 m on 2016.01.21 Completion</p> | | | | | | | | | | | | | | | | |

ONTMT4S_19-5308-95.GPJ 2012TEMPLATE(MTO).GDT 9/15/16

+³, ×³: Numbers refer to Sensitivity 20
15 5
10 (%) STRAIN AT FAILURE

Appendix C


Laboratory Test Results

19-5308-95

Culvert 12+739, Highway 17 Goulais River
GRAIN SIZE DISTRIBUTION

FIGURE 1

Sand Fill

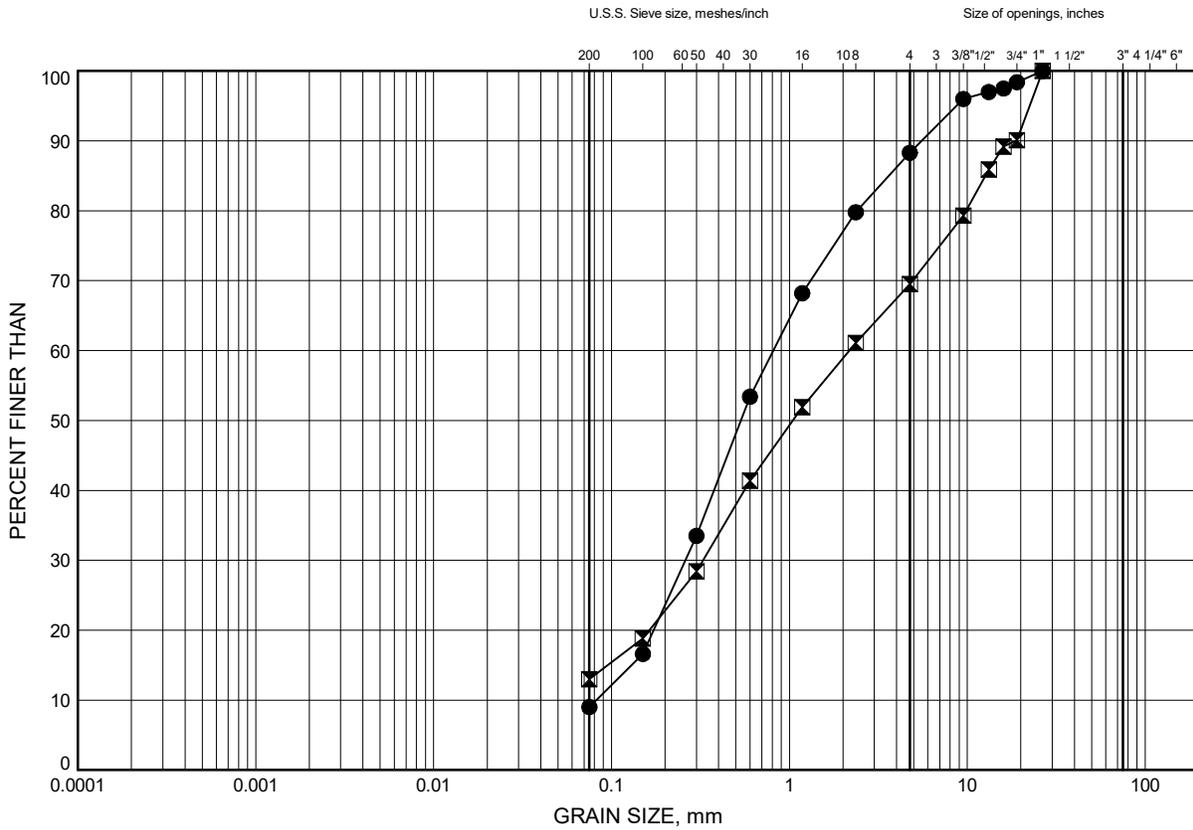

| | | | | | | |
|---------------|------|--------|--------|--------|--------|----------------|
| SILT and CLAY | FINE | MEDIUM | COARSE | FINE | COARSE | COBBLE SIZE |
| FINE GRAINED | SAND | | | GRAVEL | | |

LEGEND

| SYMBOL | BOREHOLE | DEPTH (m) | ELEV. (m) |
|--------|----------|-----------|-----------|
| ● | 15-34 | 1.07 | 248.82 |
| ⊠ | 15-35 | 1.07 | 249.70 |

GRAIN SIZE DISTRIBUTION - THURBER 19-5308-95.GPJ 9/20/16

Date .. September 2016 ..
 GWP# .. 545-00-00 ..




Prep'd .. JAG ..
 Chkd. .. FJG ..

Culvert 12+739, Highway 17 Goulais River
GRAIN SIZE DISTRIBUTION

FIGURE 2

Embankment Clay Fill

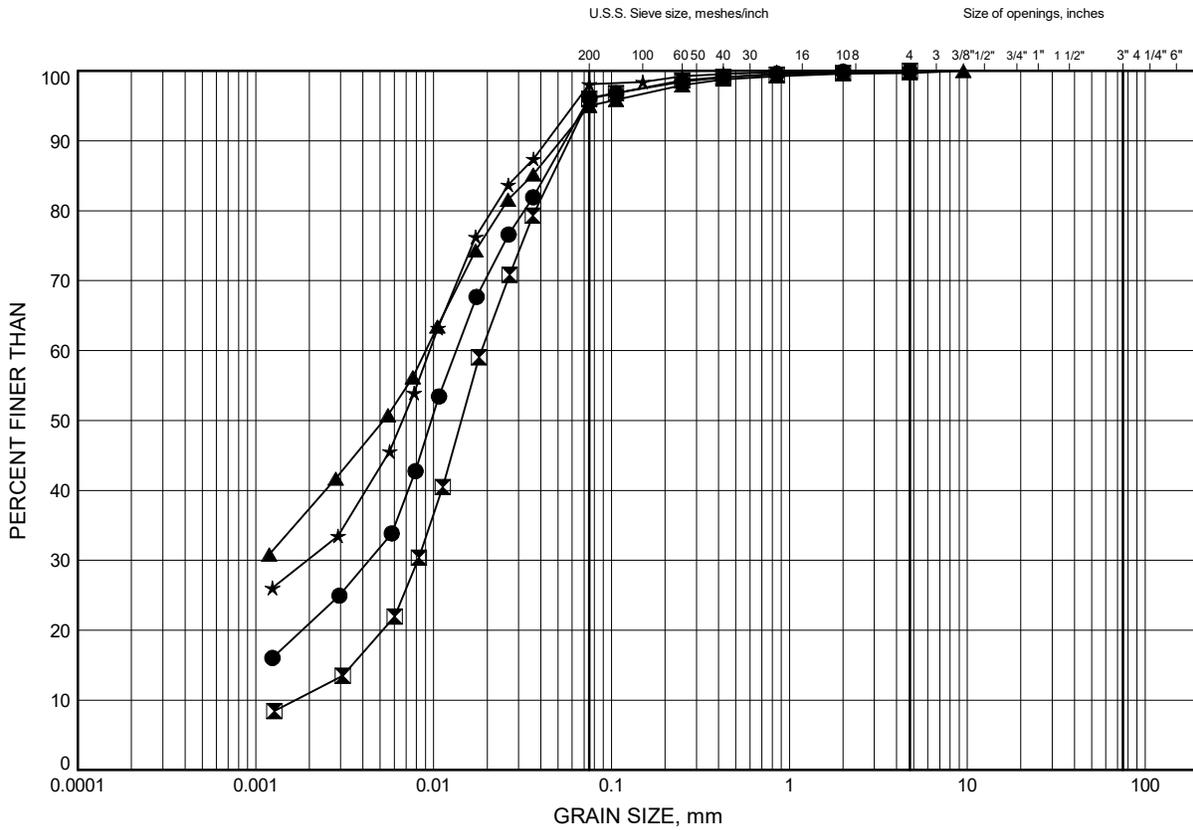

| | | | | | | |
|---------------|------|--------|--------|--------|--------|----------------|
| SILT and CLAY | FINE | MEDIUM | COARSE | FINE | COARSE | COBBLE SIZE |
| FINE GRAINED | SAND | | | GRAVEL | | |

LEGEND

| SYMBOL | BOREHOLE | DEPTH (m) | ELEV. (m) |
|--------|----------|-----------|-----------|
| ● | 15-34 | 4.11 | 245.77 |
| ⊠ | 15-34 | 6.40 | 243.49 |
| ▲ | 15-34 | 7.92 | 241.96 |
| ★ | 15-35 | 7.92 | 242.84 |

GRAIN SIZE DISTRIBUTION - THURBER 19-5308-95.GPJ 9/20/16

Date .. September 2016 ..
 GWP# .. 545-00-00 ..




Prep'd .. JAG ..
 Chkd. .. FJG ..

Culvert 12+739, Highway 17 Goulais River
GRAIN SIZE DISTRIBUTION

FIGURE 3

Silty Sandy CLAY

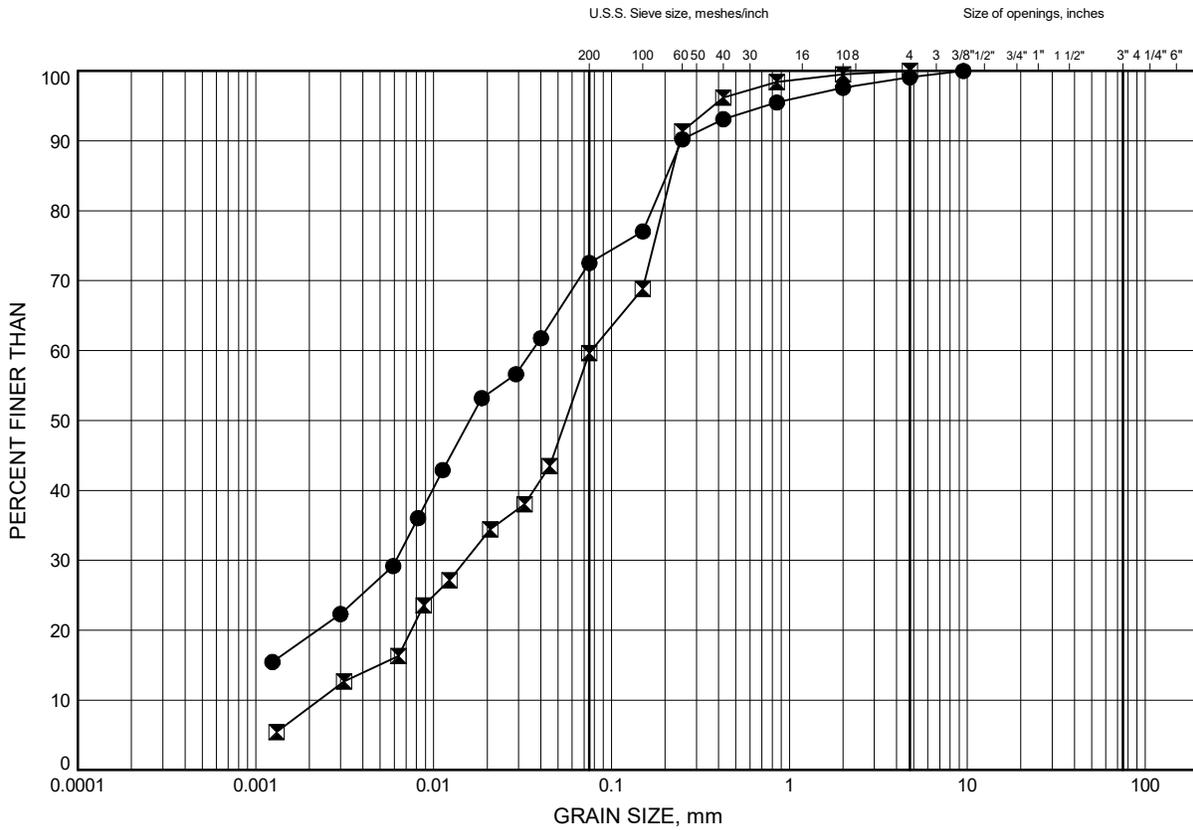

| | | | | | | |
|---------------|------|--------|--------|--------|--------|----------------|
| SILT and CLAY | FINE | MEDIUM | COARSE | FINE | COARSE | COBBLE SIZE |
| FINE GRAINED | SAND | | | GRAVEL | | |

LEGEND

| SYMBOL | BOREHOLE | DEPTH (m) | ELEV. (m) |
|--------|----------|-----------|-----------|
| ● | 15-36 | 1.07 | 241.39 |
| ☒ | 15-36 | 1.52 | 240.93 |

GRAIN SIZE DISTRIBUTION - THURBER 19-5308-95.GPJ 9/20/16

Date .. September 2016 ..
 GWP# .. 545-00-00 ..




Prep'd .. JAG ..
 Chkd. .. FJG ..

Culvert 12+739, Highway 17 Goulais River
GRAIN SIZE DISTRIBUTION

FIGURE 4

SILT some Sand

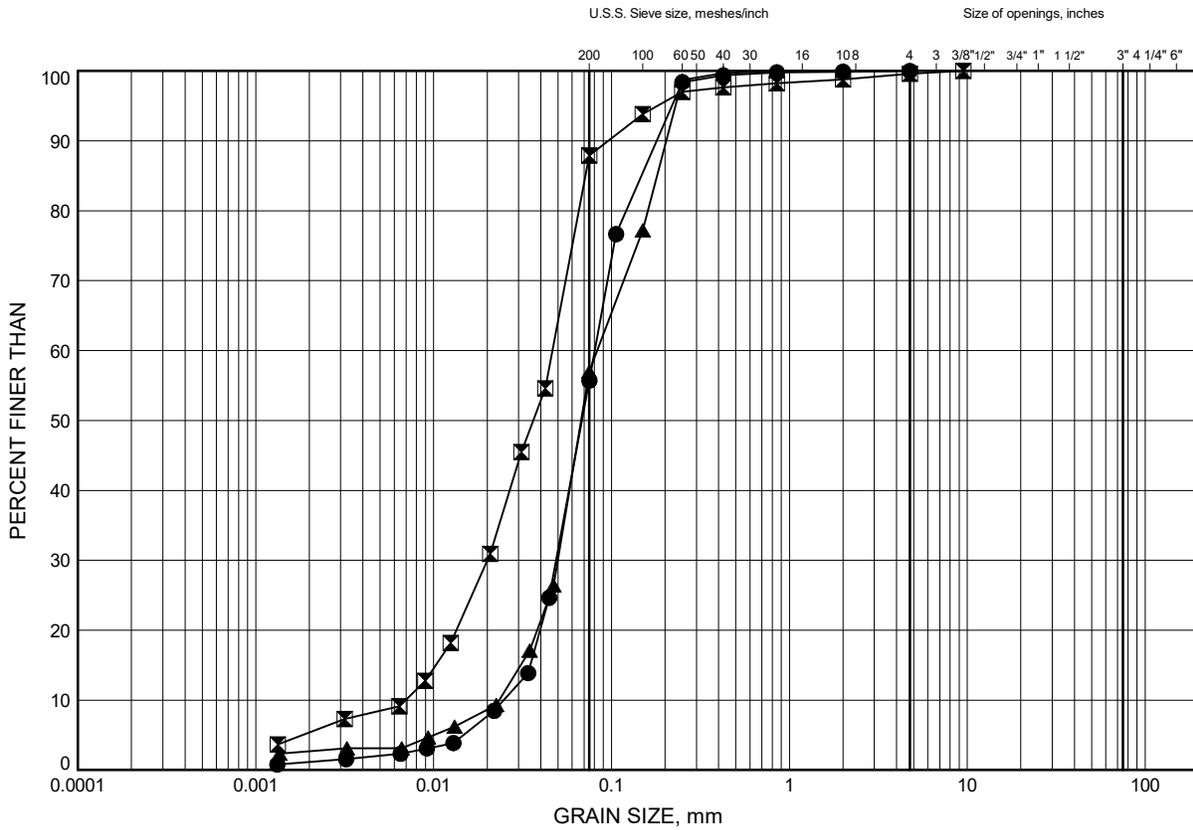

| | | | | | | |
|---------------|------|--------|--------|--------|--------|----------------|
| SILT and CLAY | FINE | MEDIUM | COARSE | FINE | COARSE | COBBLE SIZE |
| FINE GRAINED | SAND | | | GRAVEL | | |

LEGEND

| SYMBOL | BOREHOLE | DEPTH (m) | ELEV. (m) |
|--------|----------|-----------|-----------|
| ● | 15-33 | 2.90 | 238.33 |
| ⊠ | 15-35 | 9.45 | 241.31 |
| ▲ | 15-35 | 11.73 | 239.03 |

GRAIN SIZE DISTRIBUTION - THURBER 19-5308-95.GPJ 9/20/16

Date .. September 2016 ..
 GWP# .. 545-00-00 ..




Prep'd .. JAG ..
 Chkd. .. FJG ..

Culvert 12+739, Highway 17 Goulais River
GRAIN SIZE DISTRIBUTION

FIGURE 5

SAND with Silt

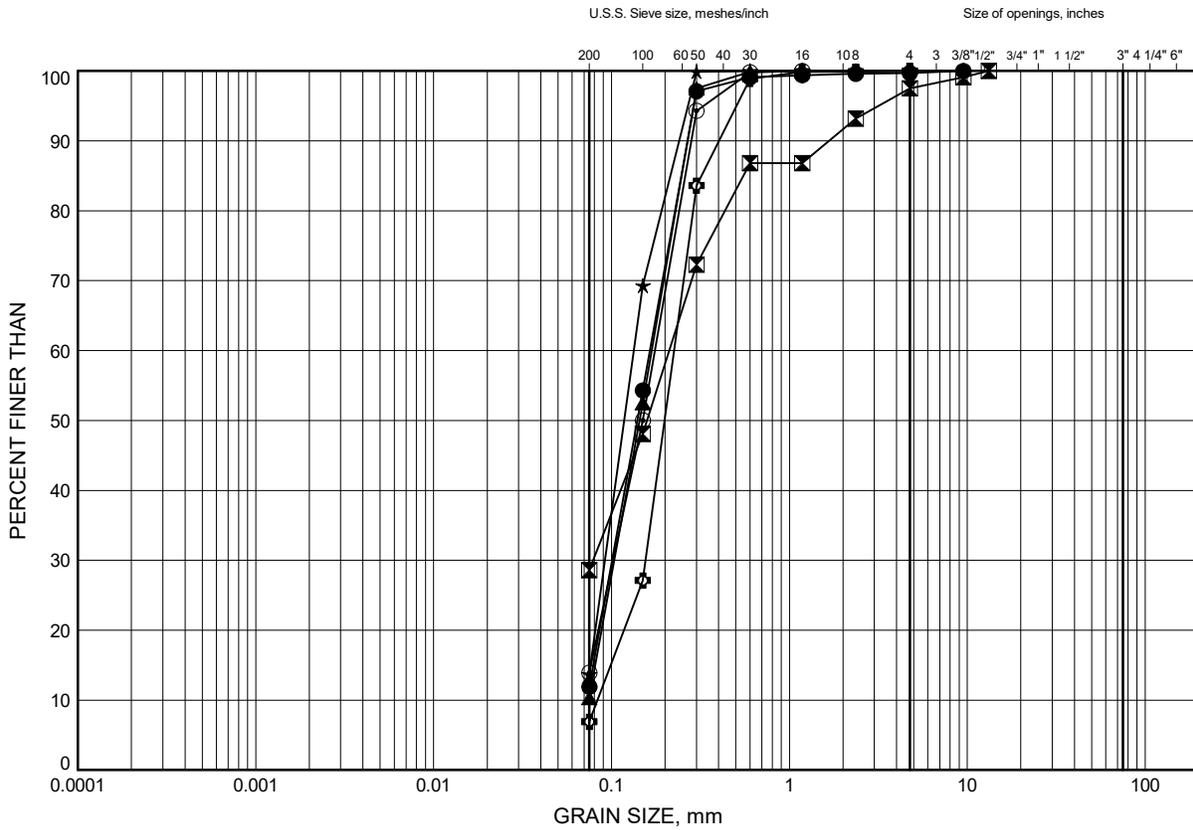

| | | | | | | |
|---------------|------|--------|--------|--------|--------|----------------|
| SILT and CLAY | FINE | MEDIUM | COARSE | FINE | COARSE | COBBLE SIZE |
| FINE GRAINED | SAND | | | GRAVEL | | |

LEGEND

| SYMBOL | BOREHOLE | DEPTH (m) | ELEV. (m) |
|--------|----------|-----------|-----------|
| ● | 15-33 | 6.40 | 234.82 |
| ⊠ | 15-34 | 10.97 | 238.91 |
| ▲ | 15-34 | 14.02 | 235.87 |
| ★ | 15-34 | 21.64 | 228.25 |
| ⊕ | 15-35 | 17.07 | 233.69 |
| ⊕ | 15-36 | 8.84 | 233.62 |


Date .. September 2016 ..
 GWP# .. 545-00-00 ..



Prep'd .. JAG ..
 Chkd. .. FJG ..

Culvert 12+739, Highway 17 Goulais River
ATTERBERG LIMITS TEST RESULTS

FIGURE 6

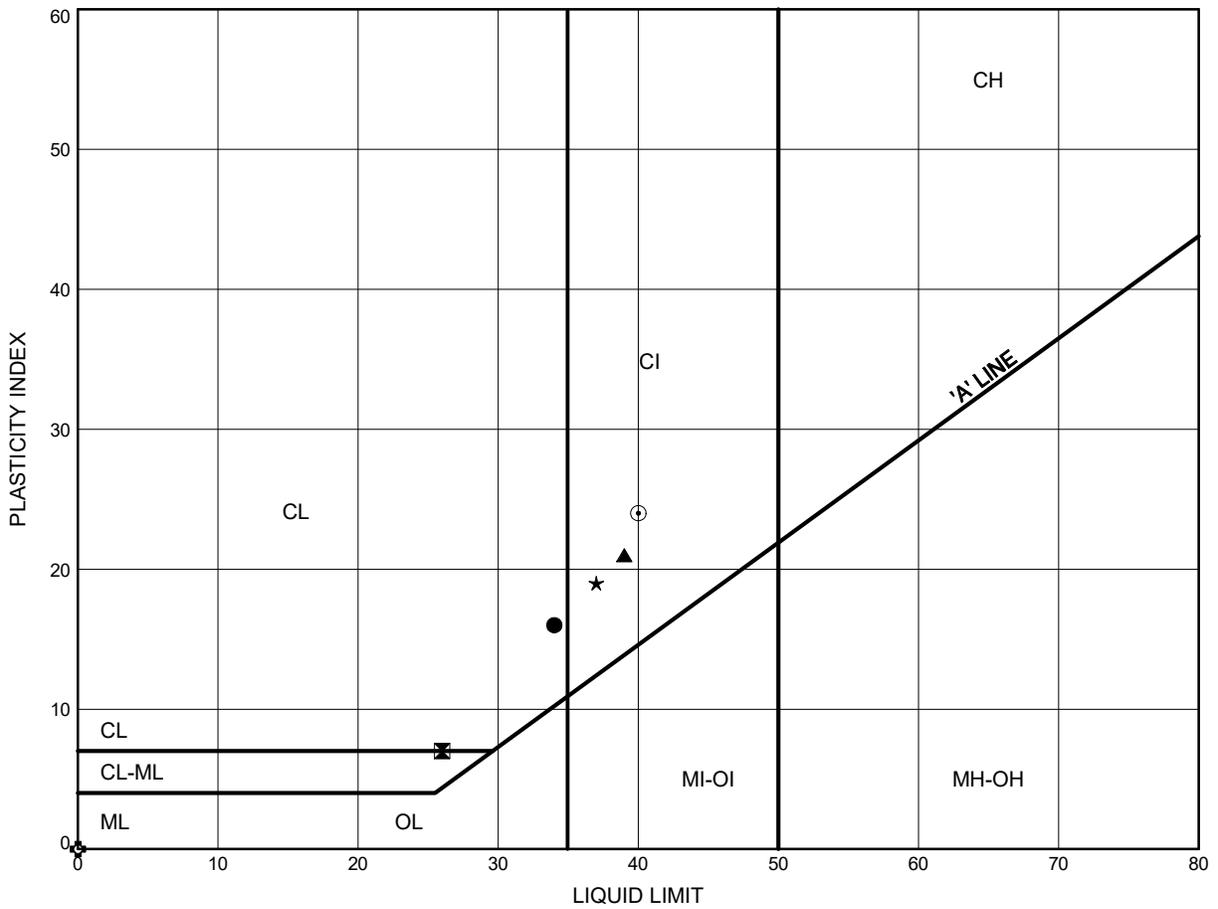

LEGEND

| SYMBOL | BOREHOLE | DEPTH (m) | ELEV. (m) |
|--------|----------|-----------|-----------|
| ● | 15-34 | 4.11 | 245.77 |
| ⊠ | 15-34 | 6.40 | 243.49 |
| ▲ | 15-34 | 7.92 | 241.96 |
| ★ | 15-35 | 7.92 | 242.84 |
| ⊙ | 15-36 | 1.07 | 241.39 |
| ⊕ | 15-36 | 1.52 | 240.93 |

THURBALT 19-5308-95.GPJ 9/20/16

Date . September 2016 .
 GWP# . 545-00-00 .



Prep'd . JAG .
 Chkd. . FJG .

Certificate of Analysis

Thurber Engineering Ltd.

2460 Lancaster Rd, Suite 104
Ottawa, ON K1B4S5
Attn: Shawn Lapain

Client PO:
Project: 19-5308-95
Custody: 27346

Report Date: 4-Feb-2016
Order Date: 29-Jan-2016

Order #: 1605367

This Certificate of Analysis contains analytical data applicable to the following samples as submitted:

| Parcel ID | Client ID |
|------------------|-------------------------|
| 1605367-01 | BH15-23 SS11 (25'-27') |
| 1605367-02 | BH15-3 SS8 (20'-22') |
| 1605367-03 | BH15-32 SS3 (4'-6') |
| 1605367-04 | BH15-33 GS3 (2.5'-3.5') |

Approved By:



Dale Robertson, BSc
Laboratory Director

Certificate of Analysis

Report Date: 04-Feb-2016

Client: **Thurber Engineering Ltd.**

Order Date: 29-Jan-2016

Client PO:

Project Description: 19-5308-95

Analysis Summary Table

| Analysis | Method Reference/Description | Extraction Date | Analysis Date |
|--------------|--|-----------------|---------------|
| Anions | EPA 300.1 - IC, water extraction | 3-Feb-16 | 3-Feb-16 |
| Conductivity | MOE E3138 - probe @25 °C, water ext | 2-Feb-16 | 3-Feb-16 |
| pH, soil | EPA 150.1 - pH probe @ 25 °C, CaCl buffered ext. | 1-Feb-16 | 1-Feb-16 |
| Resistivity | EPA 120.1 - probe, water extraction | 2-Feb-16 | 2-Feb-16 |
| Solids, % | Gravimetric, calculation | 30-Jan-16 | 30-Jan-16 |

Certificate of Analysis

Report Date: 04-Feb-2016

 Client: **Thurber Engineering Ltd.**

Order Date: 29-Jan-2016

Client PO:

Project Description: 19-5308-95

| | | | | |
|---------------------|---------------------------|-------------------------|---------------------|----------------------------|
| Client ID: | BH15-23 SS11 (25'-27') | BH15-3 SS8 (20'-22') | BH15-32 SS3 (4'-6') | BH15-33 GS3 (2.5'-3.5') |
| Sample Date: | 07-Jan-16 | 18-Jan-16 | 18-Jan-16 | 21-Jan-16 |
| Sample ID: | 1605367-01 | 1605367-02 | 1605367-03 | 1605367-04 |
| MDL/Units | Soil | Soil | Soil | Soil |

Physical Characteristics

| | | | | | |
|----------|--------------|------|------|------|------|
| % Solids | 0.1 % by Wt. | 85.0 | 84.7 | 79.0 | 85.3 |
|----------|--------------|------|------|------|------|

General Inorganics

| | | | | | |
|--------------|---------------|------|------|------|------|
| Conductivity | 5 uS/cm | 1400 | 138 | 114 | 108 |
| pH | 0.05 pH Units | 6.14 | 6.11 | 5.34 | 5.70 |
| Resistivity | 0.10 Ohm.m | 7.17 | 72.4 | 87.8 | 92.3 |

Anions

| | | | | | |
|----------|------------|-----|----|----|----|
| Chloride | 5 ug/g dry | 747 | 73 | 61 | 14 |
| Sulphate | 5 ug/g dry | 22 | 11 | 11 | 17 |

Certificate of Analysis

Report Date: 04-Feb-2016

 Client: **Thurber Engineering Ltd.**

Order Date: 29-Jan-2016

Client PO:

Project Description: 19-5308-95
Method Quality Control: Blank

| Analyte | Result | Reporting Limit | Units | Source Result | %REC | %REC Limit | RPD | RPD Limit | Notes |
|---------------------------|--------|-----------------|-------|---------------|------|------------|-----|-----------|-------|
| Anions | | | | | | | | | |
| Chloride | ND | 5 | ug/g | | | | | | |
| Sulphate | ND | 5 | ug/g | | | | | | |
| General Inorganics | | | | | | | | | |
| Conductivity | ND | 5 | uS/cm | | | | | | |
| Resistivity | ND | 0.10 | Ohm.m | | | | | | |

Certificate of Analysis
 Client: **Thurber Engineering Ltd.**
 Client PO:

Report Date: 04-Feb-2016
 Order Date: 29-Jan-2016
Project Description: 19-5308-95

Method Quality Control: Duplicate

| Analyte | Result | Reporting Limit | Units | Source Result | %REC | %REC Limit | RPD | RPD Limit | Notes |
|---------------------------------|--------|-----------------|----------|---------------|------|------------|------|-----------|-------|
| Anions | | | | | | | | | |
| Chloride | 8.7 | 5 | ug/g dry | 8.4 | | | 2.5 | 20 | |
| Sulphate | 298 | 5 | ug/g dry | 335 | | | 11.5 | 20 | |
| General Inorganics | | | | | | | | | |
| Conductivity | 749 | 5 | uS/cm | 758 | | | 1.3 | 6.2 | |
| pH | 7.76 | 0.05 | pH Units | 7.79 | | | 0.4 | 10 | |
| Physical Characteristics | | | | | | | | | |
| % Solids | 77.8 | 0.1 | % by Wt. | 78.6 | | | 1.0 | 25 | |

Certificate of Analysis

Report Date: 04-Feb-2016

 Client: **Thurber Engineering Ltd.**

Order Date: 29-Jan-2016

Client PO:

Project Description: 19-5308-95
Method Quality Control: Spike

| Analyte | Result | Reporting Limit | Units | Source Result | %REC | %REC Limit | RPD | RPD Limit | Notes |
|---------------|--------|-----------------|-------|---------------|------|------------|-----|-----------|-------|
| Anions | | | | | | | | | |
| Chloride | 10.3 | | mg/L | 0.8 | 94.3 | 78-113 | | | |
| Sulphate | 41.8 | | mg/L | 33.5 | 83.3 | 78-111 | | | |

Certificate of Analysis

Report Date: 04-Feb-2016

Client: **Thurber Engineering Ltd.**

Order Date: 29-Jan-2016

Client PO:

Project Description: 19-5308-95

Qualifier Notes:

None

Sample Data Revisions

None

Work Order Revisions / Comments:

None

Other Report Notes:

n/a: not applicable

ND: Not Detected

MDL: Method Detection Limit

Source Result: Data used as source for matrix and duplicate samples

%REC: Percent recovery.

RPD: Relative percent difference.

Soil results are reported on a dry weight basis when the units are denoted with 'dry'.

Where %Solids is reported, moisture loss includes the loss of volatile hydrocarbons.

Appendix D

Selected Photographs

19-5308-95

Photo 1: West side – inlet of culvert



Photo 2: East side – outlet of culvert



Photo 3: Looking west towards culvert inlet.



Photo 4: Looking east towards culvert outlet.



Photo 5: Looking north towards culvert crossing.

